

VEHICLE DETAIL

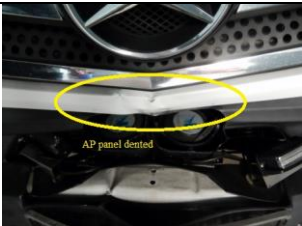
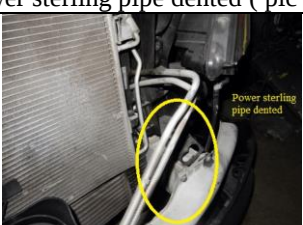
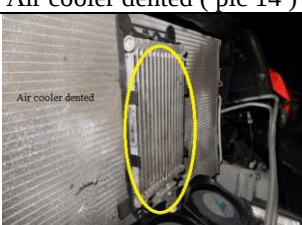
Vehicle No	QX 1609 K	SCDF Ref. No.	ACC-IND-21-16
Date Booked In			

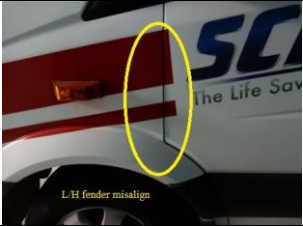
REPAIR DESCRIPTIONS

- 1) Remove & replace dented bonnet (pic 1,2)
- 2) Remove & replace radiator grill (pic 3)
- 3) Remove & replace AP panel (pic 4)
- 4) Remove & replace front bumper (pic 5,6)
- 5) Replace front bumper retainer (pic 5,6)
- 6) Replace front bumper step board (pic 5,6)
- 7) Remove & replace front bumper support (pic 7)
- 8) Replace front number plate & casing (pic 8)
- 9) Remove & replace R/H head lamp (pic 9)
- 10) Remove & replace L/H head lamp (pic 10)
- 11) Remove & replace head lamp support (pic 11,12)
- 12) Remove & replace dented power steering pipe (pic 13)
- 13) Remove & replace air cooler (pic 14)
- 14) Remove & replace air con condenser (pic 15)
- 15) Remove & replace radiator fan (pic 16)
- 16) Remove & replace radiator (pic 17)
- 17) Remove & replace radiator top & bottom hose (pic 17)
- 18) Remove & replace air cleaner housing (pic 18)
- 19) Remove & replace air con motor fan (pic 19)
- 20) Remove & replace siren speaker (pic 20)
- 21) Repair & align L/H fender (pic 21,22)
- 22) Cut & weld dented bumper strobe light bracket (pic 23,24)
- 23) Wiring for all lighting (pic 9,10,20,23&24)
- 24) Replace bonnet sticker & wording (pic 1,2)
- 25) Putty & spray paint bonnet (pic 1,2)
- 26) Spray lacquer over after putting up sticker & wording for bonnet (pic 1,2)
- 27) Replace L/H fender sticker (pic 21,22)
- 28) Putty & spray paint L/H fender & AP panel (pic 4,21&22)

PHOTOS OF DAMAGED PARTS

Bonnet dented/ (pic 1)	Bonnet dented (pic 2)
	
Radiator grill crack (pic 3)	AP panel dented (pic 4)

	
Front bumper dented (pic 5)	Front bumper dented (pic 6)
	
Front bumper support dented (pic 7)	Front number plate & casing dislodged (pic 8)
	
R/H head lamp mounting bracket crack (pic 9)	L/H head lamp mounting bracket crack (pic 10)
	
Head lamp support crack (pic 11)	Head lamp support crack (pic 12)
	
Power sterling pipe dented (pic 13)	Air cooler dented (pic 14)
	
Air condenser dented (pic 15)	Radiator fan crack (pic 16)
	
Radiator leaking (pic 17)	Air cleaner housing crack (pic 18)

	
Air con motor fan housing crack (pic 19)	Siren speaker dented (pic 20)
	
L/H fender misalign (pic 21)	L/H fender misalign (pic 22)
	
Front bumper strobe light bracket dented (pic 23)	Front bumper strobe light bracket dented (pic 24)
	
QX 1609 K	
	