

ASS. REC. BY:

REF:

C72/ 21007057/Kqc

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TS / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No. DMCVSNW00083762000

Claims No. SNM21D202864/C01

Sum Insured: Excess: 500

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

12 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

GBD 34067

Yr Regn:

09, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Dyna

c.c.

2982

Colour

Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JT F A T 354 80K 203208

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

BS 195R15X8

R:

Yoko 155R12X8(D)

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

5 mm

R/Bal.

2 2 mm

L/Bal.

5 mm

L/Bal.

2 2 mm

D.O.A.

18/5/21

15/05/21 D.O.I.

28/6/2021

Survey held at

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or

N/S body & U/C

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Barry Plot

28/06/21 @ 5.37pm revert to Alfred Toh via Merimen.

01/07/21 @ 9.35am So Chow informed C/A via Merimen.

01/07/21 @ 10.06am Informed Ms Wong C/A & ex:\$500 by email.

Kenneth confirmed LS \$8500 (Red \$2813.15, 25%)

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

1) 13/08 Typist

Date/Time, File Return to?

Days Of Repair: 12

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

\$ + RS. SI

Fees

Others

TOTAL

Report Format:

MER-OD

Lump Sum

8500

S&H Motor Pte Ltd
160 Sin Ming Drive #07-02
Sin Ming Autocity
Singapore 575722

Insurer Reference:
Repairer Reference: 041963
Date calculated: 25/06/2021 11:43 AM

Full Report
Registration: GBD3406Z
Printed: 25/06/2021 11:43 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	15/05/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle	
Manufacturer:	TOYOTA
Model:	DYNA
Sub Model:	150
Model Sheet Number:	70 1N 03
Registration:	GBD3406Z
VIN number:	
Odometer:	
Model Specs	
FROM 06.2014	FRT ELECTRIC WINDOWS PLATFORM SINGLE CAB

Not Authorized
11 Days &
Returning After Repair
12 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
610101	R + R LEFT REAR MUD FLAP		3.0	12.60
NO NUMBER	R + R L/F WHEELHOUSE COVER		2.0	8.40
554011)	R + R WINDSCREEN		14.0	58.80
	INCLUDES: R + R SUN VISORS, UPPER FRONT PANEL AND A-PILLAR TRIMS			
670051)	R + R LEFT FRONT DOOR		6.0	25.20
743511)	DETACH + REFIT FRONT CARPETS		2.0	8.40
NO NUMBER	RENEW L/R CORNER PILLAR		65.0	273.00
670051)	RENEW L/F DOOR		12.0	50.40
	(DOOR REMOVED)			
	INCLUDES: CONVERT ATTACHED PARTS, RENEW IF NECESSARY			
NO NUMBER	R + R L/DOOR LOCK CATCH		1.0	4.20
NO NUMBER	R + R L/B-PILLAR BADGE		2.0	8.40
NO NUMBER	R + R REAR LOADING LID		6.0	25.20
NO NUMBER	R + R CAB PROTECTIVE GRILLE		16.0	67.20
NO NUMBER	R + R LEFT LOADING LID		5.0	21.00
NO NUMBER	R + R RIGHT LOADING LID		5.0	21.00
NO NUMBER	RENEW PLATFORM FLOOR		8.0	33.60
743201)	DETACH + REFIT HEADLINING		4.0	16.80

Code	Description	WU	Price SGD
	INCLUDES: R + R INSIDE MIRROR, PILLAR TRIMS AND SEAT BELTS		
NO NUMBER	R + R L/F LOWER DOOR SEAL	2.0	8.40
NO NUMBER	R + R R/F LOWER DOOR SEAL	2.0	8.40
711041 ZAX	R + R L/SEAT	2.0	8.40
743521)	R + R L/R FLOOR CARPET	8.0	33.60
NO NUMBER	R + R BATTERY BRACKET	7.0	29.40
2061	REAR CABIN PANEL REPAIR	20 30.0*	126.00

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	20.20	202.0	848.40
Total of Labour			848.40

Paint

Code	Description	WU	Price SGD
Paint Work	SYSTEM AZT	Time Basis 10 WU/h	
	LEFT FRONT DOOR NEW PART PAINTING	15.0	
	REAR CABIN PANEL NEW PART PAINTING	37.0	
	L/R CORNER PILLAR NEW PART PAINTING	13.0	
	PLATFORM FLOOR NEW PART PAINTING	61.0	
	L/DROP SIDE NEW PART PAINTING	20.0	
	L/OUTER A-PILLAR SURFACE PAINT	5.0	

Paint Material Per Part

Code	Description	Price SGD
1481	LEFT FRONT DOOR NEW PART PAINTING	35.87
2061	REAR CABIN PANEL NEW PART PAINTING	49.38
2103	L/R CORNER PILLAR NEW PART PAINTING	8.74
5403	PLATFORM FLOOR NEW PART PAINTING	203.11
5405	L/DROP SIDE NEW PART PAINTING	52.79
0911	L/OUTER A-PILLAR SURFACE PAINT	6.16

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		151.0	
Preparation Main Work Metal	1.70	17.0	71.40
Total	10 WU/h	16.80 168.0	705.60

Material Cost - Paint	Price SGD
New Part Painting	349.89
Surface-/Blend Paint	6.16
Material-constant Metal	18.10
Total	374.15

Spare Parts

prices as at 2015-06-01/01

Code	Description	Part Number	Part Source	Price SGD
0489	L/F BADGE	75362 35090	Original	M ₂ 30.00 ✓
0897	L/F MUDFLAP	53881 25030	Original	CM 60.00 ✓
1401	WINDSCREEN	56111 37120	Original	CM 550.00 ✓
1410	WINDSCREEN SEAL	56121 25040	Original	M ₂ 95.00 ✓
1481	LEFT FRONT DOOR	67002 37322	Original	R ₂ 520.00 ✓
1509	L/DOOR SEAL	67862 37021	Original	D ₂ 75.00 ✓
1519	L/F DOOR WINDOW	68102 37120	Original	R ₂ 250.00 ✓
1545	L/F WINDOW MOTOR	85720 37120	Original	J ₂ 210.00 ✓
1547	L/F WINDOW REGULATOR	69802 37063	Original	D ₂ 130.00 ✓
1565	L/F DOOR OUT HANDLE	69220 37020	Original	R ₂ 85.00 ✓
1577	L/INN DOOR LOCK	69320 37060	Original	140.00 ?
1711	L/F DOOR TRIM	67620 37180B4	Original	300.00 ?
2103	L/R CORNER PILLAR	61612 37112	Original	R ₂ 320.00 ✓
3703	BATTERY BRACKET	74421 26020	Original	B ₂ 40.00 ✓
4971	L/F INN DOOR GRIP	74640 37010C0	Original	S ₂ 30.00 X
5389	CAB PROTECT GRILLE	65400 25550	Original	R ₂ 450.00 ✓
5403	PLATFORM FLOOR	65100 25B50	Original	R ₂ 1,200.00 ✓
5405	L/DROP SIDE	65600 25051	Original	R ₂ 550.00 ✓
1007	BATTERY HOLDER	BATTERY	Original	R ₂ 30.00 X
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 5,065.00
u: Used parts				Total 5,065.00

Extras

Code	Description	Price SGD
1000	IU bracket IU bracket	M ₂ 15.00* ✓
1001	L/DR COMPANY STICKER LH DOOR	M ₂ 15.00* ✓
1002	PROTR STEEL LINING CAB RR PROTR	R ₂ 480.00* ✓
1003	LH DOOR STEEL LINING LH CARGO DOOR	R ₂ 500.00* ✓
1004	LH DOOR GUARD RAIL LH CARGO DOOR	R ₂ 350.00* ✓
1005	FLOOR STEEL LINING CARGO FLOOR	R ₂ 2,300.00* ✓
1006	BATTERY BATTERY	CM 130.00* 50% ✓
1008	RH REAR TYRE REAR TYRE	R ₂ 90.00* 20% ✓
1009	Wheel alignment Wheel alignment	60.00* ✓
Total Extras		3,940.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Final Calculation

	SGD	SGD
Parts		
Total Parts	5,065.00	5,065.00
Labour Time Base 10 WU/h		
Total 202.0 WU X 42.00 SGD/h		
Total of Labour	848.40	848.40
Total Of Extras		3,940.00
Paint Work Time Base 10 WU/h		
Labour Cost 158.0 WU X 42.00 SGD/h		
Material Cost	705.60	
Total Paint Including Material	374.15	1,079.75
Repair Cost Excludes GST		10,933.15
GST (+7.0%)		765.32
Repair Cost Included GST		11,698.47

Comments

* - USER SUPPLIED DATA

NNV - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	18/05/2021 17:46 (SGT)
Date of Accident	15/05/2021 14:40 (SGT)
Exact Location of Accident	Woodlands Ave 10, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBD3406Z

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	Siong Hong Seafood Enterprise Pte LTD
Company Reg No	2XXXXX170D
Email Address	sionghongpteltd@hotmail.com
Mobile Phone No	(Phone) +65-64818986
Alternative Phone No	(Office) +65-64818986

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Dyna
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle
Transmission	Manual
CC	2982


INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMCVSNW00083762000
Cover Note Number	-

DRIVER

Name of Driver	Zhang Huan Jiang
Passport No/FIN	GXXXX435N

SKETCH PLAN

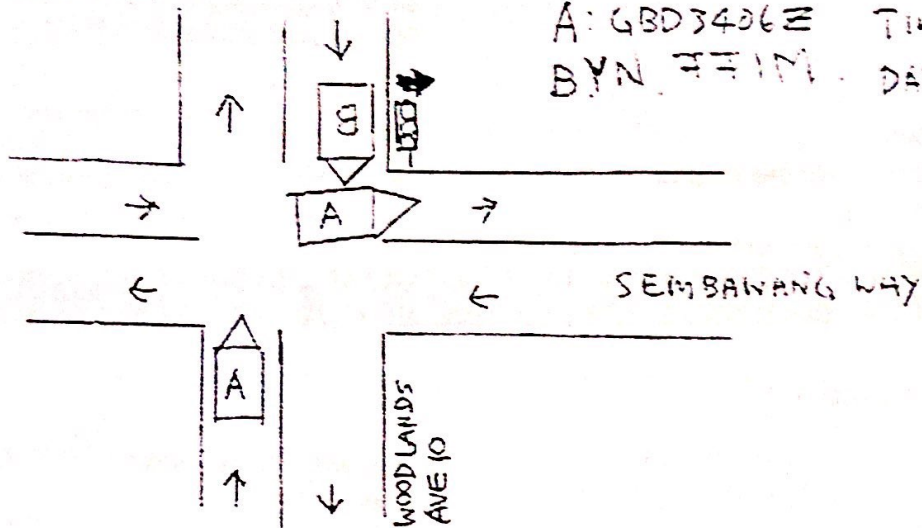

A: GBD3406E TIME: 1440 HR
BYN FFIM DATE: 15/5/2021

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REF TO POLICE REPORT

Handwritten text area for describing the circumstances of the accident, starting with "REF TO POLICE REPORT". The area contains multiple horizontal lines for writing.

DECLARATION



18 MAY 2021

Angie Sch

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Owner ID:

Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

PQP Paid:

COE Rebate Amount:

Total Rebate Amount:

Company

170D

GBD3406Z

Yes

23 Jun 2021

TOYOTA

TOYOTA DYNA 150 MANUAL

Silver

2014

1KD2414469

JTFAT35Y80K203208

-

\$27,856.00

09 Sep 2014

09 Sep 2014

0

\$1,393.00

No

-

\$0.00

08 Sep 2024

C - Goods Vehicle & Bus

10

\$24,618.00

\$7,903.00

\$7,903.00

The information contained herein is correct as at 23 Jun 2021

OK