



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2108393

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 07/12/2021
Reference CC6/CTI21007195/R1rs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLT 7310L
Insured Veh. YN 8992P
Claim No. SNM21D203670/LKKDS
Policy No. DMCVSNW00062972000
Accident Date 29/06/2021
Inspection Date 02/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC6/CTI21007195/R1rs3q2	
			Date: 07/12/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 8992P	Veh. Inspected	SLT 7310L	
Policy No.	DMCVSNW00062972000	Coverage (\$)	0.00	
Claim No.	SNM21D203670/LKKDS	Excess (\$)	0.00	
Assign From		Assign Date	02/07/2021	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI ELANTRA AD 1.6 GLS	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	KMHD841CMJU561024	Colour	RED	
Odometer	64554 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	MICHELIN	6 mm	
L/H Front Tyre	195/65 R15	MICHELIN	6 mm	
R/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
L/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	29/06/2021	Inspection Date	02/07/2021	
Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 7310L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	480.00	480.00
1	REAR BUMPER LOWER COVER	SERVICEABLE	280.00	-
10	REAR BUMPER CLIPS @\$3.00	NECESSARY	30.00	30.00
1	REAR BUMPER RETAINER RH	CRACKED	50.00	50.00
1	REAR BUMPER GUARD RH	CUT	20.00	20.00
1	REAR BUMPER REFLECTOR RH	SERVICEABLE	50.00	-
1	REAR FENDER RH	BUCKLED	1,980.00	1,980.00
1	REAR FENDER FRONT SHIELD RH	DEFORMED	70.00	70.00
1	REAR FENDER REAR SHIELD RH	DEFORMED	60.00	60.00
10	REAR FENDER CLIP @\$3.00	NECESSARY	30.00	30.00
1	REAR TAIL LAMP PANEL ASSY	SERVICEABLE	200.00	-
1	TAIL LAMP RH	BROKEN	400.00	400.00
1	TAIL LAMP RH SPECIAL CLIP	NECESSARY	10.00	10.00
1	BOOT LAMP RH	CRACKED	300.00	300.00
1	FRONT DOOR OUTER CHROME HANDLE RH	TO REPAIR SEE LABOUR	180.00	-
1	REAR WINDSCREEN	BROKEN	550.00	550.00
1	REAR WINDSCREEN MOULDING	NECESSARY	100.00	100.00
1	REAR DOOR RH	TORN	1,950.00	1,950.00
1	REAR DOOR OUTER CHROME HANDLE RH	MISSING	70.00	70.00
1	REAR DOOR OUTER CHROME HANDLE SMALL COVER RH	SCRATCHED	40.00	40.00
1	REAR DOOR CHROME HANDLE PAD RH	NECESSARY	10.00	10.00
1	REAR DOOR CHROME HANDLE SMALL COVER PAD RH	NECESSARY	10.00	10.00
1	REAR DOOR WINDOW REGULATOR RH	CRACKED	250.00	250.00
1	REAR DOOR WINDOW REGULATOR MOTOR RH	SHORTED	200.00	200.00
1	REAR DOOR CHANNEL ASSY RH	CRACKED	80.00	80.00
1	REAR DOOR LOCK	BENT	200.00	200.00
1	REAR DOOR LOCK LATCH	SERVICEABLE	30.00	-
1	REAR DOOR OUTER CHROME WEATHERSTRIP RH	DEFORMED	90.00	90.00
1	REAR DOOR INNER WEATHERSTRIP RH	NECESSARY	110.00	110.00

Report Ref No. CC6/CTI21007195/R1rs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR INNER TRIM ASSY RH	SERVICEABLE	500.00	-
1	REAR UPPER DOOR MOULDING (BLACK STICKER) RH	NECESSARY	20.00	20.00
1	REAR FRONT DOOR MOULDING (BLACK STICKER)RH	NECESSARY	20.00	20.00
1	SIDE MIRROR WITH SIGNAL ASSY RH	CRACKED	680.00	680.00
1	REAR ABSORBER RH	SERVICEABLE	250.00	-
1	REAR WHEEL BEARING RH	SERVICEABLE	480.00	-
	LESS 20% DISCOUNT		-	-1,562.00
			9,780.00	6,248.00
	<u>SPECIAL NETT ITEMS</u>			
1	HYUNDAI RIM 15R (SN)	CUT	680.00	300.00
1	REAR WINDSCREEN SOLAR FILM (SN)	NECESSARY	200.00	150.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
1	REAR TYRE R15 (SN)	SERVICEABLE	200.00	-
			1,120.00	490.00
	<u>LABOUR</u>			
	SPRAY PAINTING WHOLE RIGHT SIDE ,FRONT AND REAR BUMPERS.		1,200.00	900.00
	REPLACE REAR INCLUDING FITTING ,CUT ,WELD AND REALIGN .INCLUSIVE OF THE REPAIR OF FRONT DOOR OUTER CHROME HANDLE RH .		1,000.00	800.00
	REMOVE & REFIT REAR UNDERCARRIAGE.		250.00	150.00
	TRANSFER DOOR FITTING AND WINDOW MECHANISM TO NEW DOOR .		80.00	60.00
	REMOVE AND REFIT REAR WINDSCREEN .		120.00	120.00
	REMOVE AND REFIT REAR BUMPER REVERSE SENSOR .		50.00	50.00
	APPLY RUST PROOFING ON REPLACED/ REPAIRED PANEL.		100.00	60.00
	COMPUTERIZED WHEEL ALIGNMENT.	NOT NECESSARY	70.00	-
	CHECK AND RECTIFY ELECTRICAL WIRING.		30.00	30.00
			2,900.00	2,170.00
	GRAND TOTAL		13,800.00	8,908.00

Report Ref No. CC6/CTI21007195/R1rs3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,100.00
---	--	--	----------

Report Ref No. CC6/CTI21007195/R1rs3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 7310L

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

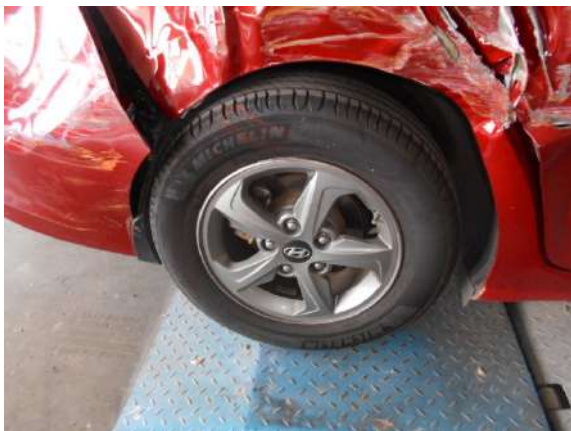



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

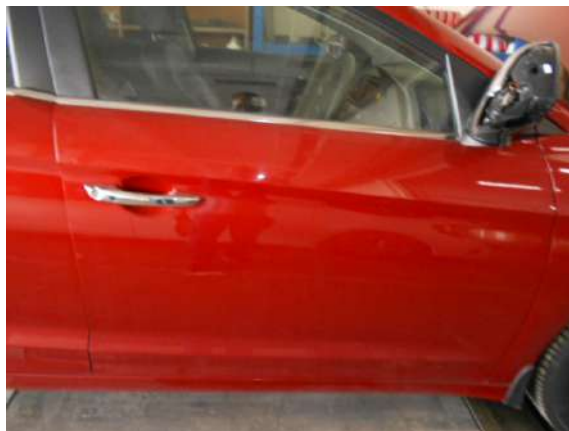



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 7310L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

