

ASS. REC. BY:

REF:

CT2/ 21007243/Kgc

C

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. SNM21D203643/C01

Sum Insured: _____ Excess: 1000

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

☒	☐
N/S	O/S
☐	☐

Bal. or Market Value: 44.5K 40-45K (45K)

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 24 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV 1 REP. / 24 HRS

Date: 10/28

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SJK 3387M

Yr Regn: 10, 08

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or (A) Ambulance

Make: Toy

Trace c.c. 2982

Colour: Silver

A/C: Insured / Std / NI / NA

Sp. Reading: 388868

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: K014 221

0002892

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: M / S/Rim / STD A/Rim or

Tyre Size: F: 195R15XP

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal. 2 mm

L/Bal. 2 mm

D.O.A. 25/6/21

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Fr N/S & U/C

The U/C / Chassis frame / Body Structure affected due to collision.

Rear

R/Bal. 3 mm

L/Bal. 3 mm

D.O.I. 2/7/2021

Date / Time

Action / Instruction

28/7 21.45 @ 30, 800. Carbur (Red \$24302.84, 44%)

2/7/2021 @ 3.32pm Revert to CTI via Merimen.

06/07/21 @ 11.28am Albert Chua informed C/A via Merimen.

06/07/21 @ 1.27pm Informed Wksp C/A & ex: \$1000 by email.

11/08/21 @ 4.28pm 2nd revert to Billy via merimen. (Supplementary \$17618.32)

18/08/21 @ 2.37pm So Chow approved \$30800 via merimen.

19/08/21 @ 11.56am Informed Soon, proceed supplementary & COR not more than LS \$30800 by email.

Date/Time, File Pass to?

☐

: Prel. Report

1) 31/08 Typist

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 24

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS, SI

Fees

Others

TOTAL

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Report Format: MER-OD

Lump Sum / B.H. (\$) 30800

AutoSoon Pte Ltd

176 Sin Ming Drive #01-10
 Sin Ming AutoCare Singapore 575721
 Tel No. : +65 64526657 Fax No. : +65 64514618
 E-Mail : autosoon1@gmail.com
 Tax Reg. No. : 200709808N Buss. Reg. No. : 20709808N

CHINA TAIPING INSURANCE (S) PTE LTD
 3 Anson Rd, #16-00
 Springleaf Tower
 Singapore 079909
 Attention : Motor Claim Department
 Contact : +65 6389 6111 Fax No. : +65 6222 1033

Not Authorized
L1 Sing @ 30,800h
Resurvey Ate Kim
Ex @ 1000h

Estimate : ES000534

Date : 29/06/2021
 Vehicle Num. : SJK 3387 K
 Make/Model : Toyota Hiace
 Chassis/Eng# : KDH221-0002692
 Accident Date : 25/06/2021
 Claim No. :
 Reference : OD/01/06/21
 Policy No. : DMCVSNA00003052101

S/N	Quantity	Particular	24 days	Unit Price	Amount S\$
LIST ITEMS :					
1.	1	Windscreen assy		CM 969.30	—
2.	1	Windscreen moulding		MA 78.45	—
3.	1	Windscreen lower garnish		CM 298.30	—
4.	1	Windscreen lower garnish weatherstrip		AM 110.30	—
5.	2	Windscreen wiper arm assy	137.38	MA 274.76	X
6.	1	Windscreen wiper blade		CA 78.13	—
7.	1	Windscreen wiper linkages		BA 390.30	—
8.	1	Windscreen washer tank assy		DEL 75.91	—
9.	2	Windscreen washer motor	168.31	MA 336.62	X
10.	1	Bonnet assy		BA 666.35	—
11.	1	Bonnet emblem		MC 57.99	—
12.	1	Bonnet lock assy		DI 96.97	—
13.	1	Bonnet lock panel		BA 243.30	—
14.	1	Bonnet lock brace panel		R 77.09	X
15.	2	Bonnet weatherstrip no:1	MS 95.00	MA 190.00	X
16.	2	Bonnet hinges	64.58	BA 129.16	—
17.	1	N/s bonnet hinges support panel		BA 101.00	—
18.	1	Radiator grille assy		MA 433.81	—
19.	1	Radiator grille apron panel		MA 331.20	X
20.	1	Bumper facial		MA 529.37	—
21.	10	Bumper facial clips	5.00	MA 50.00	—
22.	1	Bumper lower air grille assy		MA 213.30	X
23.	1	Bumper top beam		R 165.75	X
24.	1	Bumper reinforcement		R 296.35	X
25.	1	N/s bumper fog lamp cover		MA 28.59	—
26.	1	N/s bumper retainer		CM 185.02	—

CONTINUE / ...

LKK Auto Consultants hence notify
 the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be re-surveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

AutoSoon Pte Ltd

176 Sin Ming Drive #01-10

Sin Ming AutoCare Singapore 575721

Tel No. : +65 64526657 Fax No. : +65 64514618

E-Mail : autosoon1@gmail.com

Tax Reg. No. : 200709808N Buss. Reg. No. : 20709808N

CHINA TAIPING INSURANCE (S) PTE LTD

3 Anson Rd, #16-00

Springleaf Tower

Singapore 079909

Attention : Motor Claim Department

Contact : +65 6389 6111 Fax No. : +65 6222 1033

Estimate : ES000534

Date : 29/06/2021

Vehicle Num. : SJK 3387 K

Make/Model : Toyota Hiace

Chassis/Eng# : KDH221-0002692

Accident Date : 25/06/2021

Claim No. :

Reference : OD/01/06/21

Policy No. : DMCVSN00003052101

S/N	Quantity	Particular	Unit Price	Amount S\$
27.	2	Head lamp assy	546.90	1,093.80
28.	1	Head lamp support panel		358.34
29.	1	Turbo charger air inlet cowling		296.68
30.	1	Bulk head top panel		1,189.30
31.	1	Bulk head lower panel		1,893.20
32.	1	Bulk head lower panel insulator		331.30
33.	1	N/s corner view mirror assy		209.35
34.	1	N/s corner panel assy		168.75
35.	1	N/s corner panel inner support		89.00
36.	1	N/s A pillar outer assy		381.73
37.	1	N/s A pillar inner panel		313.58
38.	1	N/s A Pillar cover trim		146.31
39.	1	N/s A pillar lower panel		190.67
40.	1	N/s A pillar lower inner panel		117.44
41.	1	N/s fender assy		231.30
42.	1	N/s fender inner panel		556.30
43.	1	N/s step garnish		165.16
44.	1	N/s step panel assy		68.98
45.	1	N/s step board panel		213.30
46.	1	N/s step board inner panel		181.30
47.	1	N/s door assy		1,606.07
48.	1	N/s door outer moulding		134.51
49.	1	N/s door top hinges		105.47
50.	1	N/s door lower hinges		102.74
51.	1	N/s door window glass		391.40
52.	1	N/s door window channel		215.07
53.	1	N/s door window regulator and motor		918.37
54.	1	N/s door inner lock assy		509.23

CONTINUE / ...

AutoSoon Pte Ltd

176 Sin Ming Drive #01-10

Sin Ming AutoCare Singapore 575721

Tel No. : +65 64526657 Fax No. : +65 64514618

E-Mail : autosoon1@gmail.com

Tax Reg. No. : 200709808N Buss. Reg. No. : 20709808N

CHINA TAIPING INSURANCE (S) PTE LTD

3 Anson Rd, #16-00

Springleaf Tower

Singapore 079909

Attention : Motor Claim Department

Contact : +65 6389 6111 Fax No. : +65 6222 1033

Estimate : ES000534

Date : 29/06/2021

Vehicle Num. : SJK 3387 K

Make/Model : Toyota Hiace

Chassis/Eng# : KDH221-0002692

Accident Date : 25/06/2021

Claim No. :

Reference : OD/01/06/21

Policy No. : DMCVSN00003052101

S/N	Quantity	Particular	Unit Price	Amount S\$
55.	1	N/s door inner lock catch	46.14	✓
56.	1	N/s door inner trim board	787.10	✓
57.	1	N/s door weatherstrip	295.12	✓
58.	1	N/s B pillar outer panel	396.79	✓
59.	1	N/s B pillar inner panel	576.30	✓
60.	1	Instrument panel assy	756.30	✓
61.	1	Instrument support reinforcement assy	563.91	✓
62.	1	Instrumental panel centre garnish	427.24	✓
63.	1	Instrument centre console control panel	266.31	✓
64.	1	Instrument centre console control switch	218.99	✓
65.	1	Instrumental glove box	231.38	✓
66.	1	Air con evaporator blower and housing assy	1,015.17	✓
67.	1	Air con evaporator coil and housing	2,446.86	✓
68.	1	Air con air outlet centre grille	189.31	✓
69.	1	Air con air side outlet grille	91.48	✓
70.	1	Pax seat assy	785.30	✓
71.	1	Engine room main cover panel	651.30	✓
72.	1	Engine room main cover insulator	211.30	✓
73.	1	Floor board panel assy	1,898.30	✓
74.	1	Floor board panel covering trim	661.30	✓
75.	1	N/s wire harness assy	551.30	✓
76.	1	N/s wire harness junction box	431.30	✓
77.	1	N/s fuse box junction	688.30	✓
78.	1	N/s fuse box wire harness	315.30	✓
79.	1	N/s wheel hud cap	152.23	✓
80.	1	N/s wheel assy	385.31	✓
81.	1	N/s wheel hud assy	326.30	✓
82.	1	N/s wheel hud bearing	283.25	✓

CONTINUE / ...

AutoSoon Pte Ltd

176 Sin Ming Drive #01-10
 Sin Ming AutoCare Singapore 575721
 Tel No. : +65 64526657 Fax No. : +65 64514618
 E-Mail : autosoon1@gmail.com
 Tax Reg. No. : 200709808N Buss. Reg. No. : 20709808N

CHINA TAIPING INSURANCE (S) PTE LTD

3 Anson Rd, #16-00
 Springleaf Tower
 Singapore 079909

Attention : Motor Claim Department

Contact : +65 6389 6111 Fax No. : +65 6222 1033

Estimate : ES000534

Date : 29/06/2021
 Vehicle Num. : SJK 3387 K
 Make/Model : Toyota Hiace
 Chassis/Eng# : KDH221-0002692
 Accident Date : 25/06/2021
 Claim No. :
 Reference : OD/01/06/21
 Policy No. : DMCVSNA00003052101

S/N	Quantity	Particular	Unit Price	Amount S\$	
83.	1	N/s wheel top control arm		752.39	<i>Di</i> ✓
84.	1	N/s wheel knuckle arm		464.23	<i>R</i> ✓
85.	1	N/s wheel lower arm		390.41	<i>Di</i> ✗
86.	1	N/s wheel shock absorber		154.30	<i>R</i> ✗
87.	1	N/s steering tie rod arm		92.75	<i>R</i> ✗
88.	1	Steering rack assy		3,405.30	<i>R</i> ✗
89.	1	Crossmember assy		3,284.82	<i>R</i> ✗
List TotalS\$:				42,779.36	
25.00% Discount S\$:				10,694.84	
				32,084.52	
LABOUR :					
1		To tow ambulance on dolly wheels, receipt enclosed	100.00	100.00	✓
1		To replace windscreen assy	150.00	150.00	<i>12cl</i>
1		To supply windscreen sealant and dam rubber	180.00	180.00	<i>60cl</i>
1		To remove air con condenser to panel beat support panel	250.00	250.00	<i>15cl</i>
		To remove interior air con evaporator, heat exchanger			
1		To remove instrument board, steering column, pedals	350.00	350.00	<i>25cl</i>
1		To remove interior pax seats to facilitate repair	280.00	280.00	<i>12cl</i>
		include floor carpet, all trims covering and roof top upholstery in repairs.			
1		To refocus head lamp, remove damaged section wire harness, junction box, instrumental wire harness and engine loom in repair	250.00	250.00	<i>12cl</i>
1		To lower engine complete with transmission and radiator	380.00	380.00	<i>20cl</i>
		To lower wheel suspension, steering rack, crossmember			

CONTINUE / ...

AutoSoon Pte Ltd

176 Sin Ming Drive #01-10

Sin Ming AutoCare Singapore 575721

Tel No. : +65 64526657 Fax No. : +65 64514618

E-Mail : autosoon1@gmail.com

Tax Reg. No. : 200709808N Buss. Reg. No. : 20709808N

CHINA TAIPING INSURANCE (S) PTE LTD

3 Anson Rd, #16-00

Springleaf Tower

Singapore 079909

Attention : Motor Claim Department

Contact : +65 6389 6111 Fax No. : +65 6222 1033

Estimate : ES000534

Date : 29/06/2021

Vehicle Num. : SJK 3387 K

Make/Model : Toyota Hiace

Chassis/Eng# : KDH221-0002692

Accident Date : 25/06/2021

Claim No. :

Reference : OD/01/06/21

Policy No. : DMCVSNA00003052101

S/N	Quantity	Particular	Unit Price	Amount S\$
		to facilitate replacement		
1		To putty and respray complete damaged portion	1,380.00	1,380.00
1		To computer check/readjust wheel realignment in repair.	100.00	100.00
1		To remove/cut damaged section and restreighten/ recondition chassis frame and replace bulk head panels, floor board, fender innner panel. To panel beat all damaged panels, weld/fix panels include relaign bumper and panels in repair	1,980.00	1,980.00
Labour Total S\$:				5,400.00

13000

600

18000

Total S\$: 37,484.52

AutoSoon Pte Ltd

Kindly note above mentioned parts are visible quoted, we reserve our right to submit further quote if further parts are found damaged while undergoing repair.

Date Survey:

Surveyor Name:

Co Name:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 794E

Vehicle Details

Vehicle No.: SJK3387M

Vehicle to be Exported: Yes

Intended Deregistration Date: 02 Jul 2021

Vehicle Make: TOYOTA

Vehicle Model: HIACE 3.0DX A

Primary Colour: White

Manufacturing Year: 2008

Engine No.: 1KD1796274

Chassis No.: KDH2210002692

Maximum Power Output: -

Open Market Value: \$40,542.00

Original Registration Date: 15 Oct 2008

First Registration Date: 15 Oct 2008

Transfer Count: 1

Actual ARF Paid: \$0.00

Intended PARF Rebate Details

PARF Eligibility: No

PARF Eligibility Expiry Date: -

PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Rebate Amount: \$0.00

Total Rebate Amount: \$0.00

The information contained herein is correct as at 02 Jul 2021

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	25/06/2021 17:17 (SGT)
Date of Accident	25/06/2021 08:18 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	TIONG BAHRU ROAD JUNCTION OF LOWER DELTA ROAD
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SJK3387M

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	AMBULANCE MEDICAL SERVICES PTE LTD
Company Reg No	2XXXXX794E
Email Address	AUTOSOONL@GMAIL.COM
Mobile Phone No	(Phone) +65-87494180
Alternative Phone No	+65-87494180

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Hiace
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle
Transmission	Manual
CC	2754

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	Yes
Policy Number	DMCVSNA00003052101
Cover Note Number	DMCVSNA00003052101

DRIVER

Name of Driver	MUHAMMED MEERAN ALI KHAN BIN RAYEES AHMAD KHAN
NRIC No	SXXXX632H

Date Of Birth	19/10/1983
Occupation	Outdoor
Date Of Driving Pass	28/02/2020
Driving experience	1 YEAR AND 4 MONTHS
Gender	Male
Mobile Number	(Phone) +65-87494180
Alt. Phone Number	-
Email Address	AUTOSOONL@GMAIL.COM
Address	APT BLK 992A BUANGKOK LINK
Address complement	#12-173
Postcode	531992
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collided into Property
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	1
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Traffic Police
Police Station Phone No	(Phone) +65-65470000
Alt. Police Station Phone No	(Fax) +65-65474900
Police Station Address	10 Ubi Avenue 3 Singapore 408865
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT NO.: T/20210625/7015

ATTACHMENT(S)

Are accident photos available for attachment?	No
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	-
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	NA / Unknown

Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	TREE BARK
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and
 - (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Policyholder's Signature / Date & Time
 Sketch Plan 25 JUN 2021

Muran
 Driver's Signature (if driver is not the policyholder) / Date & Time



Witnessed by Reporting Centre Personnel

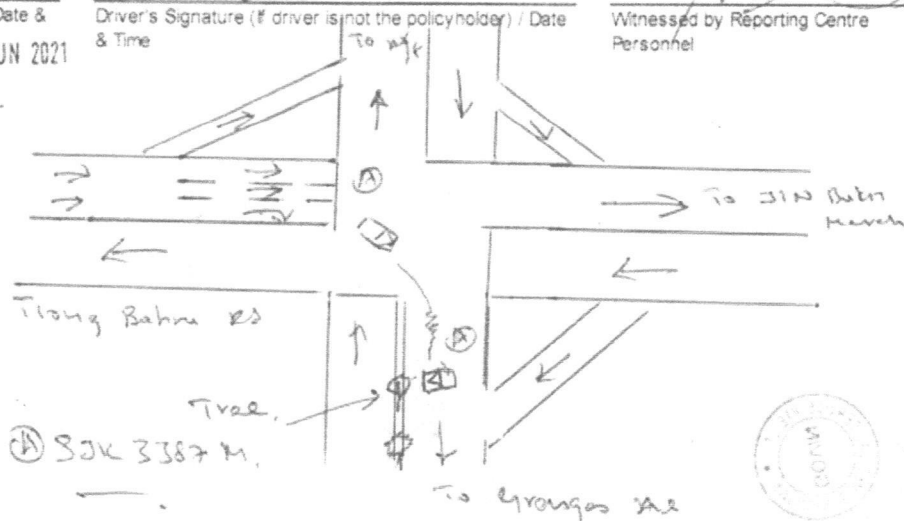



SINGAPORE POLICE FORCE



T/20210625/7015

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

1 of 3

Report No. T/20210625/7015

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 25/06/2021 12:08		Vide Report No.:		Station Diary No.:	
Informant's Particulars					
Name of Informant: MUHAMMED MEERAN ALI KHAN BIN RAYEES AHMAD KHAN			Address: 992A BUANGKOK LINK #12-173 SINGAPORE 531992		
ID Type / ID No.: NRIC NO / S8332632H			Contact No.: Home/Office: Mobile: 87494180		
Nationality: SINGAPORE CITIZEN			Email: MEERAN_KHAN@HOTMAIL.COM		
Sex: Male	Age: 37	Date of Birth: 19/10/1983	Type of Informant: Driver		
Race: Indian			Language: English		Institution / School Name:
Occupation: Medic Cum Driver			Driving Licence Information: Class: Date of Expiry:		

General Information of the Accident

Type of Accident:	Non-Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 25/06/2021 08:15	Type of Location: X-Junction
Location: LOWER DELTA ROAD				
Weather: Raining		Road Surface: Wet	Road Speed Limit: 50 Km/h	
Traffic Flow: Two Way		Traffic Control: Traffic Light - Working		Traffic Volume: Light
Type of Collision: Tree				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of
SJK3387M	Van					0

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20210625/7015

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

2 of 3

Report No. T/20210625/7015

CONTINUATION OF REPORT

Driver			
Name	MUHAMMED MEERAN ALI KHAN BIN RAYEES AHMAD KHAN	ID No.	S8332632H
Related Vehicle	SJK3387M (Van)	Contact No.	87494180
Hospital/Clinic	NIL	Class of Driving Licence & Expiry	Class: NIL Date of Expiry: NIL
Date	NIL	Date	NIL
No. of Days granted Medical Leave	NIL	Degree of	NIL

Brief Details.

I driving about approximately 50 km along Tiong Bahru Road towards the traffic control light junction of Lower delta Road, As the traffic control light was green and in my favor I proceed to turn into Lower Delta Road toward Granges Road. As I steer my ambulance in to Lower Delta Road suddenly I felt my ambulance aqua plane because the was a puddle of rain water on the road.

Hence, I lost control and it skidded towards the center divider of the road along Lower Delta and it collided on to a tree, causing only the tree bark sustained some minor damaged.

Nobody or others was involved in this accident.

AutoSoon Pte Ltd

Registration No: 200709808N

Block 176 Sin Ming Drive #01-10 Sin Ming Autocare Singapore 575721 Tel: 64526657 Fax : 64514618

Service With A Smile

7th July 2021

Land Transport Authority
10, Sin Ming Drive
Singapore 575701

Attn: Officer in Charge,
Vehicle Engineering Dept.

Dear Sir,

Re: Ambulance vehicle Regn no: SJK3387M, model: Toyota Hiace DX 3.0 A with Chassis no:
KDH221-0002692

We, above mentioned workshop has been entrusted with this damaged vehicle repairs by our client's M/s Ambulance Medical Services Pte Ltd, the said vehicle was involved in an accident on 25-06-2021, attached GIA and T/police accident reports for your kind perusal.

We seek your kind cooperation and permission to allow us to replace the vehicle front damaged cowl panels, where the vehicle chassis identification number was stamped by Toyota factory.

The new cowl panel part number 55700-26470 is available for replacement for the said vehicle, attached part purchased invoice and EPC showing the replacement panel for your kind attention

The replacement of the cowl panel will not affect the integrity of the chassis and road worthiness of the vehicle.

Kindly be assure we will carry out sound engineering practices for panels installation and welding to this vehicle with utmost safety in mind for the passenger and driver in this repair.

Look forward to your kind and favorable reply to allow us to proceed with the said cowl panel replacement.

Please feel free to contact me anytime on my mobile no: 96351683 for any clarification you may require for the above mentioned matter.

Yours faithfully,



Soon

cc: Ambulance Medical Services Pte Ltd
: China Taiping Insurance (S) Pte Ltd.



AutoSoon Pte Ltd

176 Sin Ming Drive #01-10

Sin Ming AutoCare Singapore 575721

Tel No. : +65 64526657 Fax No. : +65 64514618

E-Mail : autosoon1@gmail.com

Tax Reg. No. : 200709808N Buss. Reg. No. : 20709808N

CHINA TAIPING INSURANCE (S) PTE LTD

3 Anson Rd, #16-00

Springleaf Tower

Singapore 079909

Attention : Motor Claim Department

Contact : +65 6389 6111 Fax No. : +65 6222 1033

Supplementary Estimate : ES000535

Date : 25/06/2021

Vehicle Num. : SJK 3387 K

Make/Model : Toyota Hiace

Chassis/Eng# : KDH221-0002692

Accident Date : 25/06/2021

Claim No. :

Reference : OD/01/06/21

Policy No. : DMCVSNA00003052101

S/N	Quantity	Particular	Unit Price	Amount S\$
-----	----------	------------	------------	------------

LIST ITEMS :				
1.	1	Radiator secondary assy	R ₂ 952.32	✓
2.	1	Radiator secondary top hose	PU 42.03	✓
3.	1	Radiator secondary lower hose	L 56.38	X
4.	1	Radiator primary assy	R ₂ 1,905.08	✓
5.	1	Radiator cowlng assy	CM 311.94	✓
6.	1	Air con condenser	R ₂ 1,521.10	✓
7.	1	Air filter intake ducting	PU 166.32	✓
8.	1	Air filter housing assy	CM 793.71	✓
9.	1	Engine under cover	CM 637.20	✓
10.	1	Engine main wire harness	T ₁ 3,189.30	✓
11.	1	ABS brake actuator assy	R ₂ / Rd 4,700.11	✓
12.	2	ABS brake actuator piping assy	315.30 Rd 630.60	✓
13.	6	ABS complete fluid piping	115.30 Rd 691.80	✓
14.	1	ABS module wire harness	CM 1,863.30	✓
15.	1	N/s fender moulding	RU 163.00	✓
16.	1	N/s door control wire harness assy	T ₁ 368.00	✓
17.	1	N/s roof_components wire harness	T ₁ 996.30	✓
18.	1	N/s main fused box assy	CM 489.30	✓
19.	1	N/s fuse box junction	CM 413.30	✓
List TotalS\$:			19,891.09	
25.00% Discount S\$:			4,972.77	
			14,918.32	

LABOUR :

1	To prepare documents and letter of no objection to LTA	1,500.00	1,500.00	✓
---	--	----------	----------	---

CONTINUE / ...

AutoSoon Pte Ltd

Page 2 / 2

176 Sin Ming Drive #01-10

Sin Ming AutoCare Singapore 575721

Tel No. : +65 64526657 Fax No. : +65 64514618

E-Mail : autosoon1@gmail.com

Tax Reg. No. : 200709808N Buss. Reg. No. : 20709808N

CHINA TAIPING INSURANCE (S) PTE LTD

3 Anson Rd, #16-00

Springleaf Tower

Singapore 079909

Attention : Motor Claim Department

Contact : +65 6389 6111 Fax No. : +65 6222 1033

Supplementary Estimate : ES000535

Date : 25/06/2021

Vehicle Num. : SJK 3387 K

Make/Model : Toyota Hiace

Chassis/Eng# : KDH221-0002692

Accident Date : 25/06/2021

Claim No. :

Reference : OD/01/06/21

Policy No. : DMCVSNA00003052101

S/N	Quantity	Particular	Unit Price	Amount S\$
	1	engineering section for Bulks head, fire wall panels replacement include chassis frame number stamp and Vitas inspection services Additional unforeseen damaged repairs/panel beat and restraighthen/recondition mid section chassis and body panel, interior floor board panel include realignment	1,200.00	1,200.00
		Labour Total S\$:		2,700.00

Total S\$: 17,618.32

AutoSoon Pte Ltd

Kindly note above mentioned parts are visible quoted, we reserve our right to
submit further quote if further parts are found damaged while undergoing repair.

Date Survey:

Surveyor Name:

Co Name: