



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203630

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 13/06/2022
Reference CC6/CTI21007294/Dea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 8992Z
Insured Veh. GBJ 5227D
Claim No. SNM21D203685/C02
Policy No. DMCVSNA00069252101
Accident Date 30/06/2021
Inspection Date 02/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21007294/Dea3q2 Date: 13/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBJ 5227D	Veh. Inspected	SHC 8992Z
	Policy No.	DMCVSNA00069252101	Coverage (\$)	0.00
	Claim No.	SNM21D203685/C02	Excess (\$)	0.00
	Assign From		Assign Date	02/07/2021
2. Vehicle Particulars & Condition				
	Make & Model	HYUNDAI I40	c.c	1685
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	KMHLB41UMGU086945	Colour	BLUE
	Odometer	769988 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/60 R16	WEST LAKE	5 mm
	L/H Front Tyre	205/60 R16	WEST LAKE	5 mm
	R/H Rear Tyre	205/60 R16	WEST LAKE	5 mm
	L/H Rear Tyre	205/60 R16	WEST LAKE	5 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	30/06/2021	Inspection Date	02/07/2021
	Survey held at	Blk 9 Sector C #01-42, Sin Ming Industrial Estate		
	Repairer	BIFROST AUTO PTE LTD		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 8992Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOTLID	BUCKLED	2,174.90	2,174.90
1	BOOTLID RUBBER	DEFORMED / TORN	96.50	96.50
2	BOOTLID HINGE (LH/RH) @\$284.60	TO REPAIR SEE LABOUR	569.20	-
1	BOOTLID LOCK UPPER	BENT / DAMAGED	114.90	114.90
1	BOOTLID LOCK LOWER	BENT	31.70	31.70
1	BOOTLID I40 EMBLEM (I40)	NECESSARY	67.90	67.90
1	BOOTLID 'H' EMBLEM	NECESSARY	63.10	63.10
1	BOOTLID CRDI PLATE	NECESSARY	52.40	52.40
2	BOOTLID LAMP (LH/RH) @\$1131.20	CRACKED	2,262.40	1,131.20
2	LICENSE LAMP (LH/RH) @\$56.10	NOT NECESSARY	112.20	-
1	BOOTLID TRIMBOARD	DEFORMED / TORN	343.90	343.90
1	BOOTLID TRIMBOARD CLIPS	NECESSARY	11.00	11.00
1	BOOTLID LOWER GARNISH CHROME (I40)	CRACKED	385.30	385.30
1	REAR BUMPER	DENTED	1,106.00	553.00
2	REAR BUMPER REINFORCEMENT BRACKET LH/RH @ \$160.60	DENTED	321.20	321.20
1	REAR BUMPER REINFORCEMENT	BROKEN	428.40	428.40
10	REAR BUMPER CLIP	NECESSARY	22.00	22.00
1	REAR BUMPER BRACKET (N/S)	BROKEN	35.60	35.60
1	REAR BUMPER SPONGE	TORN	119.50	119.50
1	REAR BUMPER UNDER COVER	DENTED / DISTORTED	228.00	228.00
2	REAR BUMPER REFLECTOR LAMP (I40) @\$32.00	SERVICEABLE	64.00	-
2	TAIL LAMP (LH/RH) @\$697.80	CRACKED	1,395.60	1,395.60
2	TAIL LAMP QUARTER PANEL (LH/RH) @\$453.00	O/S TO REPAIR SEE LABOUR / N/S DENTED	906.00	453.00
1	REAR PANEL	BUCKLED	526.70	526.70
1	REAR PANEL LOWER	BUCKLED	495.50	495.50
1	REAR PANEL GARNISH	MTG DEFORMED	57.70	57.70
2	PANEL ASSY-REAR FLOOR SIDE (LH/RH) @\$180.20	TO REPAIR SEE LABOUR	360.40	-

Report Ref No. CC6/CTI21007294/Dea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SPARE TYRE HOLDER	NOT NECESSARY	248.00	-
1	SPARE WHEEL LOCK NUT	BROKEN	41.80	41.80
1	SPARE TYRE PANEL	BUCKLED	852.80	852.80
1	SPARE TYRE PANEL CUSHION	SERVICEABLE	223.10	-
1	MEMBER ASSY -REAR FLOOR CENTRE	NOT NECESSARY	570.40	-
1	REAR TOWING HOOK	NOT NECESSARY	194.60	-
2	EXHAUST PIPE INSULATOR(LH/RH) @\$117.10	NOT NECESSARY	234.20	-
2	EXHAUST SILENCER (LH/RH) @\$1935.40	BENT / DENTED	3,870.80	1,935.40
2	EXHAUST PIPE HANGER @\$117.10	SERVICEABLE	234.20	-
2	REAR FENDER (LH/RH) @\$4736.80	N/S DENTED / O/S TO REPAIR SEE LABOUR	9,473.60	2,171.40
1	REAR FENDER INNER LINING (LH)	NOT NECESSARY	338.60	-
1	REAR FENDER OUTER QUARTER GLASS (LH)	NOT NECESSARY	367.50	-
1	REAR FENDER CORNER HARDBOARD COVER (LH)	NOT NECESSARY	213.25	-
1	REAR TRAY LUGGS SIDE (LH)	NOT NECESSARY	232.60	-
1	REAR FENDER AIR -DUCT (LH)	DEFORMED	51.60	51.60
1	REAR FENDER TRIM BOARD (LH)	DEFORMED	688.75	688.75
1	REAR WINDSCREEN MOULDING	NECESSARY	51.80	51.80
1	REAR DOOR (LH)	NOT NECESSARY	2,201.10	-
1	REAR DOOR LOCK ASSY	NOT NECESSARY	468.20	-
1	REAR WIRING ASSY	NOT NECESSARY	1,521.50	-
	LESS 20% DISCOUNT		-6,886.08	-2,980.51
			27,544.32	11,922.04
	<u>SPECIAL NETT ITEMS</u>			
1	BOOTLID COMFORT LOGO & TEL NO.STICKER (SN)	NECESSARY	30.00	30.00
1	REAR NO PLATE (SN)	BENT	25.00	25.00
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	118.00	118.00
1	REAR BUMPER REVERSE SENSOR (SN)	NOT NECESSARY	135.70	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	46.00	46.00
1	REAR DOOR TEL NO.STICKER (LH) (SN)	NOT NECESSARY	10.00	-
1	REAR DOOR COMFORTDELGRO & APPS STICKER (LH) (SN)	NOT NECESSARY	80.00	-
			444.70	219.00

Report Ref No. CC6/CTI21007294/Dea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF BOOTLID HINGE (LH/RH) ,TAIL LAMP QUARTER PANEL RH,PANEL ASSY-REAR FLOOR SIDE (LH/RH) AND REAR FENDER RH.		1,800.00	1,200.00
	SPRAY PAINTING CHARGE.		1,600.00	1,000.00
	WIRING CHARGE.		100.00	30.00
	TUFF KOTE.		100.00	40.00
	TOWING CHARGE.	NOT NECESSARY	80.00	-
	REMOVE/REFIX CUSHION & UPHOLSTERY REAR .		150.00	80.00
	REMOVE/REFIX REAR WINDSCREEN GLASS .		120.00	80.00
	REMOVE/REFIX REVERSE SENSOR .		120.00	40.00
	REMOVE/REFIX FUEL TANK.	NOT NECESSARY	150.00	-
	REMOVE/REFIX EXHAUST PIPE.		150.00	60.00
	TRANSFER OF DOOR MECHANISM REAR.	NOT NECESSARY	80.00	-
	RE-SET REAR POWER WINDOW SYSTEM.	NOT NECESSARY	200.00	-
	FOUR WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.	NOT NECESSARY	550.00	-
			5,320.00	2,530.00
	GRAND TOTAL		33,309.02	14,671.04
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			11,700.00

Report Ref No. CC6/CTI21007294/Dea3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 8992Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 8992Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

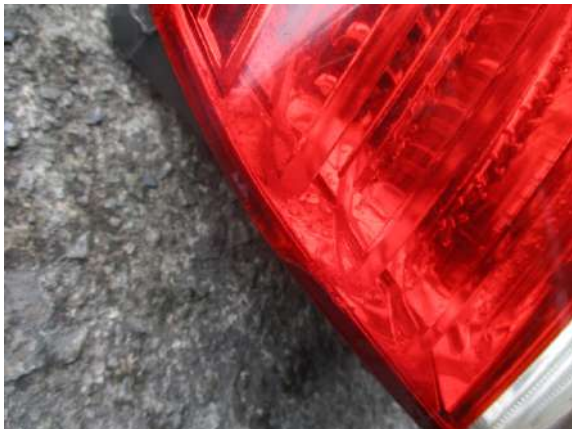



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 8992Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

