



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203432

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 06/06/2022
Reference CC6/CTI21007327/Dea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 711X
Insured Veh. SJY 1813P
Claim No. SNM21D203712/C02
Policy No. DMPCSNA00041402101
Accident Date 03/07/2021
Inspection Date 05/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21007327/Dea3q2 Date: 06/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJY 1813P	Veh. Inspected	SHC 711X	
Policy No.	DMPCSNA00041402101	Coverage (\$)	0.00	
Claim No.	SNM21D203712/C02	Excess (\$)	0.00	
Assign From		Assign Date	05/07/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JTDKB3FU203080348	Colour	YELLOW	
Odometer	328583 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/07/2021	Inspection Date	05/07/2021	
Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 711X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	BENT	950.50	950.50
1	INSULATOR ,HOOD	NOT NECESSARY	398.10	-
10	INSULATOR CLIPS	NOT NECESSARY	36.80	-
1	BONNET RUBBER	SERVICEABLE	35.50	-
1	BONNET CABLE	NOT NECESSARY	83.20	-
1	BONNET HINGE (RH)	BENT	87.70	87.70
1	BONNET HINGE (LH)	BENT	87.70	87.70
1	BONNET LOCK	BENT	132.60	132.60
1	RADIATOR GRILLE	DEFORMED	438.00	438.00
1	RADIATOR GRILLE EMBLEM	NECESSARY	88.00	88.00
1	FRONT BUMPER COVER	TORN	499.90	499.90
1	FRONT BUMPER REINFORCEMENT	BENT	696.40	696.40
1	FRONT BUMPER REINFORCEMENT ABSORBER (O/S)	BENT	115.70	115.70
1	FRONT BUMPER LOWER REINFORCEMENT	BENT	364.20	364.20
2	FRT BUMPER LOWER REINFORCEMENT BRACKET LH/RH @\$330.00	BENT	660.00	660.00
1	ABSORBER ,FRONT BUMPER ,LOWER	CRACKED	127.70	127.70
1	FRONT BUMPER SPONGE	TORN	78.80	78.80
1	FRONT BUMPER LOWER GRILLE	DEFORMED	166.90	166.90
1	LAMP ASSY ,FOG, RH	BROKEN	920.00	920.00
1	FRONT NO PLGATE GARNISH	CRACKED	99.00	99.00
2	FRONT BUMPER SIDE RETAINER @\$77.00	SERVICEABLE	154.00	-
1	FRONT LOWER PANEL	BENT	320.65	320.65
2	FRONT LOWER SIDE RAIL (LH/RH)@\$230.80	NOT NECESSARY	461.60	-
1	FRONT LOWER CROSSMEMBER	NOT NECESSARY	357.70	-
1	FRONT UNDER COVER	TORN	180.80	180.80
1	ENGINE UNDER COVER (RR)	NOT NECESSARY	457.40	-
1	ENGINE UNDER COVER CENTER	NOT NECESSARY	523.40	-
1	FRONT BUMPER TOP GARNISH	NOT NECESSARY	225.40	-
1	COVER ,FRONT BUMPER HOLE ,RH	SERVICEABLE	28.38	-
1	UNIT ASSY ,HEADLAMP ,RH (LED)	BROKEN	3,455.00	2,637.60

Report Ref No. CC6/CTI21007327/Dea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	UNIT ASSY ,HEADLAMP ,LH (LED)	MTG CRACKED	3,455.00	2,637.60
1	HEADLAMP ECU (O/S)	MTG BROKEN	682.60	486.40
1	HEAD LAMP PANEL (RH)	BENT	240.10	240.10
1	HEAD LAMP PANEL (LH)	BENT	240.10	240.10
1	TOP PANEL CENTRE	BENT	364.98	364.98
1	TOP PANEL SIDE (O/S)	BENT	145.90	145.90
1	BRACE PANEL	TO REPAIR SEE LABOUR	75.20	-
1	RADIATOR ASSY	BENT	1,841.80	1,841.80
1	RADIATOR FAN GRILLE	NOT NECESSARY	632.40	-
1	GUIDE RADIATOR AIR NO.3	NOT NECESSARY	299.70	-
1	DEFLECTOR ,RADIATOR SIDE ,RH	NOT NECESSARY	83.50	-
1	DEFLECTOR ,RADIATOR SIDE ,LH	SERVICEABLE	83.50	-
1	RADIATOR TOP HOSE	NOT NECESSARY	43.03	-
1	RADIATOR TOP HOSE	NOT NECESSARY	42.60	-
1	RADIATOR SPARE TANK HYBRID	NOT NECESSARY	225.80	-
1	RADIATOR BOTTOM MOUNTING	NOT NECESSARY	27.50	-
1	STAY ,RADIATOR SUPPORT ,RH	NOT NECESSARY	65.70	-
1	STAY ,RADIATOR SUPPORT ,LH	NOT NECESSARY	65.70	-
1	RADIATOR FAN BLADE (RH)	NOT NECESSARY	233.10	-
1	RADIATOR FAN BLADE (LH)	NOT NECESSARY	233.10	-
1	RADIATOR FAN MOTOR (RH)	NOT NECESSARY	543.70	-
1	RADIATOR FAN MOTOR (LH)	NOT NECESSARY	543.70	-
1	RADIATOR FAN COWLING (RH)	MTG CRACKED	451.30	451.30
1	RESERVE TANK ASSY ,RADIATOR W/O CAP	NOT NECESSARY	395.30	-
1	PIPE RADIATOR	NOT NECESSARY	126.50	-
2	HORN @\$112.71	NOT NECESSARY	225.42	-
1	CONDENSER ASSY ,W/RECEIVER	BENT	1,336.60	1,336.60
1	FENDER SUB-ASSY ,FRONT RH	DENTED	945.30	945.30
1	FENDER SUB-ASSY ,FRONT LH	DENTED	945.30	945.30
1	FRONT HEADLAMP ASSY	NOT NECESSARY	958.30	-
1	FRONT FENDER SHIELD	NOT NECESSARY	38.00	-
1	FRONT FENDER SHIELD CLIP	NOT NECESSARY	14.90	-

Report Ref No. CC6/CTI21007327/Dea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT FENDER HYBRID EMBLEM LH/RH @\$86.50	NECESSARY	173.00	173.00
1	BRACKET ,FRONT SIDE PANEL RH	NOT NECESSARY	86.30	-
1	BRACKET ,FRONT SIDE PANEL LH	NOT NECESSARY	86.30	-
1	EXTENSION ,FRONT FENDER ,RH	NOT NECESSARY	47.20	-
1	PROTECTOR FRONT FENDER SIDE PANEL ,RH	NOT NECESSARY	113.90	-
1	SEAL ,FRONT FENDER TOP COWL SIDE ,RH	NOT NECESSARY	15.20	-
1	GUSSET FRONT FENDER APRON LOWER RH	NOT NECESSARY	34.90	-
1	EXTENSION ,FRONT FENDER APRON ,FRONT RH	NOT NECESSARY	23.20	-
1	MEMBER FRONT APRON TO COWL SIDE ,UPPER RH	NOT NECESSARY	138.40	-
1	FRONT APRON TO COWL SIDE ,LOWER FRT RH	NOT NECESSARY	82.30	-
1	WIPER SPARE TANK ASSY	DEFORMED / BROKEN	486.70	486.70
1	WIPER TANK NECK	NOT NECESSARY	89.40	-
1	WIRING FRONT	NOT NECESSARY	8,450.50	-
	LESS 20% DISCOUNT		-7,532.79	-
	LESS 25% DISCOUNT		-	-4,736.81
			30,131.17	14,210.42
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NO PLATE (SN) }	BENT	25.00	45.00
1	FRONT NO PLATE TRIM COVER (SN) }	BENT	30.00	-
1	COOLANT (SN)	NOT NECESSARY	45.00	-
2	FRONT FENDER ADVERTISEMENT LOGO (LH/RH) @ \$100.00 (SN)	NECESSARY	200.00	200.00
			300.00	245.00
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF BRACE PANEL .		1,800.00	1,000.00
	SPRAY PAINTING CHARGE.		1,400.00	1,000.00
	WIRING CHARGE.		100.00	30.00
	TUFF KOTE.		100.00	40.00
	TOWING CHARGE .	NOT NECESSARY	80.00	-
	FOUR WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	REMOVE/REFIX UNDERCARRIAGE (FRT).	NOT NECESSARY	400.00	-

Report Ref No. CC6/CTI21007327/Dea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	RE-SET FRT ABS SYSTEM.	NOT NECESSARY	200.00	-
	REMOVE/REFIX RADIATOR.		90.00	50.00
	REMOVE/REFIX AIRCON & REFILL GAS.		130.00	80.00
	REMOVE/REFIX FUSE BOX .	NOT NECESSARY	120.00	-
	REMOVE/REFIX ENGINE.	NOT NECESSARY	600.00	-
	FRONT CHASSIS ALIGNMENT CHARGE.	NOT NECESSARY	220.00	-
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE.		550.00	150.00
			5,910.00	2,350.00
GRAND TOTAL			36,341.17	16,805.42
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				15,000.00

Report Ref No. CC6/CTI21007327/Dea3q2

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 711X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

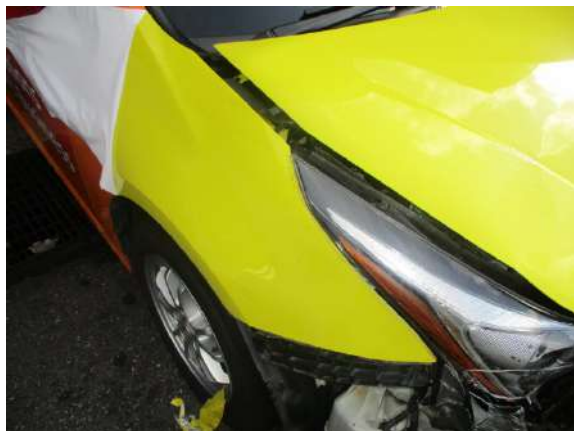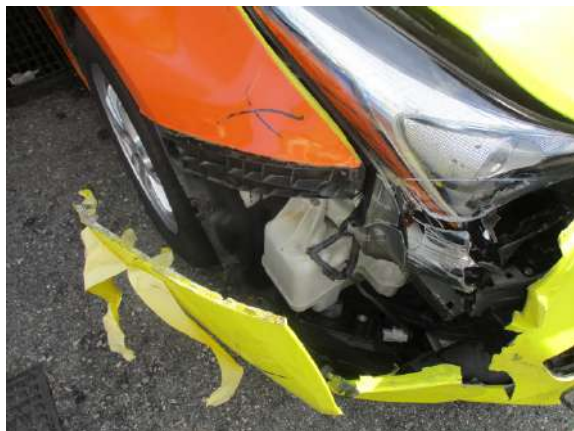



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

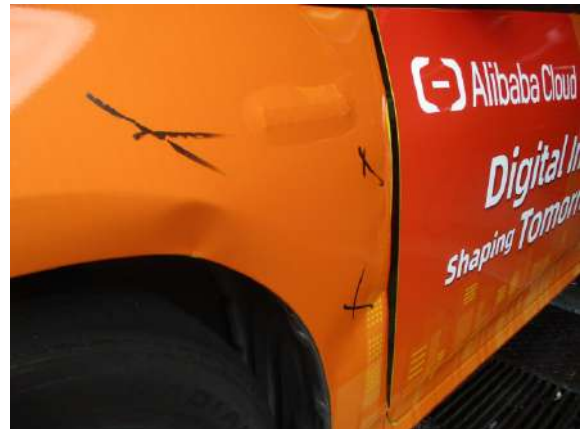



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 711X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 711X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

