



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2200559

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 27/01/2022
Reference CC6/CTI21007392/Aes3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMP 4744Y
Insured Veh. SJR 2516C
Claim No. SNM21D203761/C02
Policy No. DMCVSNA00003052101
Accident Date 05/07/2021
Inspection Date 06/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21007392/Aes3q2	
			Date: 27/01/2022	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJR 2516C	Veh. Inspected	SMP 4744Y	
Policy No.	DMCVSNA00003052101	Coverage (\$)	0.00	
Claim No.	SNM21D203761/C02	Excess (\$)	0.00	
Assign From		Assign Date	06/07/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA WISH	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	JTDGG20W905003640	Colour	SILVER	
Odometer	121828 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	CONTINENTAL	6 mm	
L/H Front Tyre	195/65 R15	CONTINENTAL	6 mm	
R/H Rear Tyre	195/65 R15	CONTINENTAL	6 mm	
L/H Rear Tyre	195/65 R15	CONTINENTAL	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/07/2021	Inspection Date	06/07/2021	
Survey held at	CN MOTORS PTE LTD 1 KAKI BUKIT AVENUE 6 BLK C #01-41 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 4744Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR TAILGATE	DISTORTED	1,315.20	1,272.00
1	REAR TAILGATE LOCK	DAMAGED	374.40	374.40
1	REAR TAILGATE LOCK CATCH	NOT NECESSARY	68.40	-
1	REAR TAILGATE LOCK SENSOR	DAMAGED	361.70	361.70
1	REAR TAILGATE INNER TRIM BOARD	CRACKED	781.40	485.00
1	REAR TAILGATE EMBLEM LOGO	NECESSARY	51.10	51.10
1	REAR TAILGATE EMBLEM VALVE-MATIC	NECESSARY	84.70	84.70
1	REAR TAILGATE OUTER CHROME MOULDING	CRACKED	274.40	274.40
2	REAR TAILGATE SHOCK ABSORBER @\$185.60	BENT	371.20	371.20
2	REAR TAILGATE NUMBER PLATE LAMP @\$105.10	NOT NECESSARY	210.20	-
2	REAR TAILGATE LAMP @\$590.20	CRACKED	1,180.40	590.20
1	REAR TAILGATE WINDSCREEN GLASS	CUT	1,192.70	1,192.70
1	REAR TAILGATE WINDSCREEN GLASS MOULDING	NECESSARY	136.40	136.40
1	REAR TAILGATE WIPER MOTOR	DAMAGED	389.50	389.50
1	REAR TAILGATE WIPER ARM	NOT NECESSARY	181.90	-
1	REAR TAILGATE WIPER BLADES	NOT NECESSARY	48.30	-
1	REAR TAILGATE WIPER ARM COVER	NOT NECESSARY	98.40	-
1	REAR TAILGATE WEATHER STRIPE	CUT	187.20	187.20
1	REAR BUMPER	DISTORTED	625.50	625.50
2	REAR BUMPER REFLECTOR @\$141.40	O/S CRACKED	282.80	141.40
2	REAR BUMPER BRACKET @\$75.60	DENTED	151.20	151.20
2	REAR BUMPER SIDE RETAINER @\$132.10	NECESSARY	264.20	264.20
1	REAR END PANEL	DENTED	612.50	612.50
1	REAR END PANEL TOP GARNISH	DEFORMED	375.40	253.00
1	REAR END PANEL KEYLESS SENSOR	CRACKED	186.40	186.40
2	REAR TAILLAMP	CRACKED	1,398.80	782.00
2	REAR TAILLAMP LOWER BRACKET @\$78.10	NOT NECESSARY	156.20	-
2	REAR TAILLAMP INNER PANEL @\$378.20	TO REPAIR SEE LABOUR	756.40	-
1	REAR FLOOR COMPARTMENT PANEL	TO REPAIR SEE LABOUR	980.30	-

Report Ref No. CC6/CTI21007392/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FLOOR COMPARTMENT PANEL TOP BOARD	DEFORMED	292.20	292.20
2	REAR FLOOR COMPARTMENT PANEL SIDE BOARD @ \$65.40	NOT NECESSARY	130.80	-
2	REAR FENDER @\$1274.50	N/S BUCKLED	2,549.00	1,137.00
2	REAR FENDER INNER TRIM BOARD @\$679.00	CRACKED	1,358.00	1,358.00
2	REAR FENDER AIR VENT @\$84.60	NOT NECESSARY	169.20	-
1	REAR SPARE TYRE BRACKET	NOT NECESSARY	245.60	-
1	REAR EXHAUST MUFFLER	BENT	961.20	961.20
2	REAR EXHAUST MUFFLER RUBBER MOUNTING @\$38.50	NOT NECESSARY	77.00	-
	LESS 25% DISCOUNT		-4,720.05	-3,133.78
			14,160.15	9,401.32
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	REAR REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
1	REAR REVERSE CAMERA (SN)	NOT NECESSARY	380.00	-
1	REAR TAILGATE WINDSCREEN GLASS SEALANT (SN)	NECESSARY	100.00	60.00
2	REAR END PANEL SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	100.00	-
2	REAR FENDER INNER TRIM BOARD CLIPS @\$60.00 (SN)	NECESSARY	120.00	60.00
1	REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	80.00	30.00
1	REAR END PANEL TOP AGRNISH CLIPS (SN)	NECESSARY	60.00	10.00
1	REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	300.00	-
			1,560.00	450.00
	<u>LABOUR</u>			
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR TAILLAMP INNER PANEL AND REAR FLOOR COMPARTMENT PANEL .		3,000.00	1,500.00
	LABOUR FOR SPRAY PAINTING.		2,000.00	1,400.00
	WIRING CHECK.		80.00	30.00
	LABOUR FOR REMOVE & REFIX REAR WINDSCREEN GLASS .		150.00	120.00
	LABOUR FOR REMOVE & REFIX REAR UPHOLSTERY /ROOF LINING.		300.00	80.00

Report Ref No. CC6/CTI21007392/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR FOR REMOVE & RENEW REAR EXHAUST MUFFLER ,TO REPAIR & STRAIGHTEN REAR EXHAUST PIPE.		300.00	80.00
	TO APPLY TUFF COATING /RUST PROOF ACCIDENT AREAS.		300.00	60.00
	LABOUR FOR REMOVE & TRANSFER ALL REAR TAILGATRE FITTING.		200.00	80.00
			6,330.00	3,350.00
GRAND TOTAL			22,050.15	13,201.32
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				10,500.00

Report Ref No. CC6/CTI21007392/Aes3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4744Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

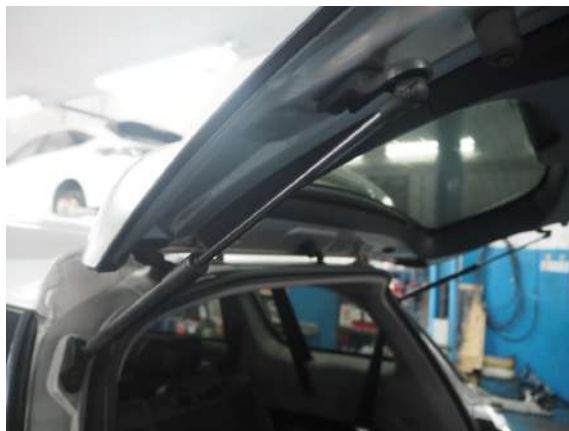



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

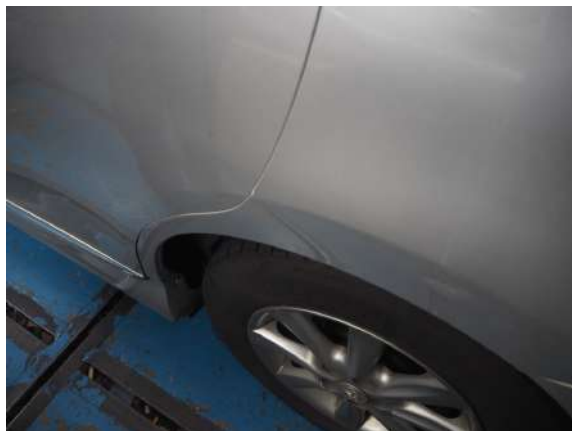



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4744Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

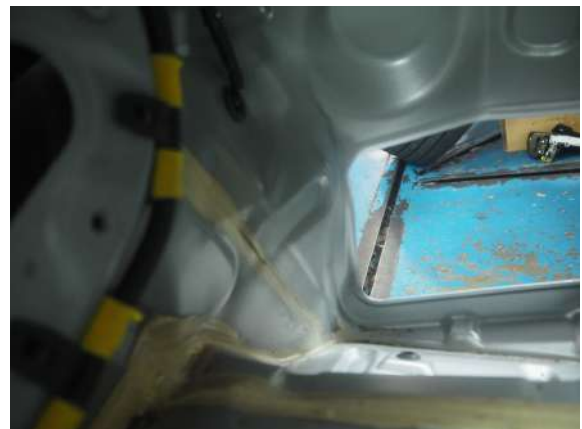



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4744Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

