



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2108690  
INV Date 17/12/2021  
Reference CC4/LPC21007459/Ars3q2  
Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SKH 4827H  
Insured Veh. GBB 5682P  
Claim No. 20/21/21/VC05/024743  
Policy No. Z20VC05005950  
Accident Date 04/07/2021  
Inspection Date 09/07/2021

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC21007459/Ars3q2

Date: 17/12/2021

Code: LPC2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	GBB 5682P	<b>Veh. Inspected</b>	SKH 4827H
<b>Policy No.</b>	Z20VC05005950	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	20/21/21/VC05/024743	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	KENNY	<b>Assign Date</b>	08/07/2021

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA ALTIS	<b>c.c</b>	1598
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2012
<b>Chassis No.</b>	MR053REE104148671	<b>Colour</b>	BLACK
<b>Odometer</b>	117736 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	195/65 R15	KAPSEN	6 mm
<b>L/H Front Tyre</b>	195/65 R15	KAPSEN	6 mm
<b>R/H Rear Tyre</b>	195/65 R15	KAPSEN	6 mm
<b>L/H Rear Tyre</b>	195/65 R15	KAPSEN	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT & REAR PORTION & N/S BODY AND UNDERCARRIAGE.

DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	04/07/2021	<b>Inspection Date</b>	09/07/2021
<b>Survey held at</b>	HUA MENG SPRAY PAINTING WORKSHOP 1 KAKI BUKIT AVE 6 #01-61 AUTOBAY SINGAPORE 417883		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **20 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKH 4827H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	FRONT WINDSCREEN RUBBER	NECESSARY	123.50	123.50
1	FRONT LH DOOR	DISTORTED	1,190.00	1,190.00
1	FRONT LH DOOR GLASS	SMASHED	390.00	390.00
1	FRONT LH DOOR GLASS OUTER MOULDING	DEFORMED	171.50	171.50
1	FRONT LH DOOR PROTECTOR	DISTORTED	188.60	188.60
1	FRONT LH DOOR OUTER HANDLE	DAMAGED	175.00	175.00
1	FRONT LH DOOR TOP HINGE }	BENT	84.00	84.00
1	FRONT LH DOOR LOWER HINGE }	BENT	92.00	-
1	FRONT LH DOOR STOPPER	DAMAGED	154.00	154.00
1	FRONT LH DOOR WEATHERSTRIP	CUT	174.00	174.00
1	FRONT LH DOOR INNER LOCK	JAMMED	634.80	634.80
1	FRONT LH DOOR INNER BOARD	DISTORTED	1,095.50	645.00
1	FRONT LH DOOR GLASS CHANNEL	BENT	151.50	151.50
1	FRONT LH DOOR GLASS INNER TOP MOULDING	NOT NECESSARY	151.00	-
1	FRONT LH DOOR POWER WINDOW SWITCH	DAMAGED	255.00	255.00
1	FRONT LH DOOR POWER WINDOW MOTOR	DISTORTED	840.00	355.00
1	FRONT LH DOOR POWER WINDOW REGULATOR	DISTORTED	230.00	230.00
1	SET FRONT LH DOOR FRAME BLACK STICKER	NECESSARY	75.00	75.00
1	FRONT LH DOOR PILLAR	DISTORTED	450.00	450.00
1	FRONT LH ROOF TOP SIDE PANEL	NOT NECESSARY	395.00	-
1	FRONT LH DOOR SIDE MIRROR HOUSING }	SMASHED	1,480.00	985.00
1	FRONT LH DOOR SIDE MIRROR }	SMASHED	-	-
1	FRONT LH DOOR SIDE MIRROR LAMP }	SMASHED	-	-
1	FRONT LH DOOR PILLAR INNER SIDE GARNISH	DISTORTED	135.00	135.00
1	FRONT LH DOOR BODY RUBBER	CUT	175.00	175.00
1	FRONT BONNET	NOT NECESSARY	1,145.00	-
1	FRONT WINDSCREEN	SHATTERED	1,475.00	1,475.00
1	FRONT BUMPER	NOT NECESSARY	512.00	-
2	FRONT BUMPER SIDE HOLDER @\$97.60	NOT NECESSARY	195.20	-
1	FRONT BUMPER SPONGE	NOT NECESSARY	121.00	-
2	FRONT BUMPER BRACKET @\$82.10	NOT NECESSARY	164.20	-

Report Ref No. CC4/LPC21007459/Ars3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	420.00	-
1	FRONT GRILLE	NOT NECESSARY	470.00	-
1	FRONT GRILLE EMBLEM	NOT NECESSARY	75.00	-
2	FRONT HEADLAMP @\$2652.00	O/S MISSING	5,304.00	1,650.00
2	FRONT HEADLAMP LOWER GARNISH @\$189.00	NOT NECESSARY	378.00	-
2	FRONT FENDER @\$790.40	N/S DISTORTED	1,580.80	602.00
1	FRONT FENDER 'VVTI' EMBLEM	NECESSARY	84.00	84.00
1	FRONT FENDER INNER SHIELD	DEFORMED	520.80	185.00
1	FRONT ENGINE LOWER COVER	NOT NECESSARY	255.00	-
1	FRONT CROSS MEMBER	NOT NECESSARY	2,250.00	-
1	FRONT SUPPORT PANEL	NOT NECESSARY	1,075.00	-
1	FRONT LH STEP GARNISH	NECESSARY	95.00	95.00
1	FRONT RH WHEEL HOUSING	NOT NECESSARY	550.00	-
1	LH ROCKER PANEL	DISTORTED	490.00	490.00
1	LH ROCKER PANEL GARNISH	DISTORTED	420.00	420.00
1	GEAR BOX ASSY	NOT NECESSARY	9,000.00	-
1	ENGINE OIL SUMP	NOT NECESSARY	750.00	-
1	DESKBOARD ASSY	DAMAGED	1,400.00	1,400.00
1	DESKBOARD GLOVE BOX COVER	DEFORMED	135.00	135.00
1	DESKBOARD GLOVE BOX COMPARTMENT	DEFORMED	155.00	155.00
1	REAR WINDSCREEN RUBBER	NOT NECESSARY	123.50	-
1	REAR BOOTLID	NOT NECESSARY	754.70	-
2	REAR BOOTLID HINGES @\$56.40	NOT NECESSARY	112.80	-
1	REAR BOOTLID UPPER LOCK	NOT NECESSARY	105.60	-
1	REAR BOOTLID LOWER LOCK	NOT NECESSARY	38.50	-
1	REAR BOOTLID WEATHERSTRIP	NOT NECESSARY	205.20	-
1	REAR BOOTLID HANDLE	NOT NECESSARY	350.50	-
1	REAR BOOTLID CENTRE LOGO	NOT NECESSARY	58.30	-
1	REAR BOOTLID '1.6' EMBLEM	NOT NECESSARY	32.50	-
1	REAR BOOTLID 'DUAL' EMBLEM	NOT NECESSARY	46.50	-
1	REAR BOOTLID 'ALTIS' EMBLEM	NOT NECESSARY	46.50	-
2	REAR BOOTLID REFLECTOR @\$161.50	NOT NECESSARY	323.00	-
1	REAR BOOTLID CABLE	NOT NECESSARY	58.10	-

Report Ref No. CC4/LPC21007459/Ars3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BOOTLID INSULATION	NOT NECESSARY	174.10	-
1	REAR LH LAMP	NOT NECESSARY	480.00	-
1	REAR LH LAMP HOUSING	NOT NECESSARY	84.10	-
1	REAR LH LAMP LOWER GARNISH	NOT NECESSARY	88.90	-
1	REAR END PANEL	NOT NECESSARY	670.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	202.70	-
1	REAR BUMPER	NOT NECESSARY	490.00	-
2	REAR BUMPER SIDE HOLDER @\$70.40	NOT NECESSARY	140.80	-
2	REAR BUMPER BRACKET @\$37.20	NOT NECESSARY	74.40	-
1	REAR BUMPER SPONGE	NOT NECESSARY	123.50	-
1	REAR LH FENDER	NOT NECESSARY	930.00	-
1	REAR LH FENDER INNER TRIM	NOT NECESSARY	351.70	-
1	REAR LH FENDER AIR VENT	NOT NECESSARY	42.00	-
1	REAR SPARE TYRE TOP BOARD	NOT NECESSARY	280.00	-
1	REAR SPARE TYRE WELL	NOT NECESSARY	780.90	-
	LESS 25% DISCOUNT		-11,249.80	-3,358.23
			33,749.40	10,074.67
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET FRONT BUMPER CLIPS (SN)	NOT NECESSARY	60.00	-
1	SET FRONT FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	60.00	-
1	FRONT RH SPORT RIM (SN)	NOT NECESSARY	750.00	-
1	FRONT RH TYRE (SN)	NOT NECESSARY	380.00	-
1	SET REAR REVERSE SENSOR (SN)	NOT NECESSARY	380.00	-
			1,630.00	-
	<b><u>LABOUR</u></b>			
	TOWING FEE.		200.00	60.00
	TO SUPPLY FRONT & REAR WINDSCREEN SEALANT .	NOT NECESSARY	150.00	-
	TO SUPPLY REAR END PANEL INNER SEALANT .	NOT NECESSARY	200.00	-
	TO CHECK WHEEL ALIGNMENT.		100.00	80.00
	REMOVE & REINSTALL REVERSE SENSOR .	NOT NECESSARY	200.00	-
	REMOVE & REINSTALL PETROL TANK.	NOT NECESSARY	200.00	-
	REMOVE & REINSTALL ROOF LINING.		200.00	150.00

Report Ref No. CC4/LPC21007459/Ars3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & REINSTALL DOOR GLASS .		150.00	80.00
	REMOVE & REINSTALL DESKBOARD .		300.00	220.00
	REMOVE & REINSTALL CUSHION AND CARPET .		150.00	100.00
	REMOVE & REINSTALL GEAR BOX .	NOT NECESSARY	800.00	-
	REMOVE & REINSTALL ENGINE .	NOT NECESSARY	400.00	-
	REMOVE & REINSTALL FRONT SUSPENSION.	NOT NECESSARY	300.00	-
	REMOVE & REINSTALL FRONT AND REAR WINDSCREEN.	NOT NECESSARY	300.00	-
	REMOVE,REPLACE & REPAIR CONSISTENT TO THE ACCIDENT.		3,000.00	1,600.00
	RESPRAY PAINTING .		2,000.00	1,200.00
	TUFF KOTE.		150.00	150.00
			8,800.00	3,640.00
<b>GRAND TOTAL</b>			<b>44,179.40</b>	<b>13,714.67</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>10,000.00</b>

Report Ref No. CC4/LPC21007459/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SKH 4827H

## INSPECTION





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

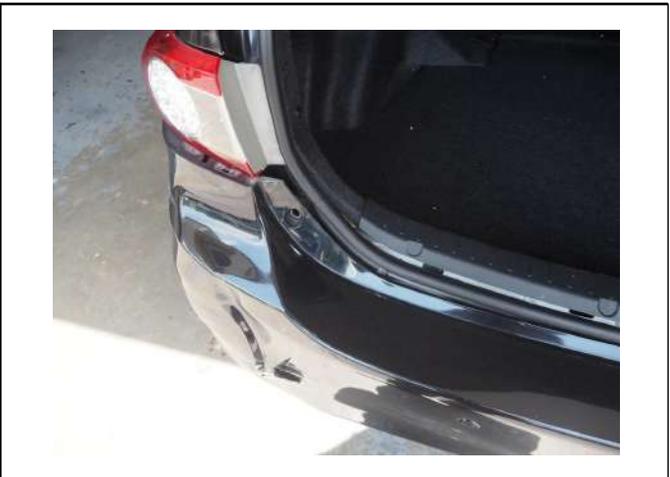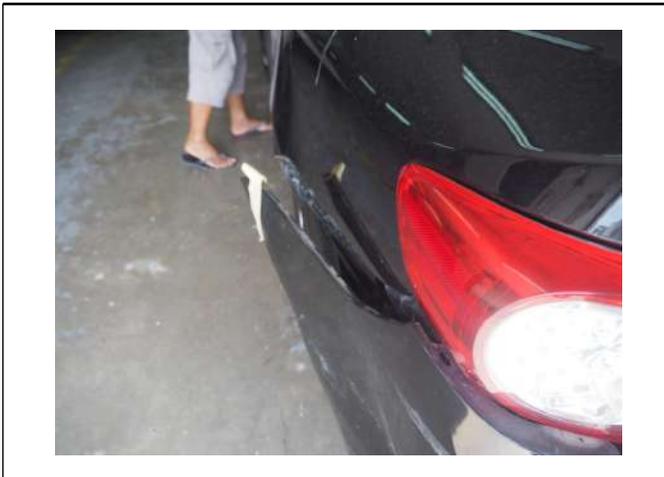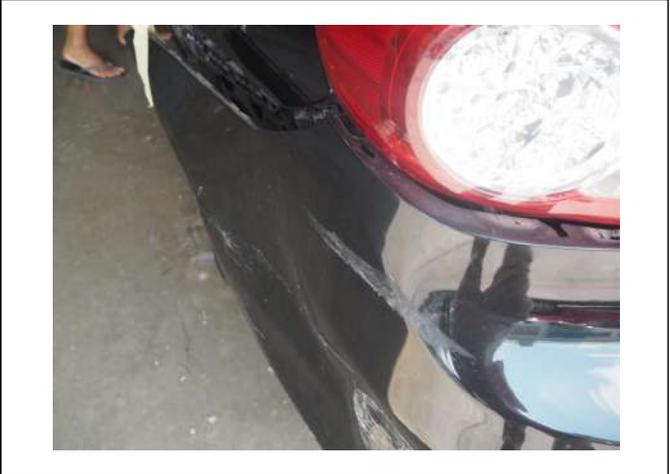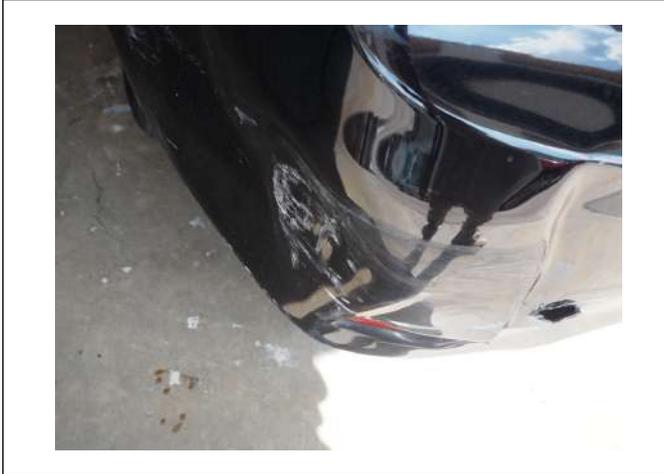






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

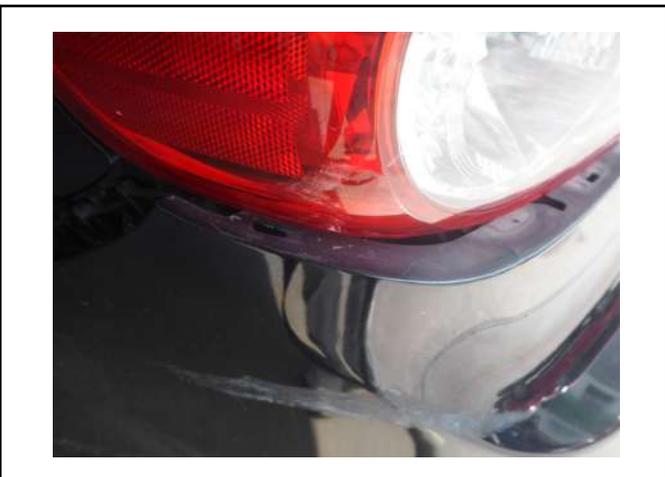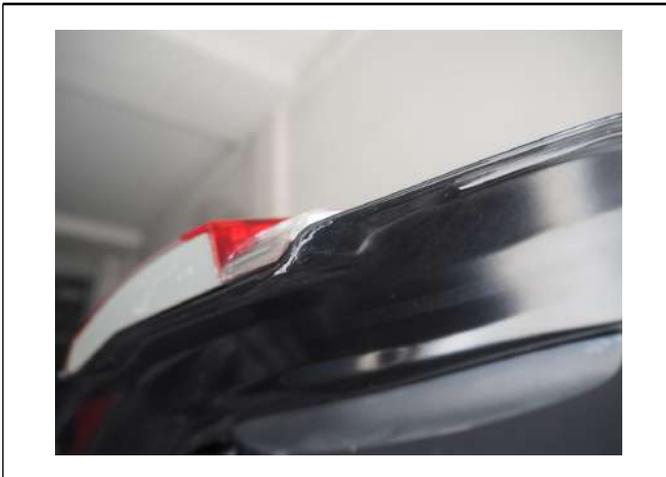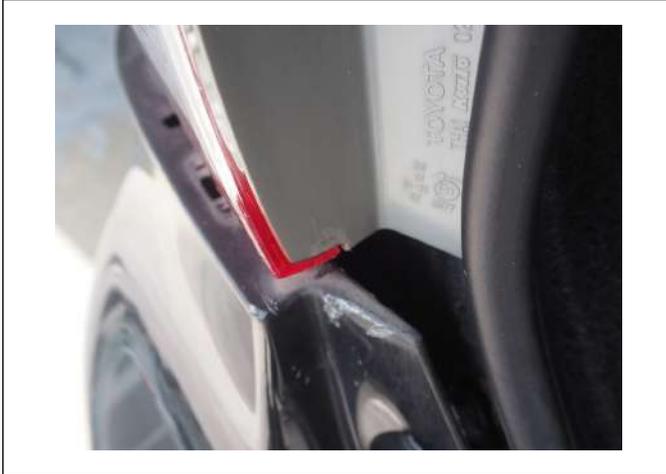





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

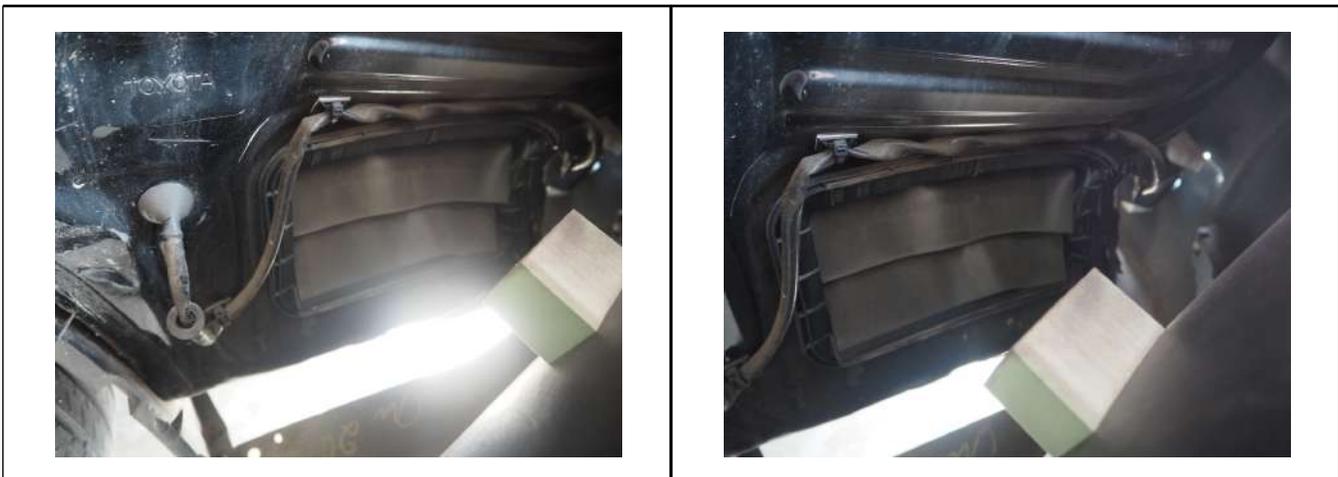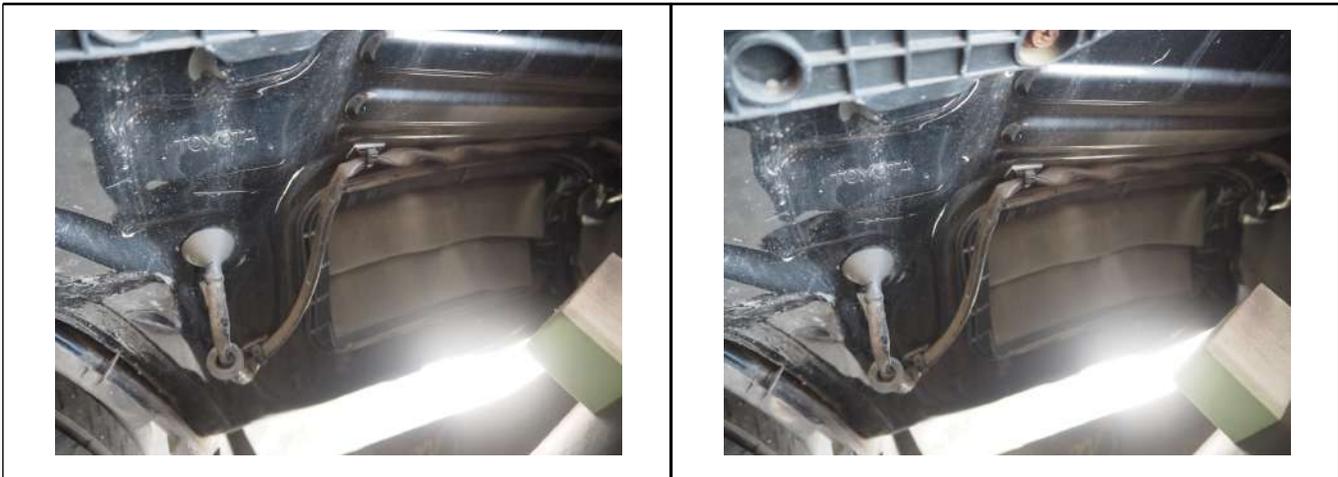




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

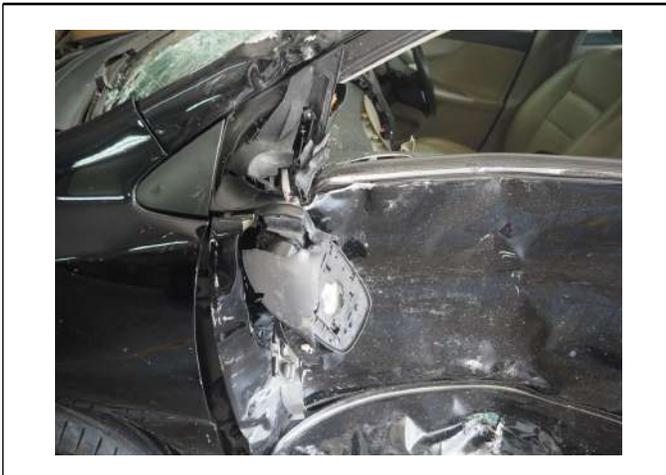



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

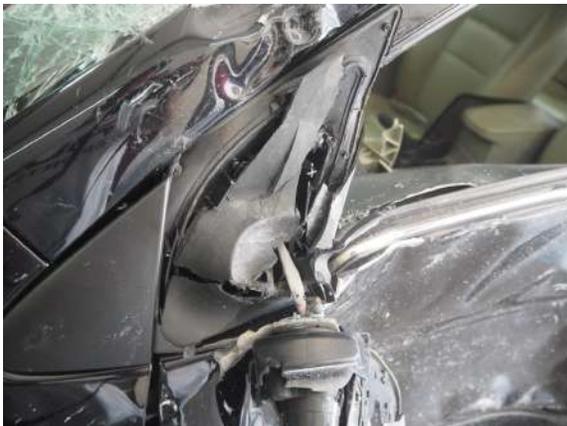



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

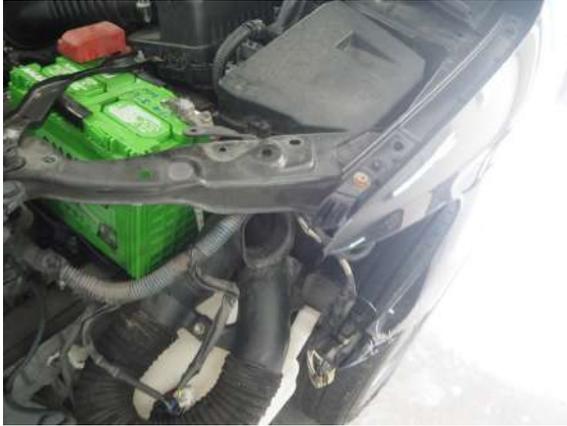








# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

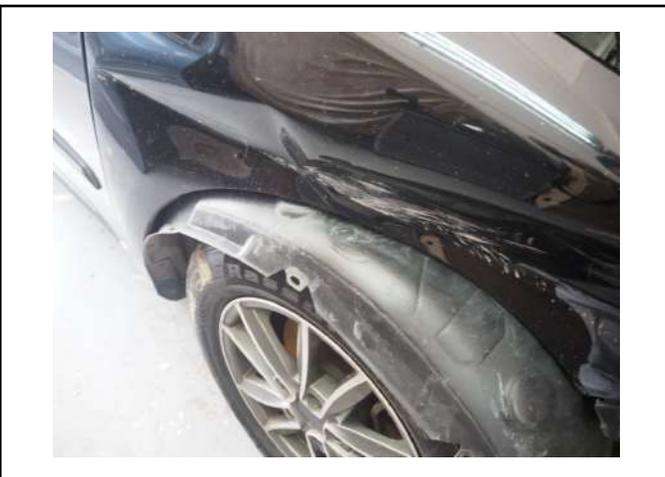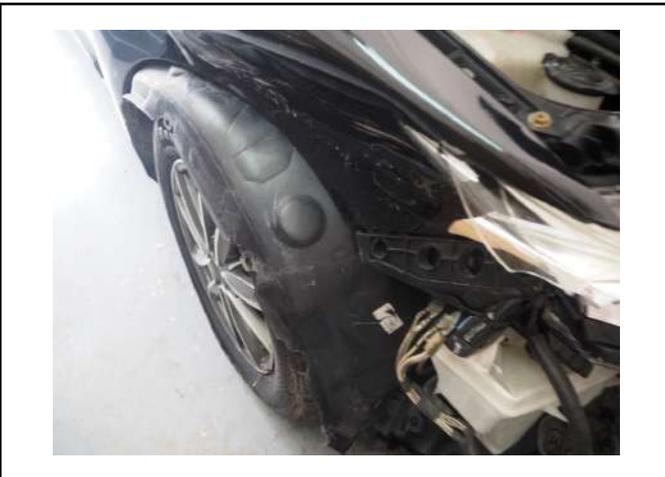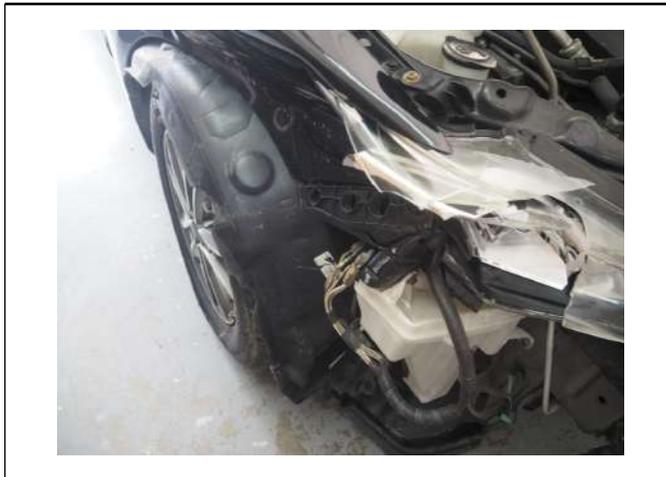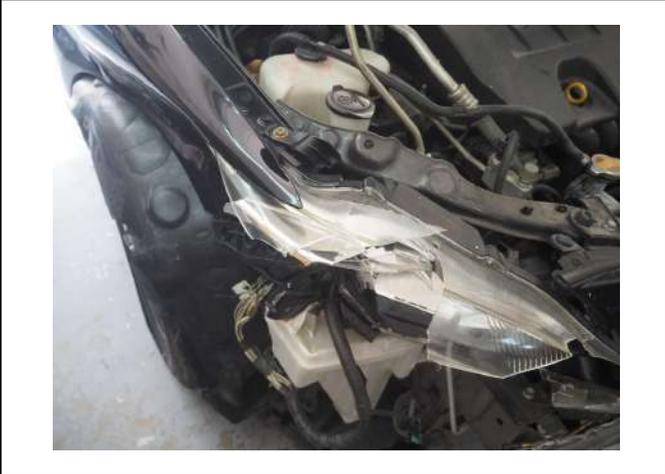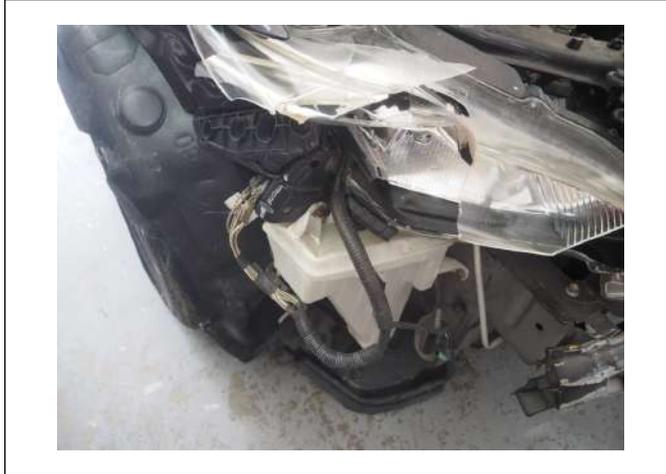



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R










# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

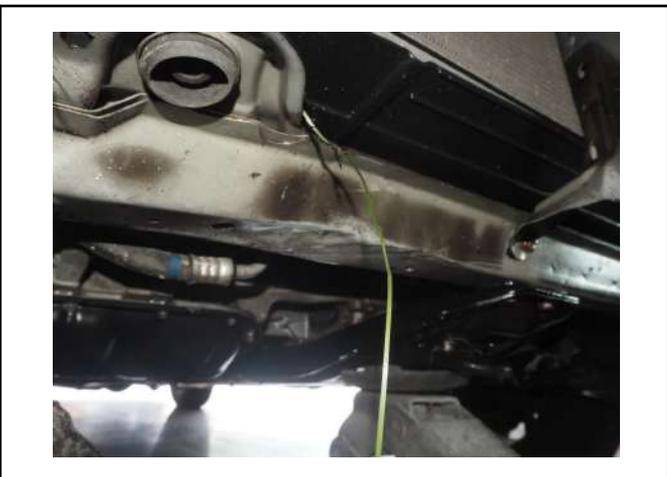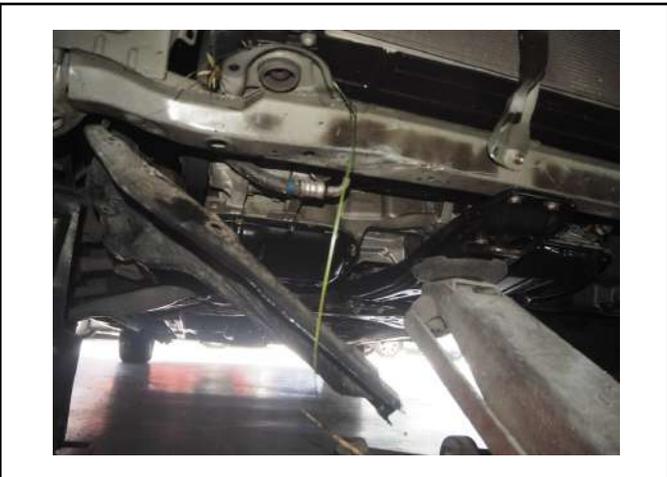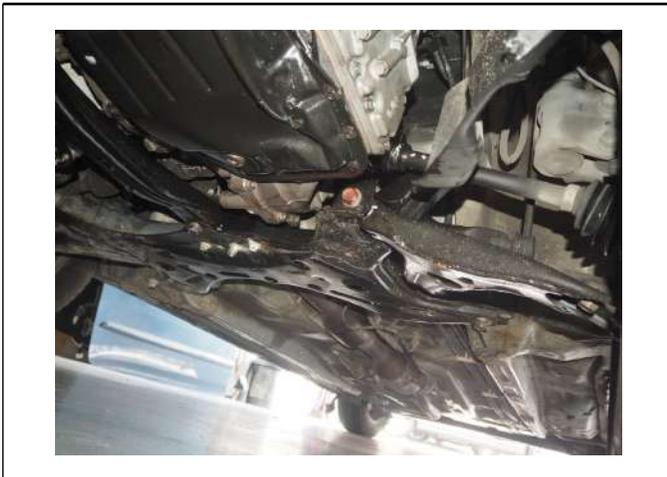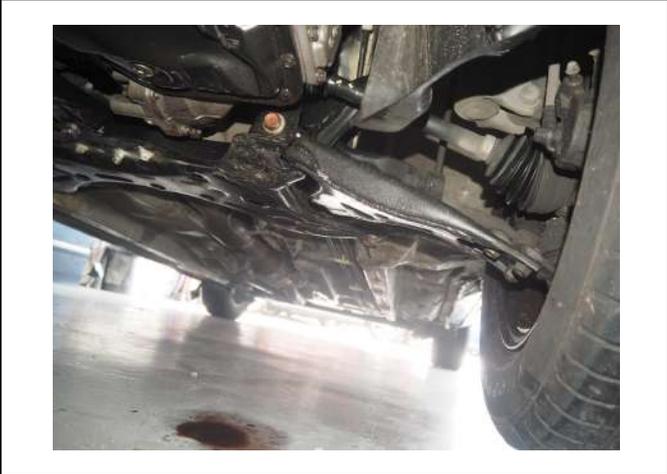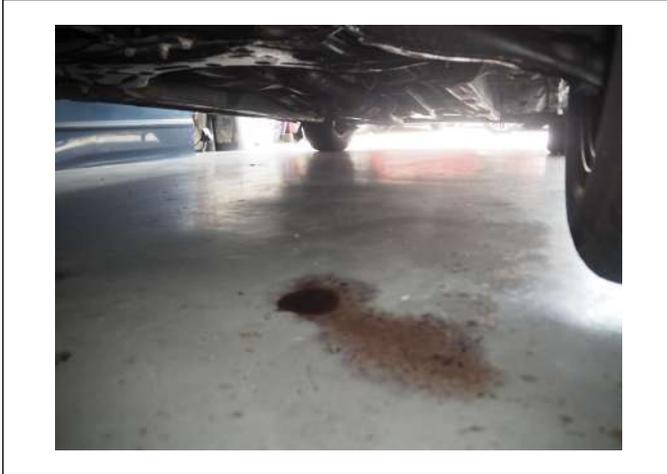



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

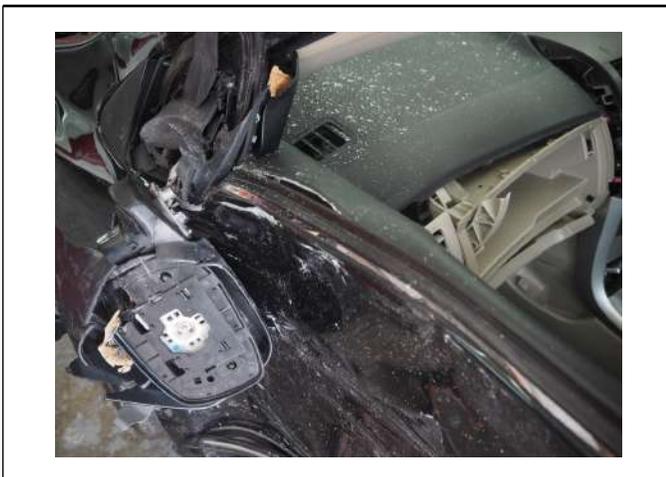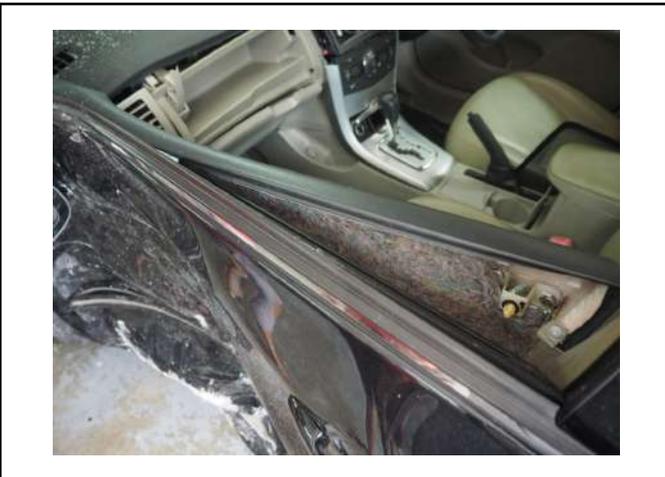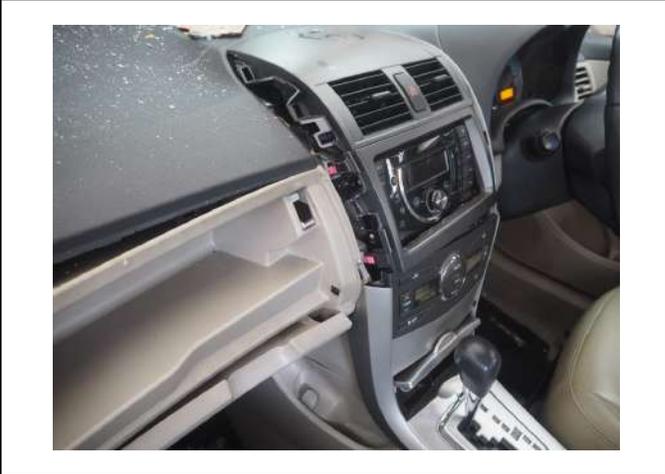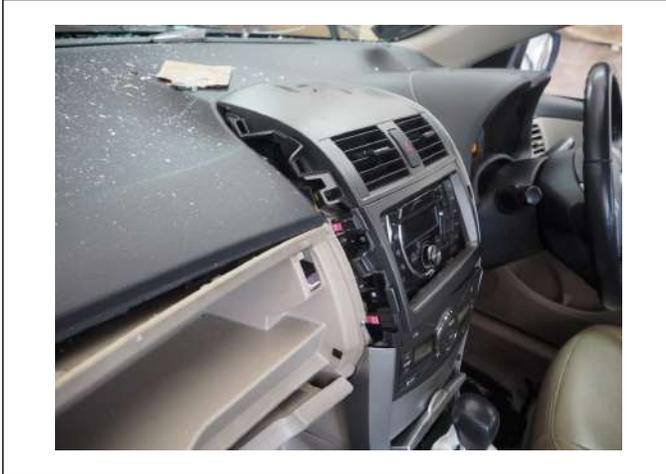



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SKH 4827H**

**RE-INSPECTION**





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

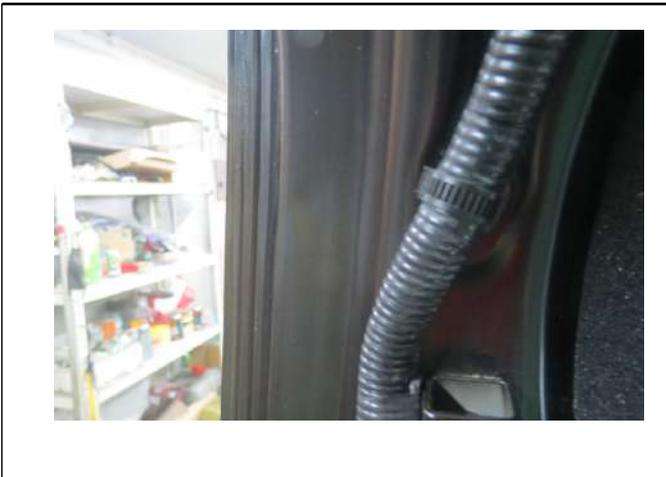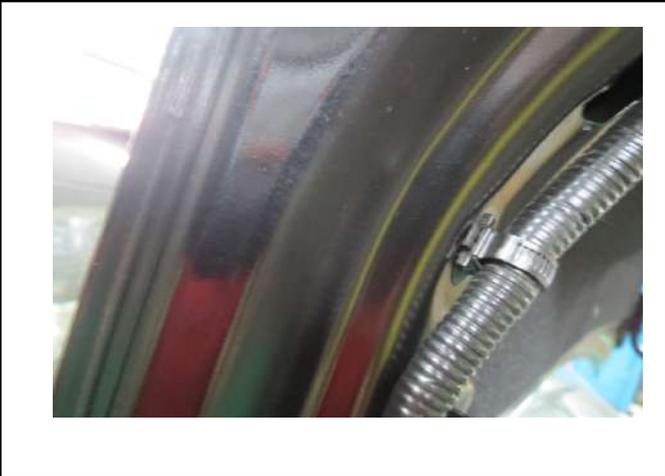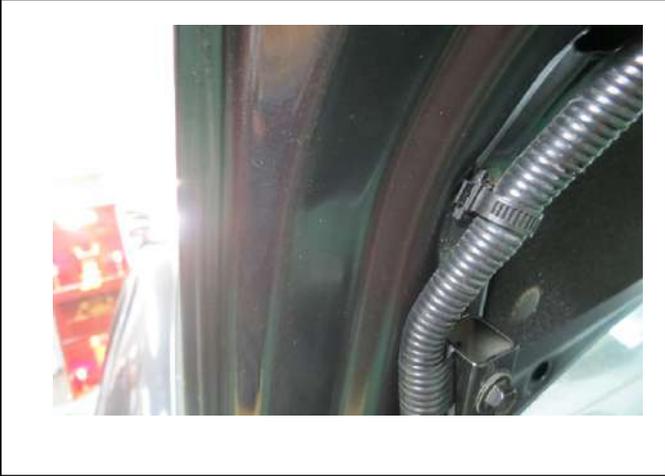



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

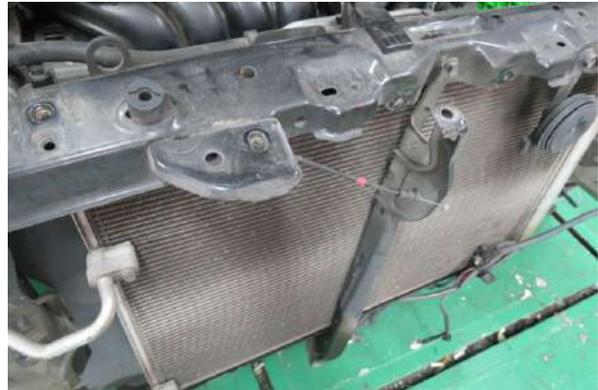



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

