



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2202776
3 ANSON ROAD #16-00	INV Date	17/05/2022
SPRINGLEAF TOWER	Reference	CC6/CTI21007679/Aea3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SLU 9676M
Insured Veh.	GBC 1651A
Claim No.	SNM21D203892/C02
Policy No.	DMCVSNA00049482100
Accident Date	13/07/2021
Inspection Date	14/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21007679/Aea3q2 Date: 17/05/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBC 1651A	Veh. Inspected	SLU 9676M
Policy No.	DMCVSNA00049482100	Coverage (\$)	0.00
Claim No.	SNM21D203892/C02	Excess (\$)	0.00
Assign From		Assign Date	14/07/2021
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA PRIUS ALPHA HYBRID	c.c	1797
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	ZVW400026302	Colour	GREY
Odometer	298816 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	CRUCERO	6 mm
L/H Front Tyre	215/60 R16	CRUCERO	6 mm
R/H Rear Tyre	215/60 R16	CRUCERO	6 mm
L/H Rear Tyre	215/60 R16	CRUCERO	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	13/07/2021	Inspection Date	14/07/2021
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		16 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 9676M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT BONNET	NOT NECESSARY	980.20	-
1	FRONT BUMPER	DEFORMED	630.00	630.00
2	FRONT BUMPER SIDE RETAINER @\$62.30	NECESSARY	124.60	124.60
1	FRONT BUMPER LOGO	NECESSARY	90.00	90.00
1	FRONT BUMPER CENTRE GRILLE	CRACKED	360.00	360.00
1	FRONT BUMPER LOWER GRILLE	CRACKED	580.00	205.00
2	FRONT BUMPER LOWER GRILLE FOGLAMP @\$210.00	N/S CRACKED	420.00	210.00
2	FRONT BUMPER LOWER GRILLE TOWING COVER @\$60.00	NOT NECESSARY	120.00	-
2	FRONT BUMPER DAY LIGHT @\$370.30	NOT NECESSARY	740.60	-
2	FRONT BUMPER DAY LIGHT UPPER GARNISH @\$80.00	NOT NECESSARY	160.00	-
1	FRONT BUMPER REINFORCEMENT	DENTED	499.00	499.00
1	FRONT BUMPER REINFORCEMENT SPONGE	CRACKED	102.00	102.00
1	FRONT BUMPER NUMBER PLATE HOLDER	CRACKED	130.00	130.00
1	FRONT BUMPER UNDER COVER	NOT NECESSARY	480.30	-
2	HEADLAMP @\$910.00	CRACKED	1,820.00	1,820.00
2	HEADLAMP LOWER BRACKET @\$80.70	NOT NECESSARY	161.40	-
2	FRONT FENDER @\$520.30	TO REPAIR SEE LABOUR	1,040.60	-
2	FRONT FENDER EMBLEM @\$90.00	NECESSARY	180.00	180.00
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	1,588.30	-
1	FRONT SUPPORT PANEL TOP COVER	NOT NECESSARY	140.00	-
1	TAILGATE	DISTORTED	1,455.90	929.00
1	TAILGATE LOGO	NECESSARY	72.10	72.10
1	TAILGATE EMBLEM 'PRIUS'	NECESSARY	68.00	68.00
1	TAILGATE EMBLEM 'HYBRID SYNERGY DRIVE'	NECESSARY	60.00	60.00
2	TAILGATE DAMPER @\$280.00	NOT NECESSARY	560.00	-
2	TAILGATE HINGE @\$60.00	NOT NECESSARY	120.00	-
1	TAILGATE LOCK	DAMAGED	360.00	360.00
1	TAILGATE LOCK CATCH	NOT NECESSARY	80.00	-
1	BOOTLID INNER BOARD	CRACKED	530.00	530.00

Report Ref No. CC6/CTI21007679/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	BOOTLID INNER SIDE BOARD @\$230.00	DEFORMED	460.00	460.00
1	BOOTLID INNER TOP BOARD	NOT NECESSARY	220.00	-
1	BOOTLID INNER HANDLE	NOT NECESSARY	60.00	-
2	TAILGATE STOPPER @\$20.00	NOT NECESSARY	40.00	-
1	TAILGATE WEATHERSTRIPE	CUT	320.00	320.00
1	TAILGATE SPOILER	NOT NECESSARY	988.70	-
1	TAILGATE WINDSCREEN	SHATTERED	1,320.00	1,320.00
1	TAILGATE WINDSCREEN MOULDING	NECESSARY	155.60	155.60
1	TAILGATE WIPER BLADE ARM	CUT	90.00	90.00
1	TAILGATE WIPER BLADE	CUT	60.00	60.00
1	TAILGATE WIPER BLADE MOTOR	DAMAGED	622.00	364.00
1	SET TAILGATE NUMBER PLATE LAMP	NOT NECESSARY	180.00	-
1	TAILGATE NUMBER PLATE OUTER GARNISH	CRACKED	420.00	420.00
1	REAR BUMPER	DISTORTED	820.00	820.00
2	REAR BUMPER SIDE RETAINER @\$60.30	NECESSARY	120.60	120.60
2	REAR BUMPER REFLECTOR @\$90.00	NOT NECESSARY	180.00	-
2	TAILLAMP @\$630.00	CRACKED	1,260.00	1,260.00
2	TAILLAMP PANEL @\$350.00	BUCKLED	700.00	700.00
2	REAR FENDER @\$1115.90	O/S BUCKLED / N/S TO REPAIR SEE LABOUR	2,231.80	1,115.90
2	REAR FENDER INER TRM (TOP) @\$530.00	CRACKED	1,060.00	700.00
2	REAR FENDER INNER TRIM (LOWER) @\$888.50	CRACKED	1,777.00	1,312.00
2	REAR FENDER MUD FLAG @\$150.00	NOT NECESSARY	300.00	-
2	REAR FENDER AIR VENT @\$90.00	NOT NECESSARY	180.00	-
2	REAR QUARTER GLASS @\$360.00	NOT NECESSARY	720.00	-
2	REAR QUARTER GLASS MOULDING @\$90.00	NECESSARY	180.00	180.00
1	REAR END PANEL	DISTORTED	630.00	630.00
1	REAR END PANEL TOP GARNISH	DEFORMED	255.80	255.80
1	REAR FLOOR PANEL	BUCKLED	1,055.90	1,055.90
1	REAR FLOOR PANEL CENTRE TRAY	DEFORMED	630.00	396.00
1	REAR FLOOR PANEL CENTRE TRAY COVER	DEFORMED	530.00	381.00
1	REAR FLOOR PANEL SIDE TRAY RH	DEFORMED	230.00	230.00
2	REAR FLOOR PANEL SIDE TRAY COVER @\$280.00	NOT NECESSARY	560.00	-

Report Ref No. CC6/CTI21007679/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR CHASSIS SUB ASSY RH	TO REPAIR SEE LABOUR	280.50	-
1	REAR CHASSIS SUB ASSY LH	TO REPAIR SEE LABOUR	280.50	-
1	REAR TOOLS SPONGE	CRACKED	280.00	280.00
1	REAR EXHAUST PIPE	NOT NECESSARY	922.30	-
2	REAR DOOR @\$1260.80	TO REPAIR SEE LABOUR	2,521.60	-
1	AXLE	NOT NECESSARY	2,688.30	-
2	REAR KNUCKLE ARM @\$355.90	NOT NECESSARY	711.80	-
2	REAR KNUCKLE ARM BEARING @\$198.20	NOT NECESSARY	396.40	-
2	REAR SHOCK ABSORBER @\$430.50	NOT NECESSARY	861.00	-
	LESS 25% DISCOUNT		-10,238.20	-4,749.13
			30,714.60	14,247.37
2	REAR SEAT @\$2550.00 (LOCAL REPAIR) (SN)	DAMAGED	5,100.00	300.00
	LESS 25% DISCOUNT		-1,275.00	-
			3,825.00	300.00
	SPECIAL NETT ITEMS			
1	FRONT NUMBER PLATE (SN)	BENT	50.00	50.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	20.00	20.00
1	REAR NUMBER PLATE (SN)	BENT	50.00	50.00
1	TAILGATE SEALANT (SN)	NOT NECESSARY	120.00	-
1	SET TAILGATE INNER BOARD CLIPS (SN)	NECESSARY	20.00	20.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	120.00	60.00
1	TAILGATE WINDSCREEN SOLAR FILM (SN)	NECESSARY	350.00	200.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	20.00	20.00
2	TAILLAMP SEALANT @\$120.00 (SN)	NOT NECESSARY	240.00	-
2	REAR FENDER SEALANT @\$120.00 (SN)	NOT NECESSARY	240.00	-
2	REAR QUARTER GLASS SEALANT @\$100.00 (SN)	O/S NECESSARY	200.00	40.00
1	REAR END PANEL INSULATOR SEAL (SN)	NECESSARY	150.00	60.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	20.00
1	REAR FLOOR PANEL INSULATOR SEAL (SN)	NOT NECESSARY	150.00	-

Report Ref No. CC6/CTI21007679/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
1	REVERSE CAMERA (SN)	NOT NECESSARY	550.00	-
1	BATTERY (SN)	NOT NECESSARY	350.00	-
			2,870.00	740.00
	LABOUR			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF FRONT FENDER,FRONT SUPPORT PANEL,REAR FENDER LH,REAR CHASSIS SUB ASSY RH,REAR CHASSIS SUB ASSY LH AND REAR DOOR.		4,000.00	2,250.00
	TO SPRAY PAINT AFFECTED AREA.		3,000.00	1,850.00
	TUFF COAT.		250.00	150.00
	WIRING CHECK .		180.00	60.00
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIX FUEL TANK TO FACILITATE REPAIR.		250.00	80.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		100.00	50.00
	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING.		120.00	50.00
	TRANSFER TAILGATE MECHANISM .		120.00	80.00
	REMOVE AND REFIX REAR WINDSCREEN .		160.00	120.00
	REMOVE AND REFIX REAR QUARTER GLASS .		120.00	60.00
	REMOVE AND REFIX REAR EXHAUST PIPE .	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIX REAR TOP CUSHION .		550.00	300.00
	TO APPLY PHV STICKER .		50.00	30.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	320.00	-
			9,560.00	5,080.00
	GRAND TOTAL		46,969.60	20,367.37



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			16,300.00
---	--	--	------------------

Report Ref No. CC6/CTI21007679/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 9676M

INSPECTION

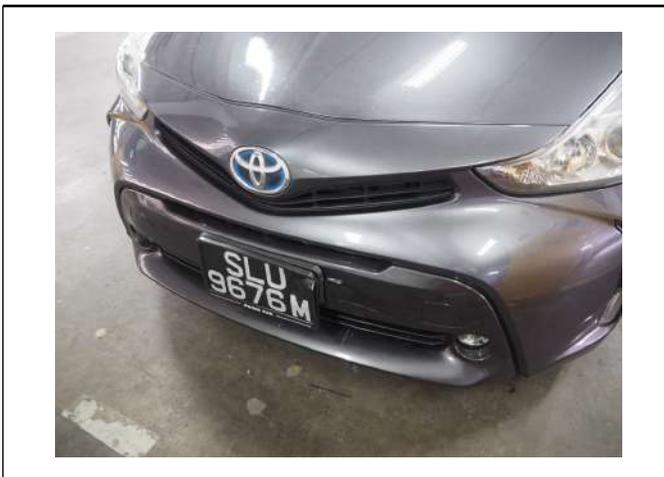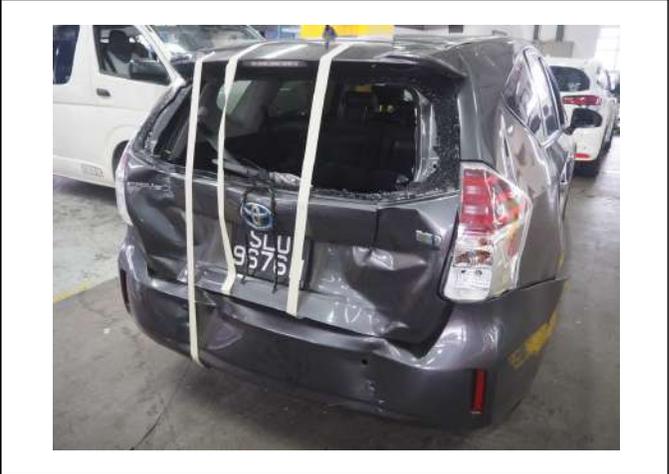



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

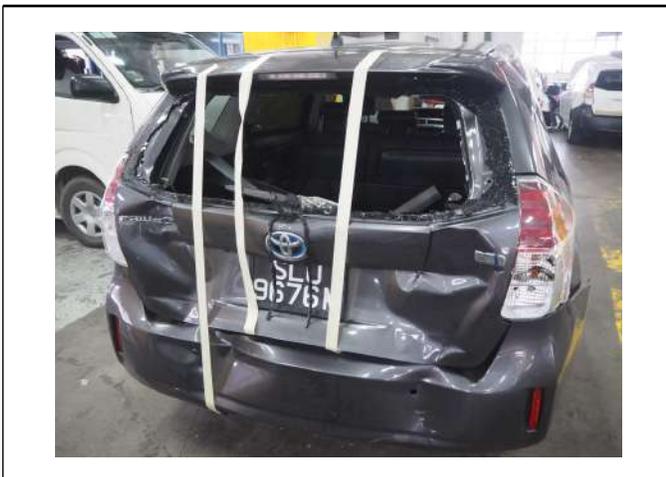






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

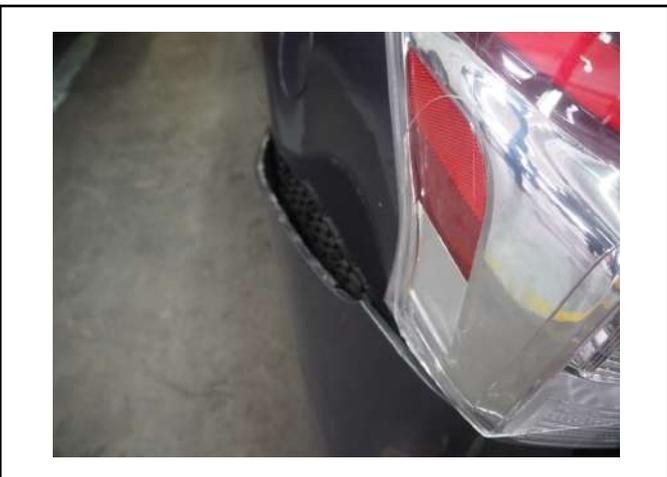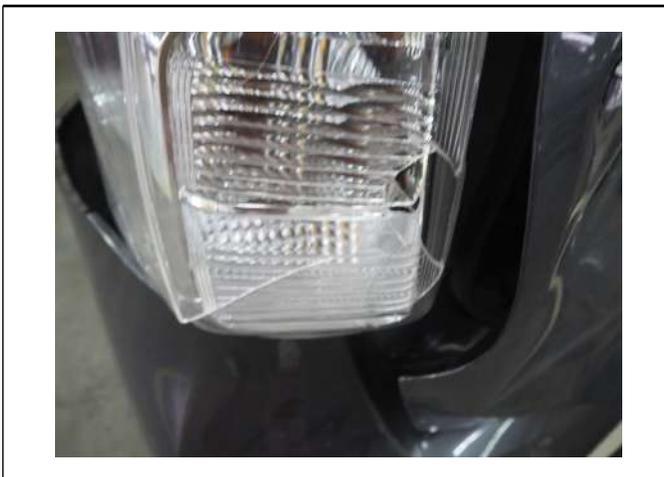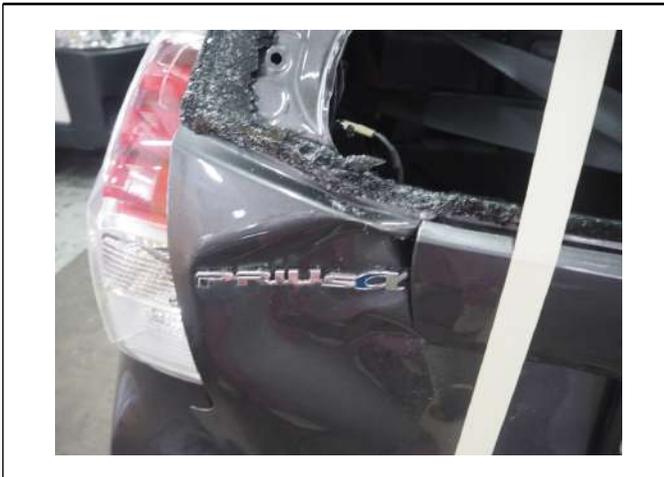



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

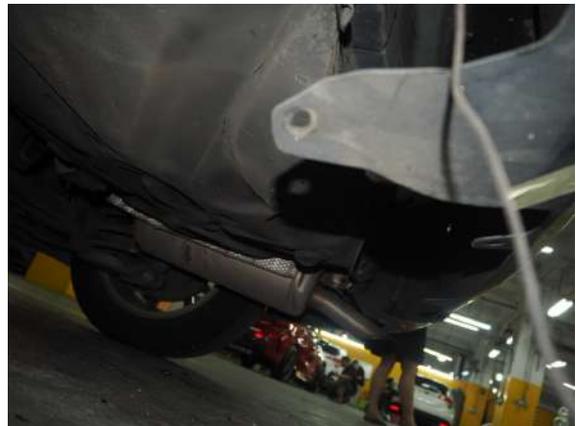



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 9676M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

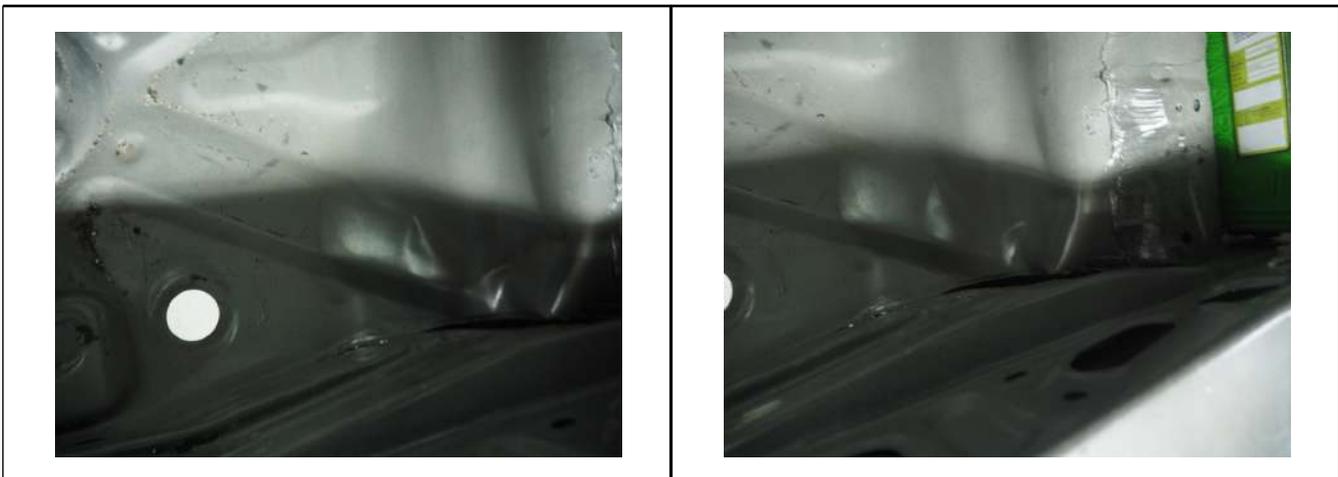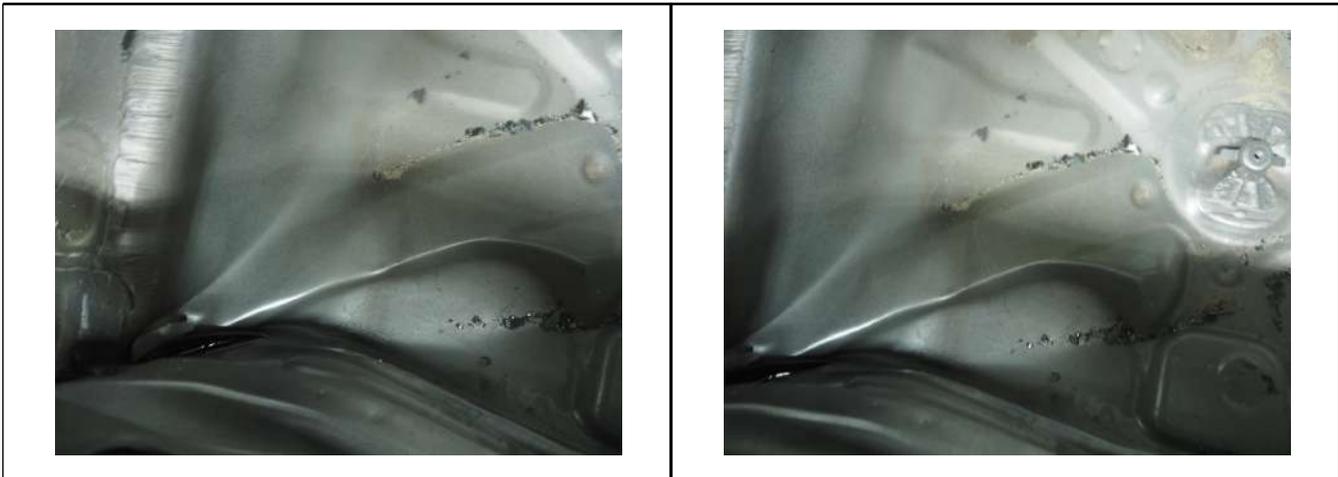



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

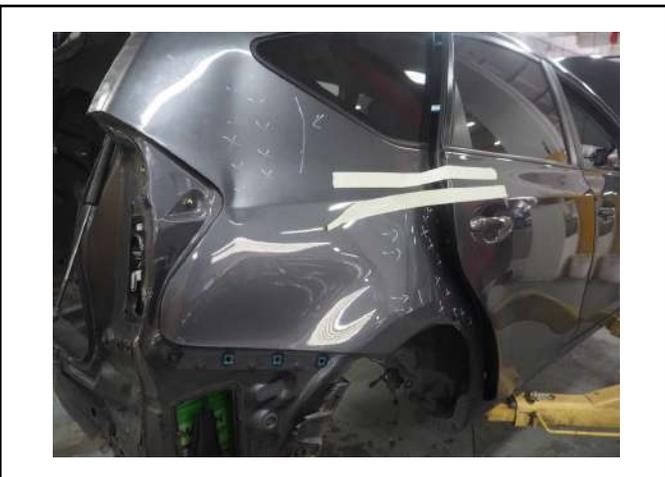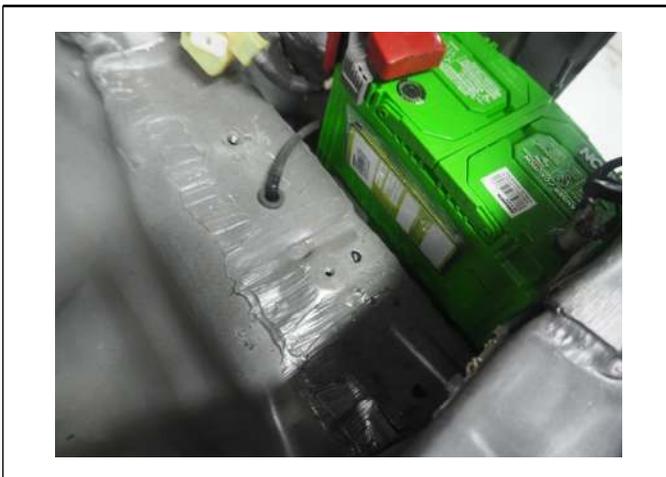





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

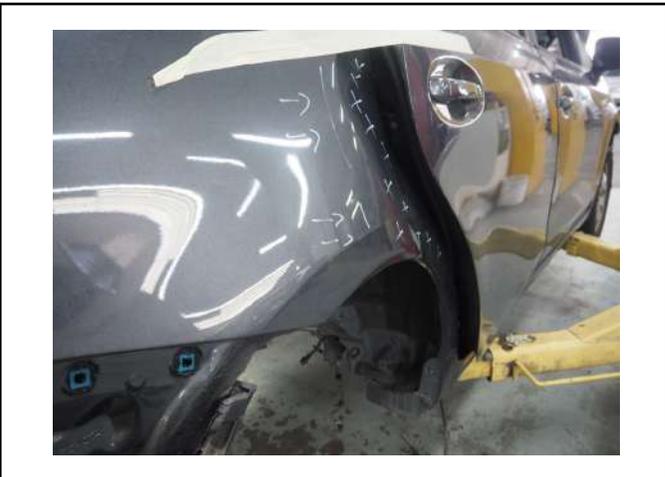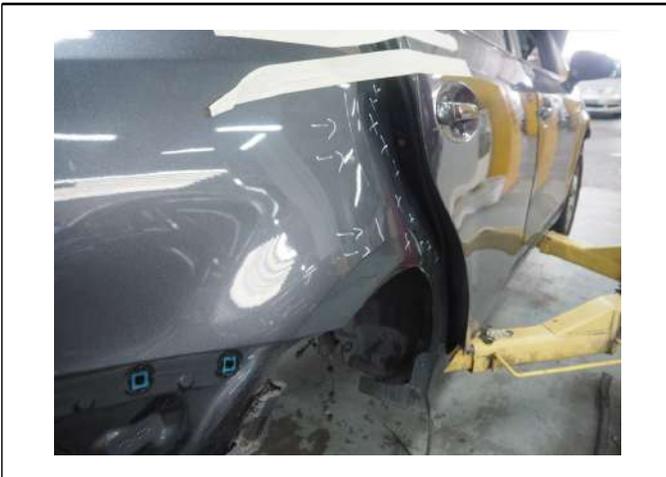




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

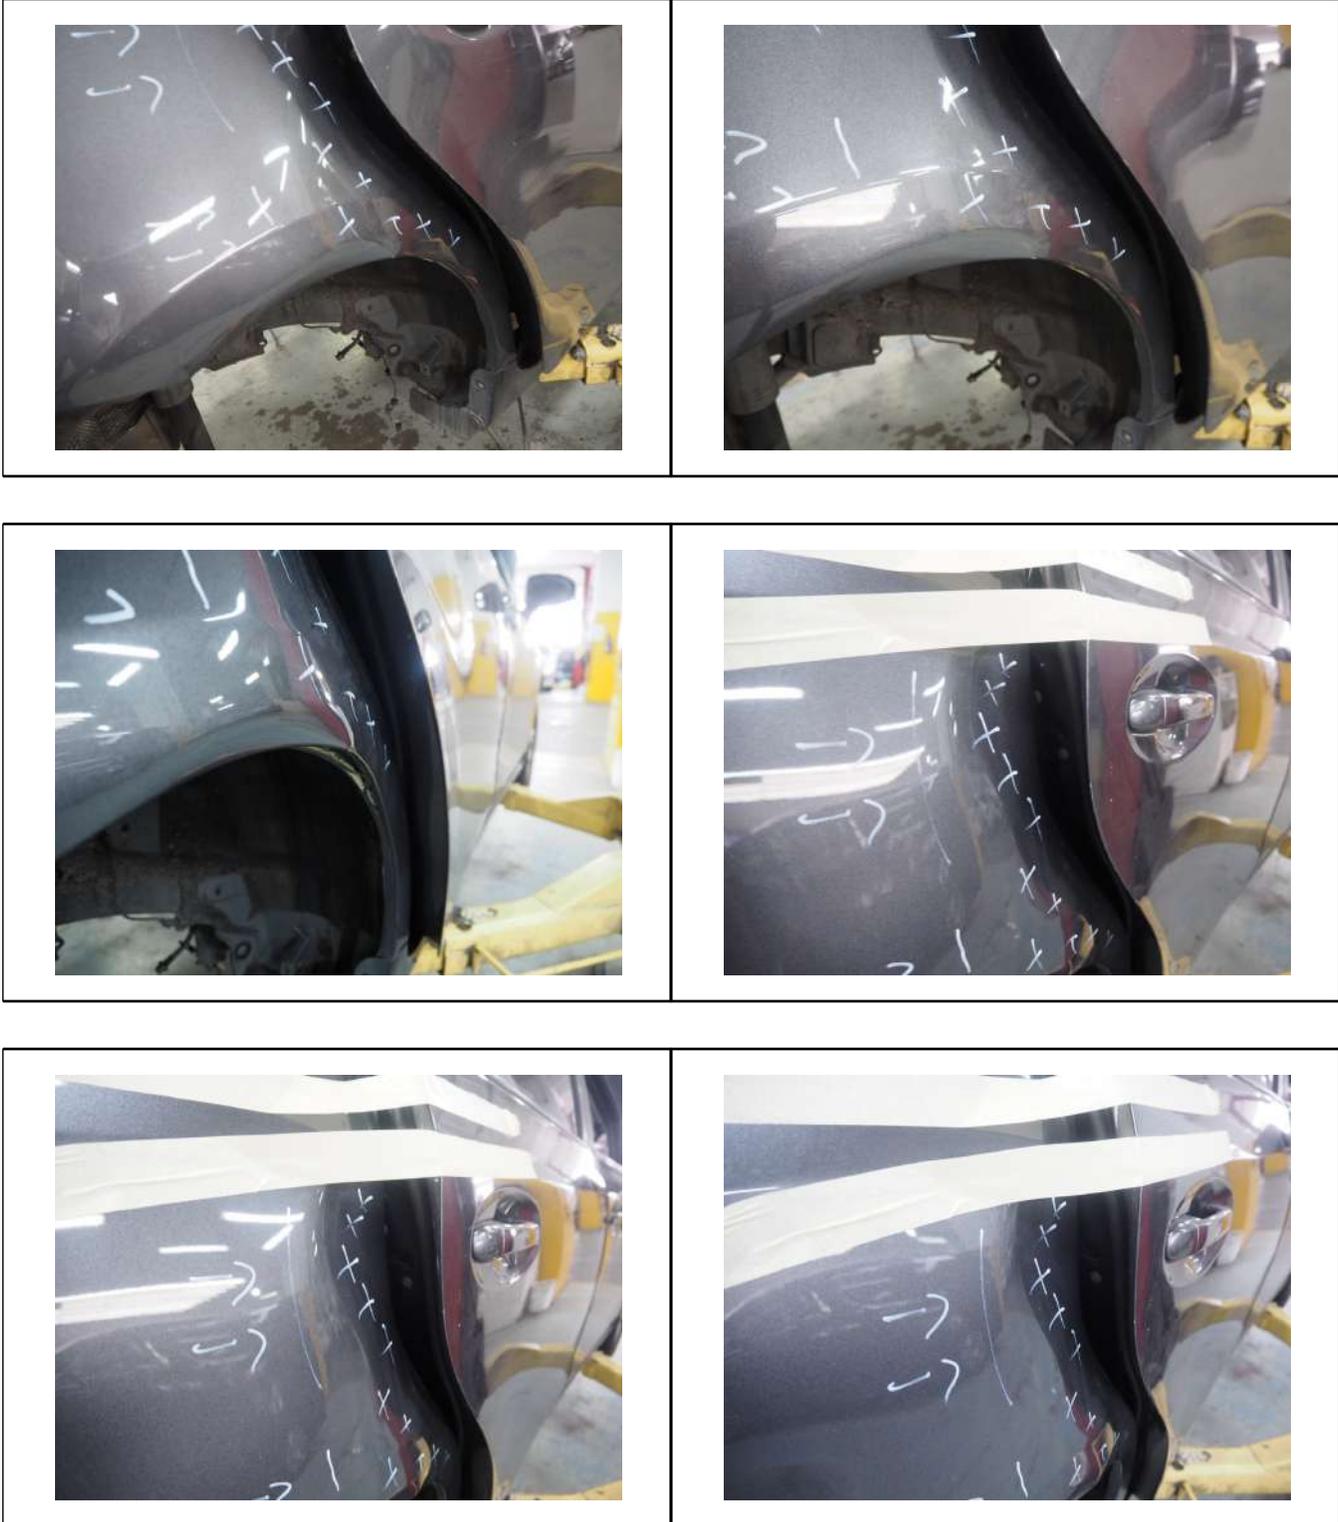



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

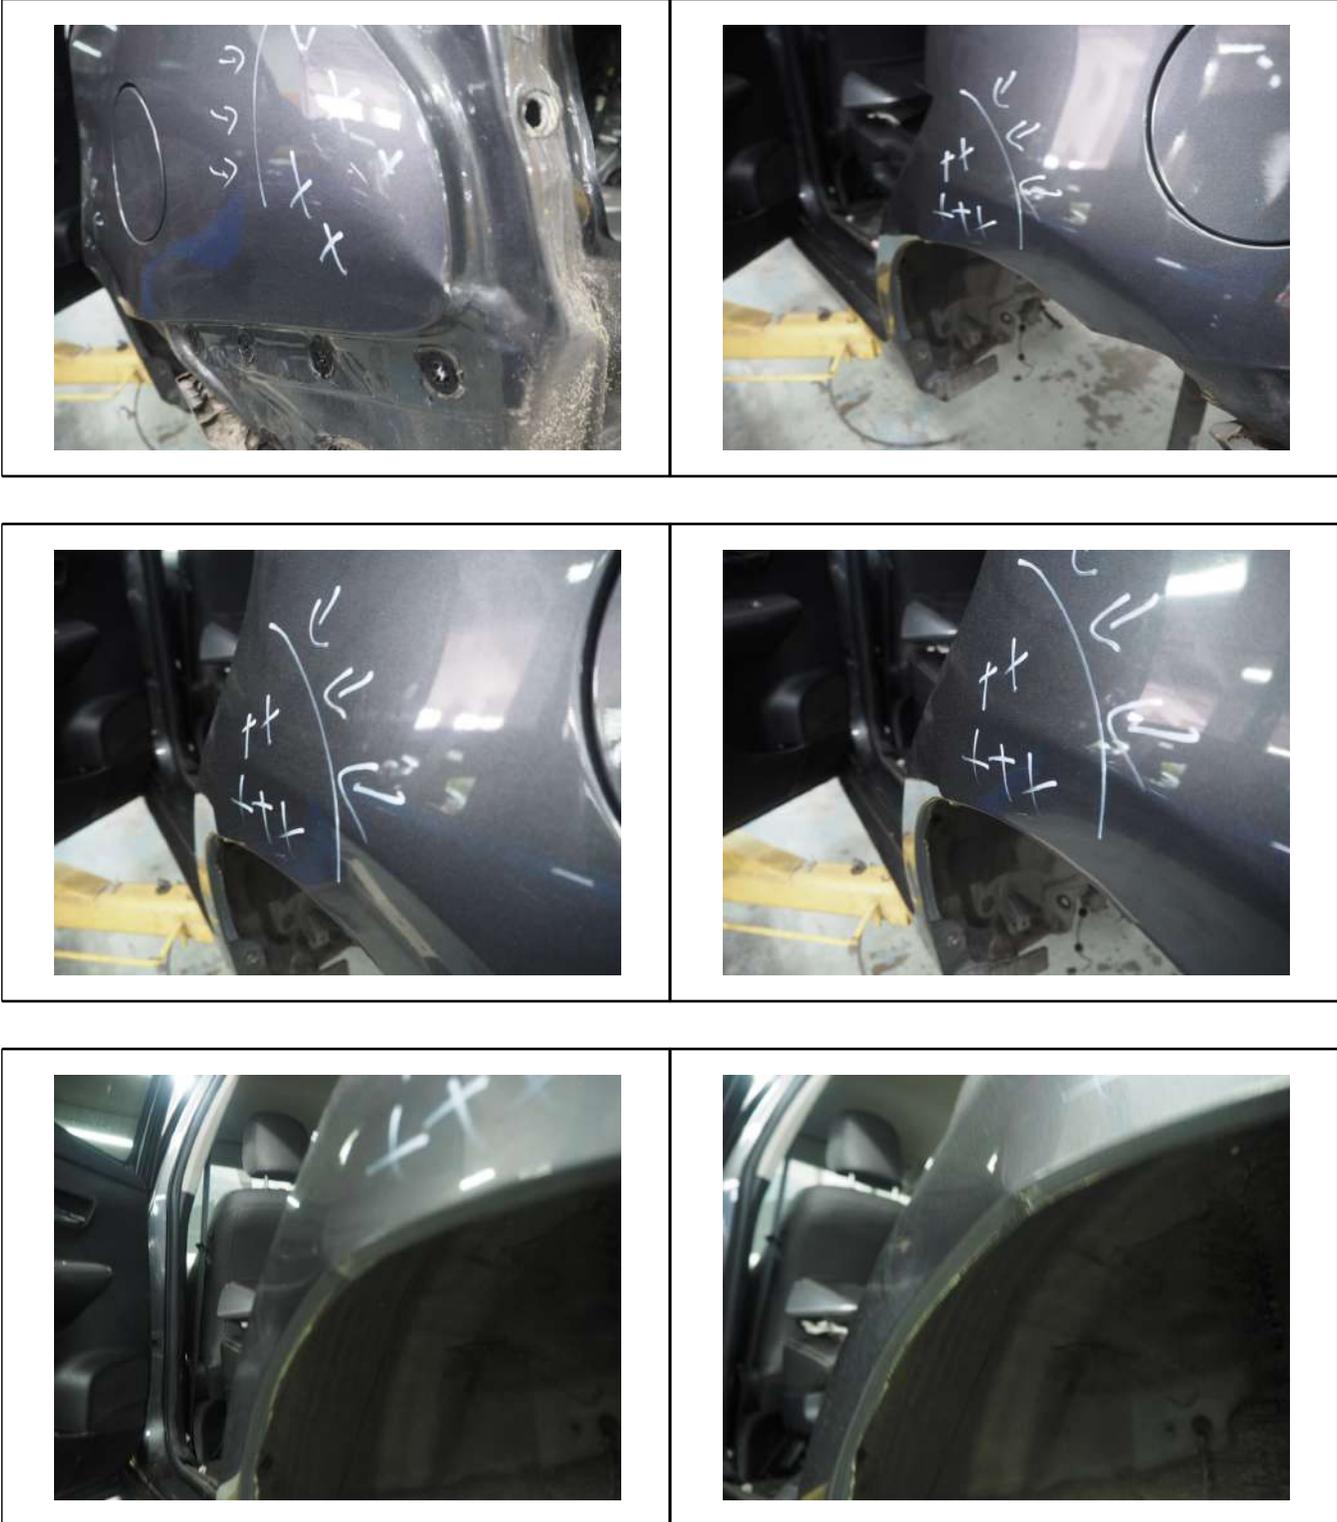





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

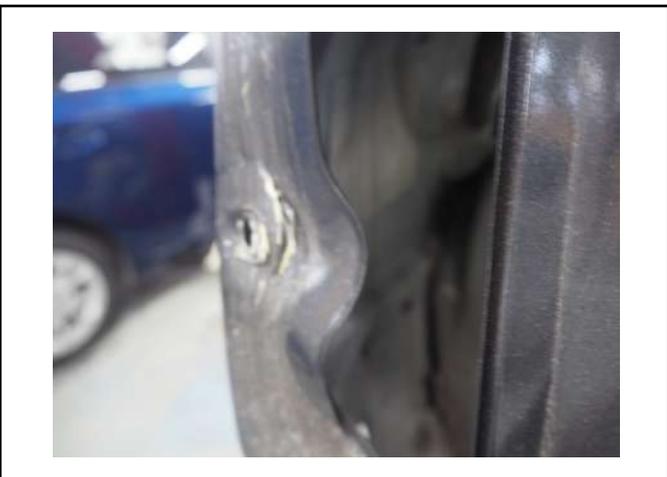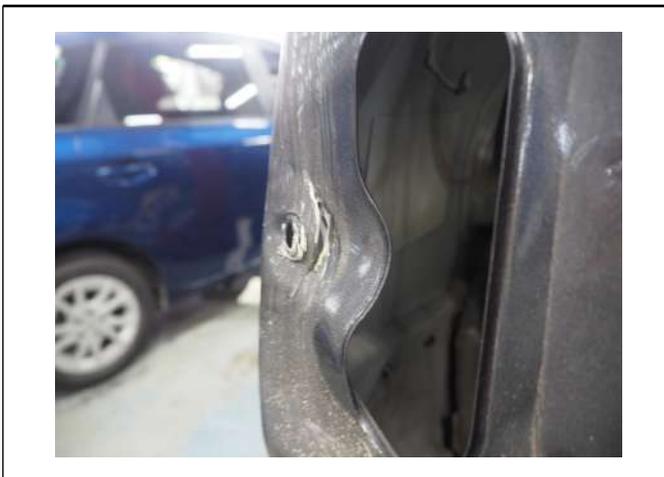







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

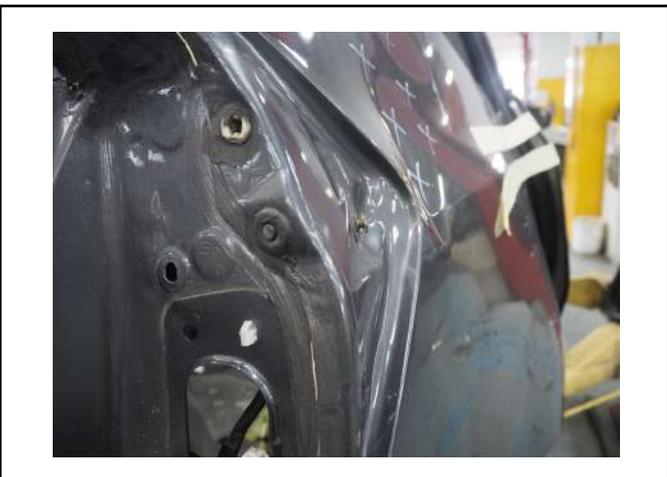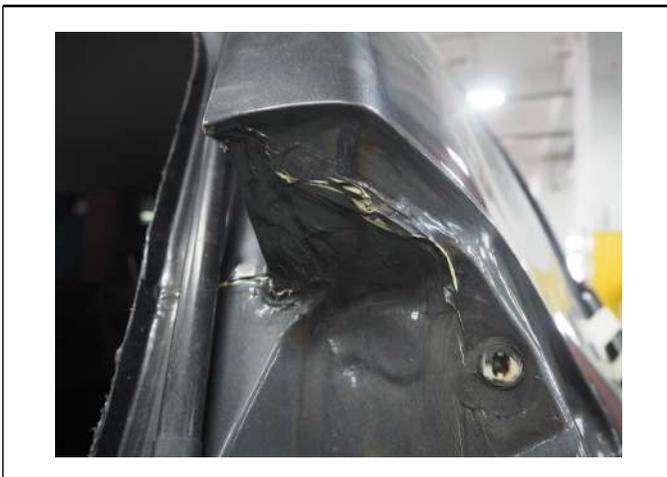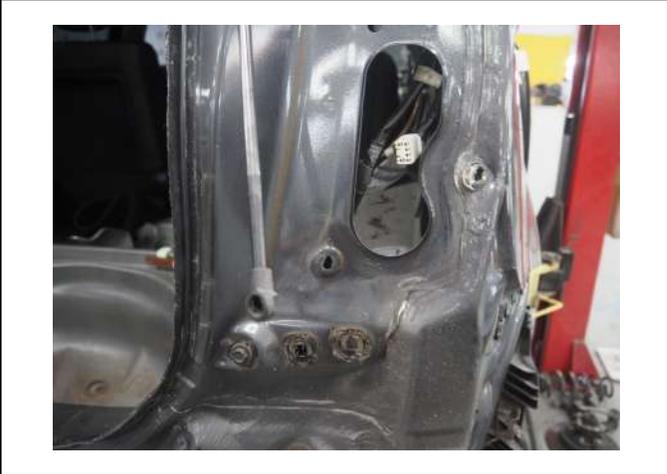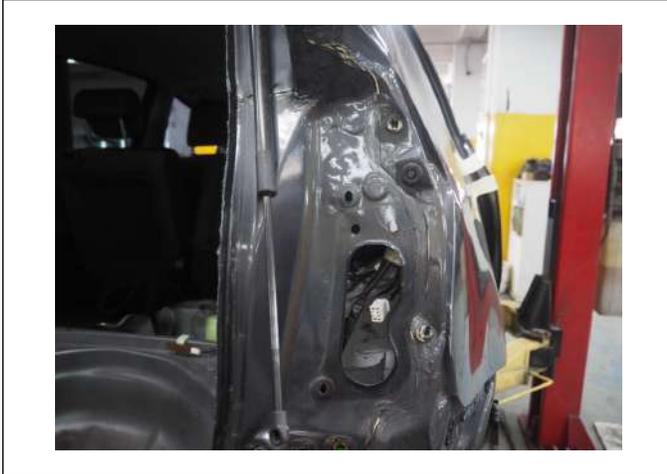



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

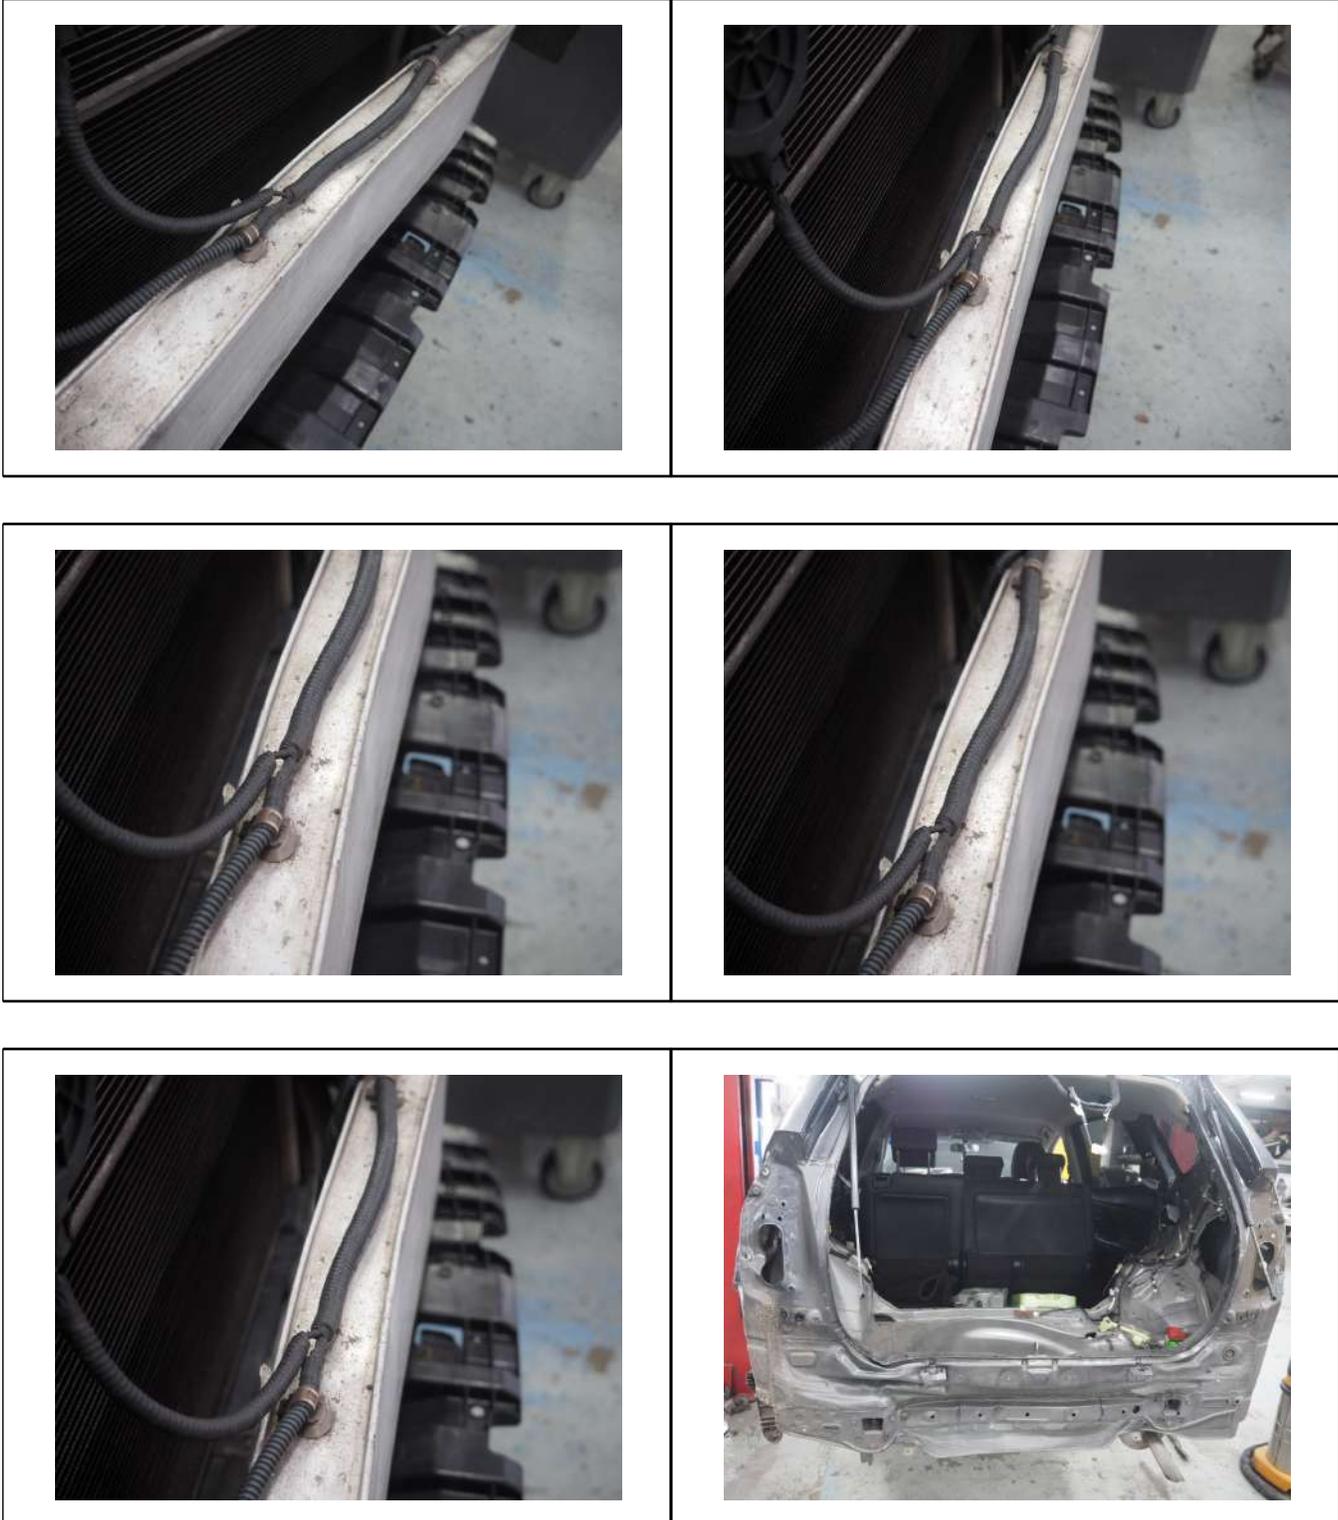






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

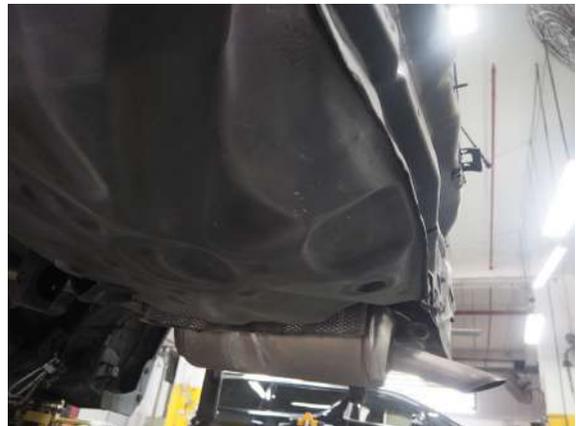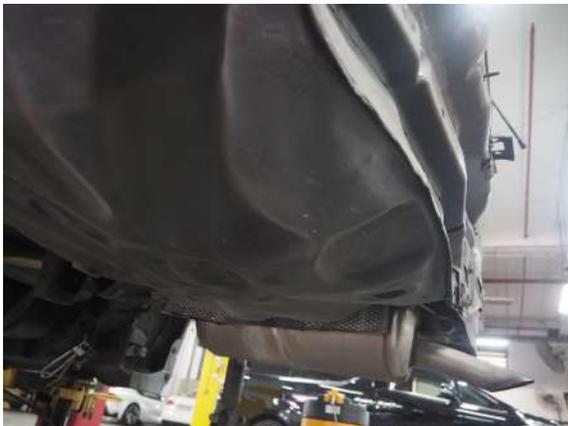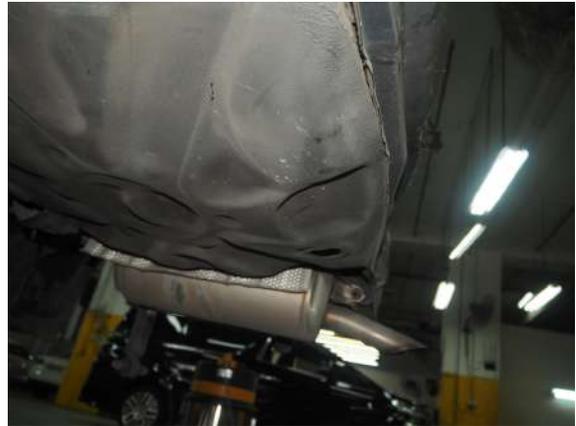



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

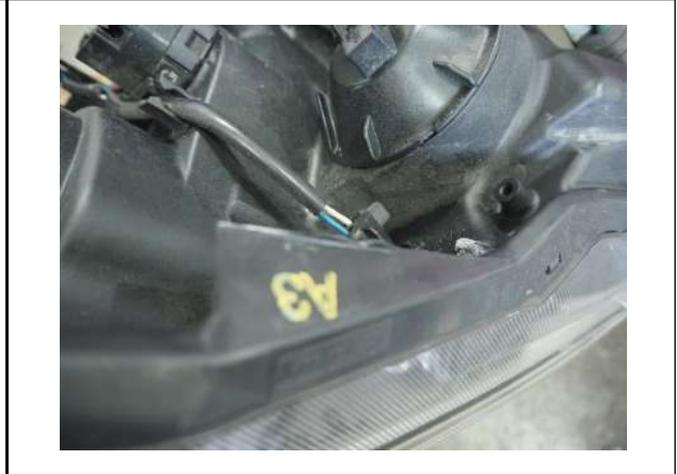




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

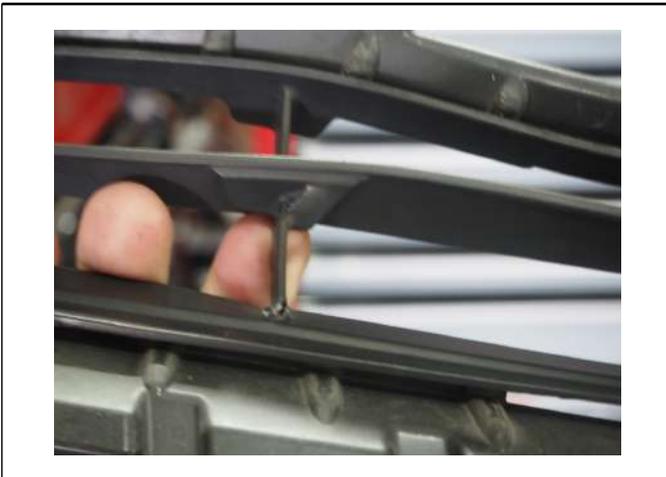

SLU
9676M



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

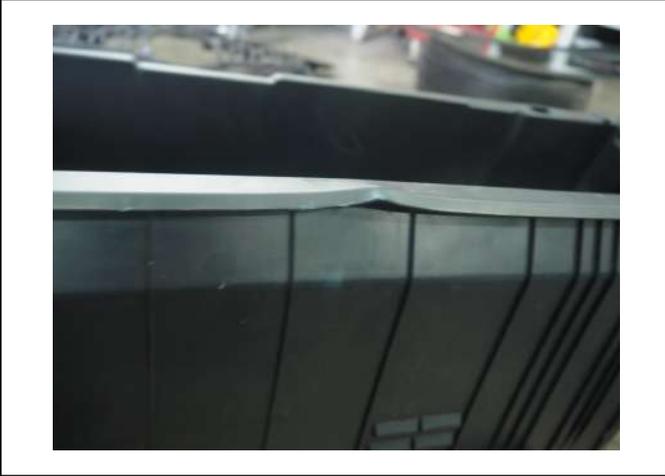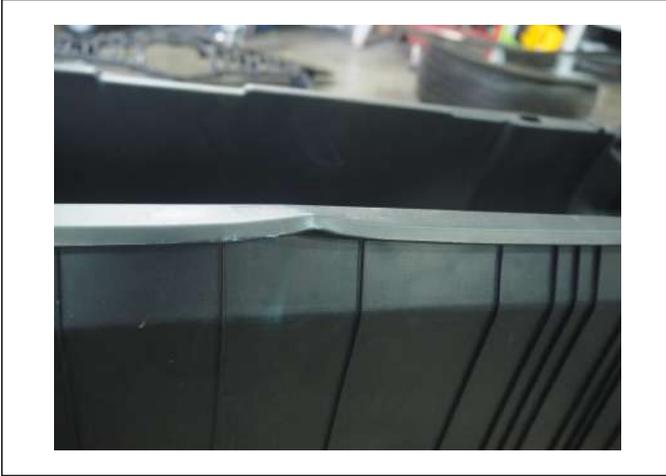



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

