

OH APPRAISAL SERVICES

BLK 34,#02-309,TOA PAYOH,LORONG 5

SINGAPORE (310034)

Mobile : 97982959 Fax : 63975857 email : oh3434@yahoo.com.sg

Business Regn No 53214975X

VEHICLE DAMAGE INSPECTION REPORT

Mr. Muhammad Harris Bin Amin
Blk 5 Marsiling Drive
#09-47
Singapore 730005

Our Ref :FU353A /TP5084
Date : 06 August 2018

REFERENCES

Claim Type	: Third Party	Date of Accident	: 17 July 2018
Vehicle No.	: FU353A	Date of Assignment	: 25 July 2018
Make	: Honda	Date of Inspection	: 25 July 2018
Model	: Phantom 200	Date of Re-inspn.	: Nil
Reg. Date	: 19 October 2001	Chassis No	: TA2000003667
Color	: Brown	Engine No	: Blocked
Odometer	: 46258 km		

TYRE CONDITION

	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
<u>Front</u>	Golden Boy	90/90-17	3
<u>Rear</u>	Pirelli	130/90-15	4

GENERAL DESCRIPTION OF DAMAGE (PHOTOGRAPHS ATTACHED)

Front and Lh side portion

INSPECTION AND ADJUSTMENT

Original Quotation : \$4,739.50 Revised Assessment \$3,450.00 Lump sum

In accordance to your instruction, we have not authorized repairs.

In normal circumstances, repairs to the vehicle would take approximately (5) days to complete.(Survey at Chek Kong Motor Co.)

This survey was conducted on a "WITHOUT PREJUDICE" basis.

<u>S/N</u>	<u>Description</u>	<u>Qty</u>	<u>Condition</u>	<u>Original Quotation</u>	<u>Revised Quotation</u>	
	<u>Material</u>					
1	Handle bar	1 pc	Bent	45.00	45.00	
2	Handle bar holder @\$28.00	2 pcs	Bent	56.00	56.00	
3	Handle grip ' Belta ' w/balancer	1 set	Cut	35.00	35.00	
4	Clutch lever	1 pc	Grazed	18.00	18.00	
5	Brake lever	1 pc	Grazed	18.00	18.00	
6	Meter assy	1 pc	Cracked	195.00	195.00	
7	Meter cover	1 pc	Cracked	68.00	68.00	
8	Mirror @\$28.00	2 pcs	Cracked/grazed	56.00	56.00	
9	Head lamp assy	1 pc	Grazed	110.00	110.00	
10	Head lamp bracket @\$24.00	2 pcs	Bent	48.00	48.00	
11	Front signal lamp @\$48.00	2 pcs	Cracked/grazed	96.00	96.00	
12	Front mudguard	1 pc	Cracked	48.00	48.00	
13	Fork top bracket	1 pc	Bent	95.00	95.00	
14	Front fork assy@\$285.00	2 pcs	Bent	570.00	570.00	
15	Steering emblem	1 pc	Cracked	48.00	48.00	
16	Steering stem	1 pc	Distorted	185.00	185.00	
17	Front wheel assy	1 pc	Warped	250.00	250.00	
18	Front wheel axle	1 pc	Bent	20.00	20.00	
19	Front disc brake	1 pc	Warped	185.00	185.00	
20	Chrome cover (2 T)	1 pc	Grazed Lh	38.00	38.00	
21	Air intake cover	1 pc	Usable	55.00	0.00	Xnn
22	Fuel tank assy	1 pc	Dente	480.00	485.00	
23	Front footrest	1 pc	Bent Lh	45.00	45.00	
24	Footrest bracket	1 pc	Bent Lh	65.00	65.00	
25	Gear pedal assy	1 pc	Bent	45.00	45.00	
26	Rear foot peg	1 pc	Bent Lh	48.00	48.00	
27	Rear footrest bracket	1 pc	Usable	68.00	0.00	Xnn
28	Rear fender	1 pc	Grazed	145.00	145.00	XR
29	Rear mudguard stay	1 pc	Bent	55.00	55.00	
30	Rear no. plate lamp	1 pc	Grazed	45.00	45.00	
				3235.00	3117.00	2972
			Less 10% discount	323.50	311.70	2674.80
				2911.50	2805.30	
	<u>Add special nett items</u>					
31	Number plate	1 set	Bent	22.00	22.00	
32	Steering cone & bearing	1 pc	Necessary	55.00	27.50	
33	I.U unit	1 pc	Cut/grazed	156.00	156.00	
34	I.U bracket	1 pc	Bent	45.00	35.00	25
						230.50
	Towing fee (4 ways)			200.00	160.00	
	Traffic police/Idac/Repair chassis frame speicalist then to Workshop (Repair)					
	Chassis frame repair			300.00	250.00	200
	Spray painting			550.00	450.00	350
	Labour charges			500.00	400.00	300
				4739.50	4305.80	850
	Lump sum repair adjustment				3450.00	

3755.30
I/s\$3000
5 days

OH APPRAISAL SERVICES

Vehicle No: FU353A

Our Ref :FU353A/TP5084

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS

The information contained in this document is privileged and confidential and is intended for the exclusive use of the addressee designation. If you are not the addressee; any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this document not meant for you, please contact us immediately to arrange for it to return.



A handwritten signature in black ink, appearing to be "C. C." or similar, written over a horizontal line.

For Oh Appraisal Services




PHOENIX
SERVICES
APPROVAL



PHOENIX
SERVICES
APPROVAL




PHOENIX
SERVICES
APPROVAL

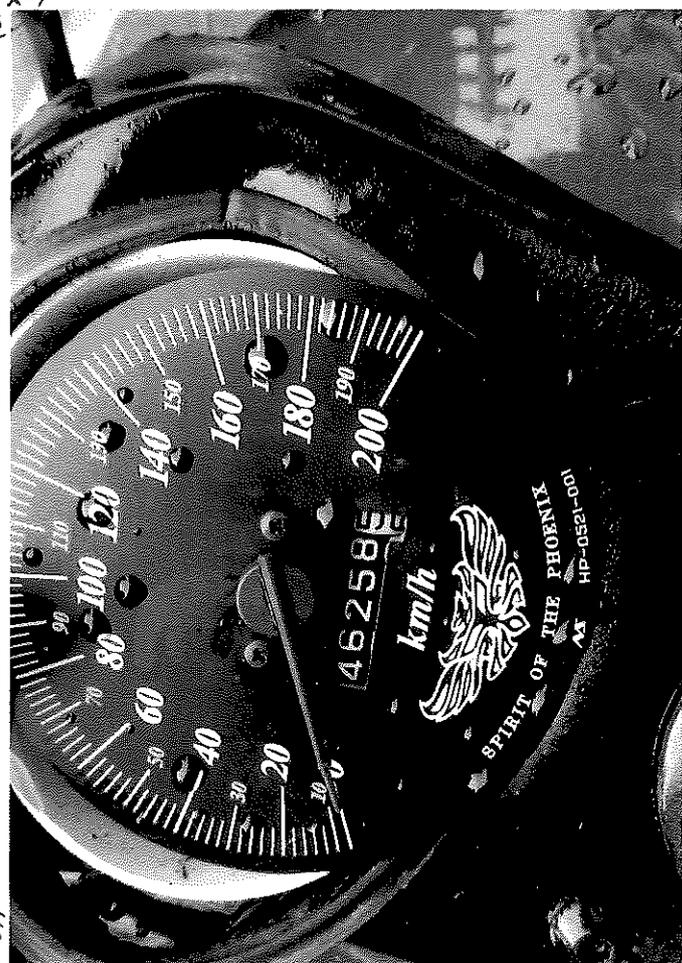




SAL SER
10*

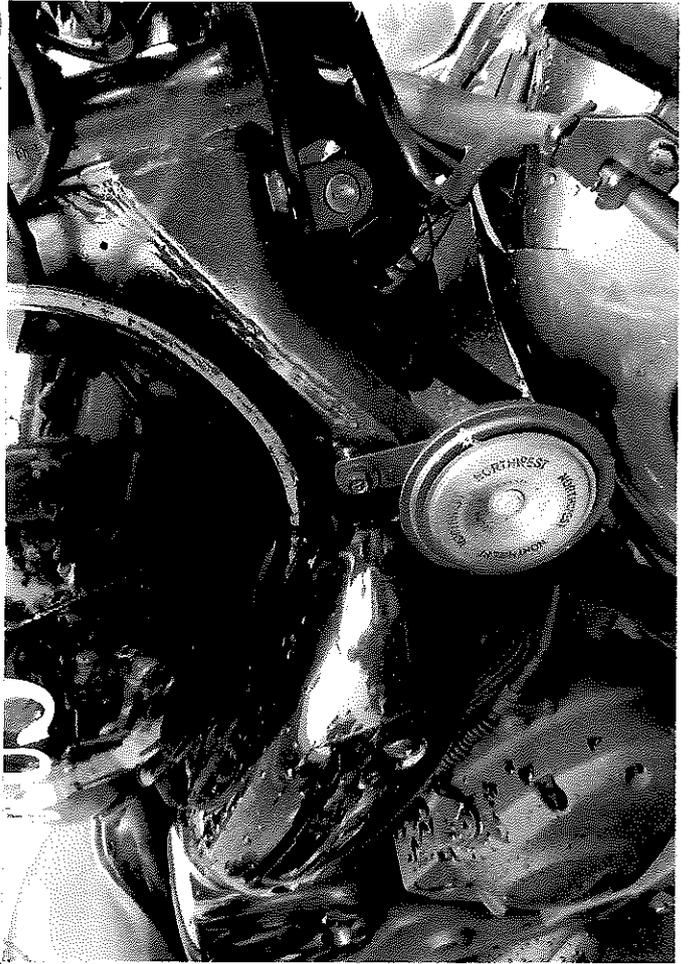


SERVICES
PAIS
* HO



ERV
* HO

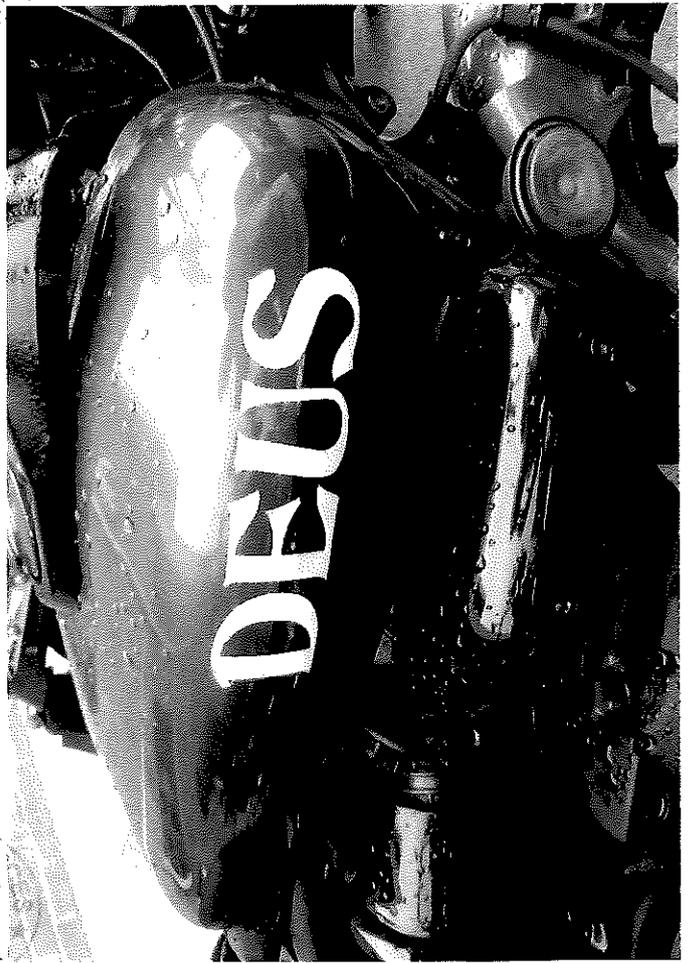

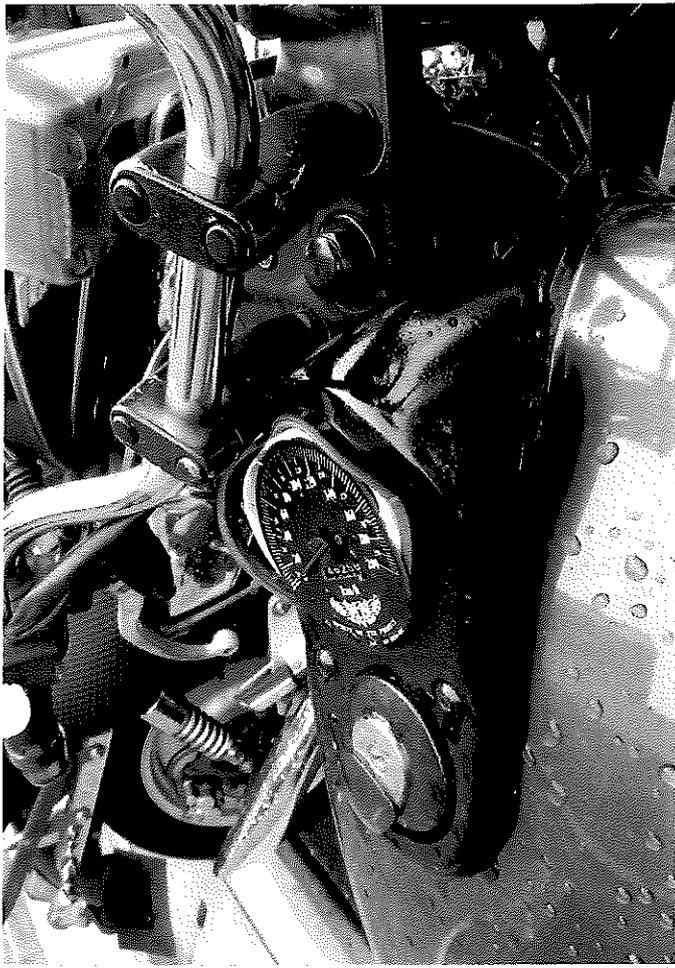


SERVICE
APPRAISAL




SERVICE
APPRAISAL




SERVICE
APPRAISAL

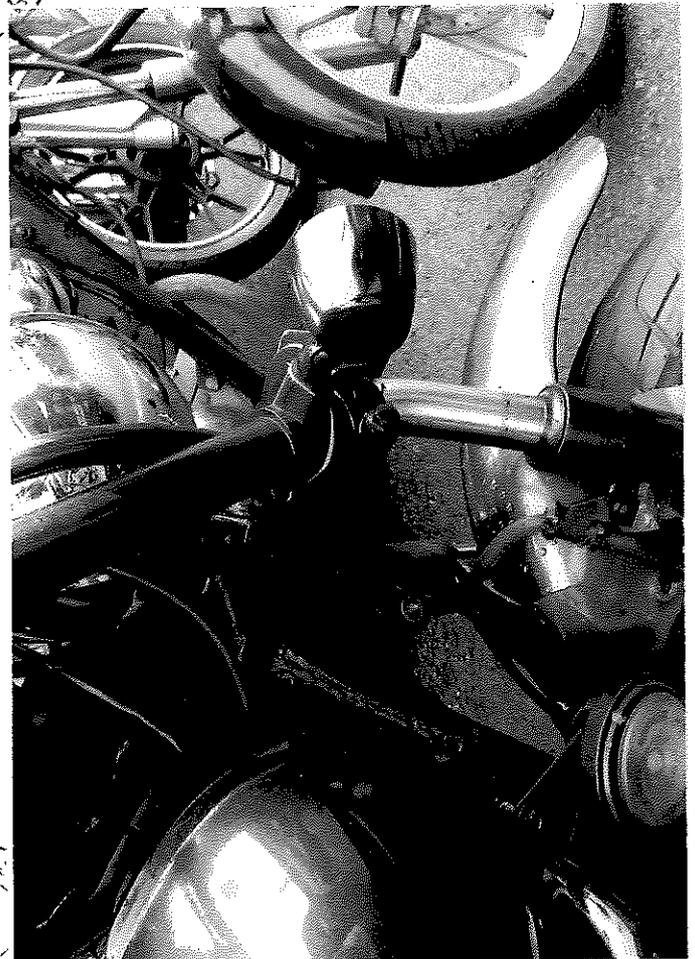

APPRAISAL SERVICE

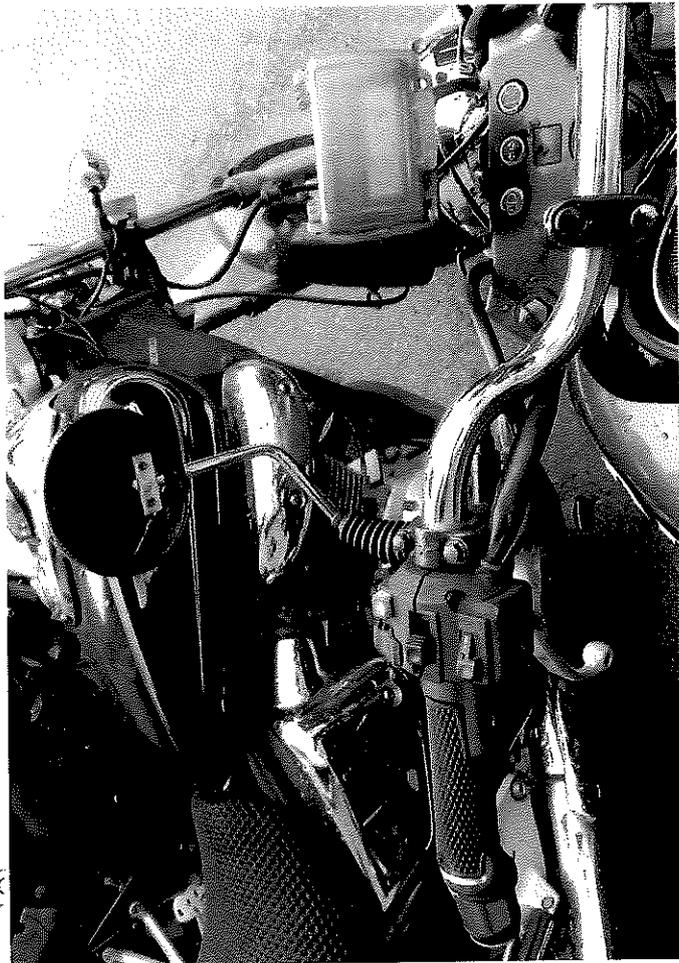


APPRAISAL SERVICE

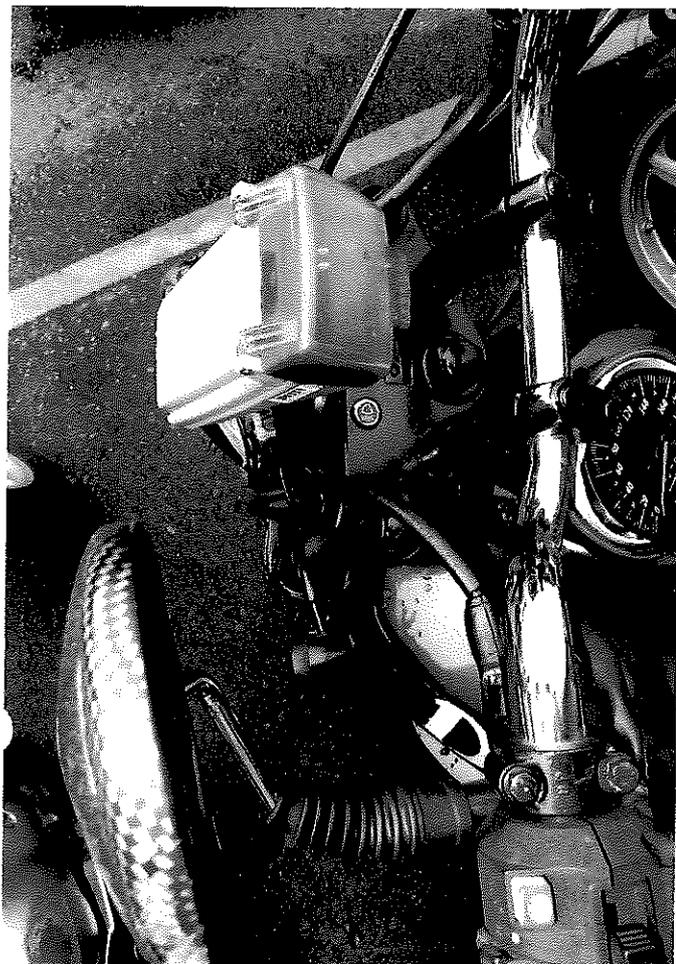


SAL S
O*



PRASAL SERVICES
HO


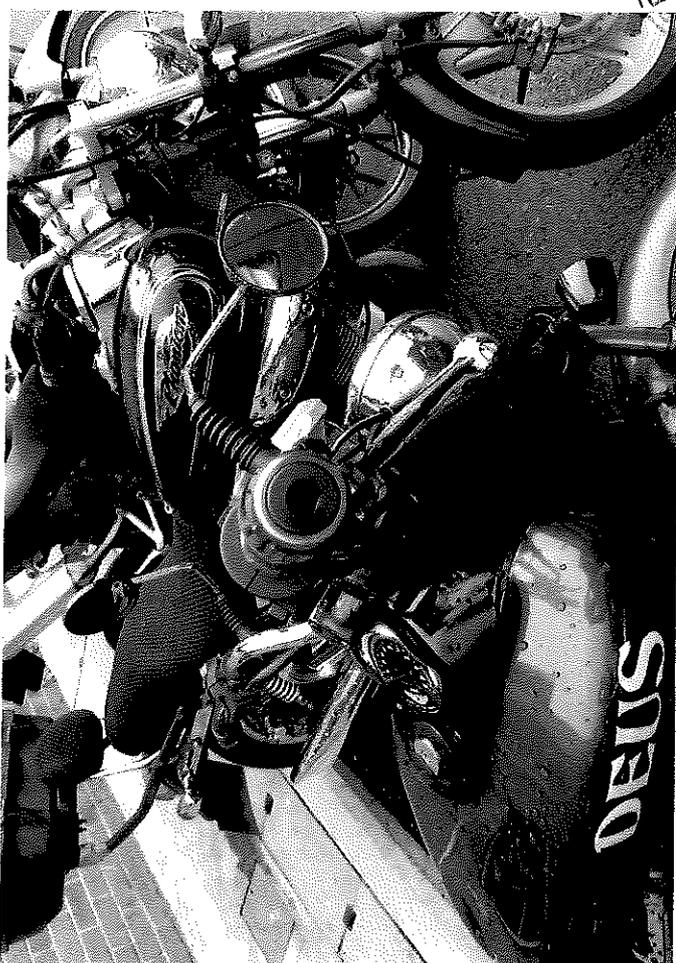


ON APPRA
VICES

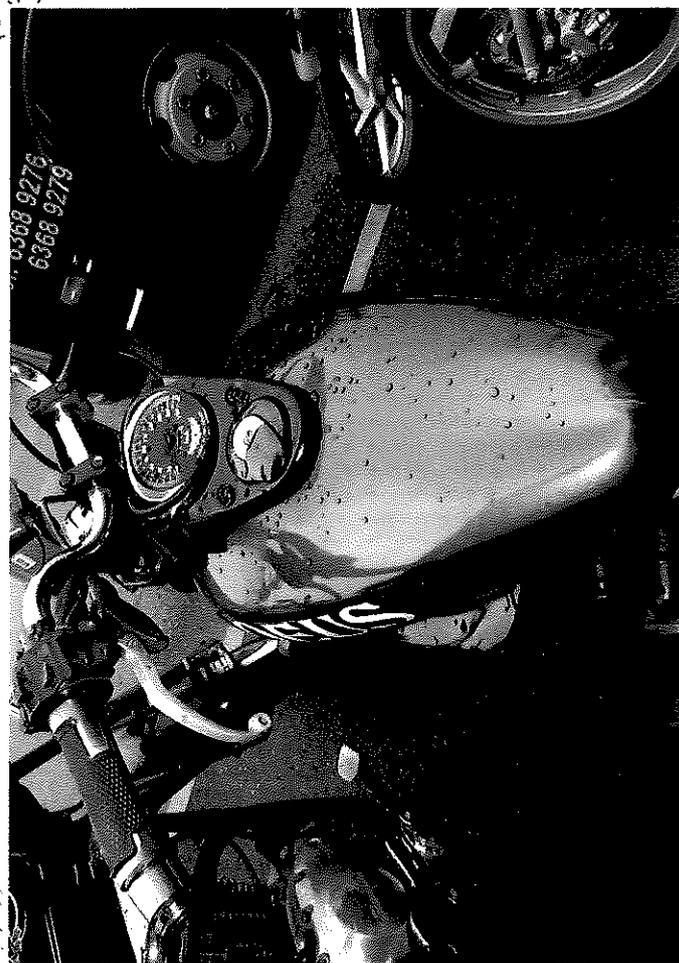


6368 9276
6368 9279

ARMED SERVICES
HOT

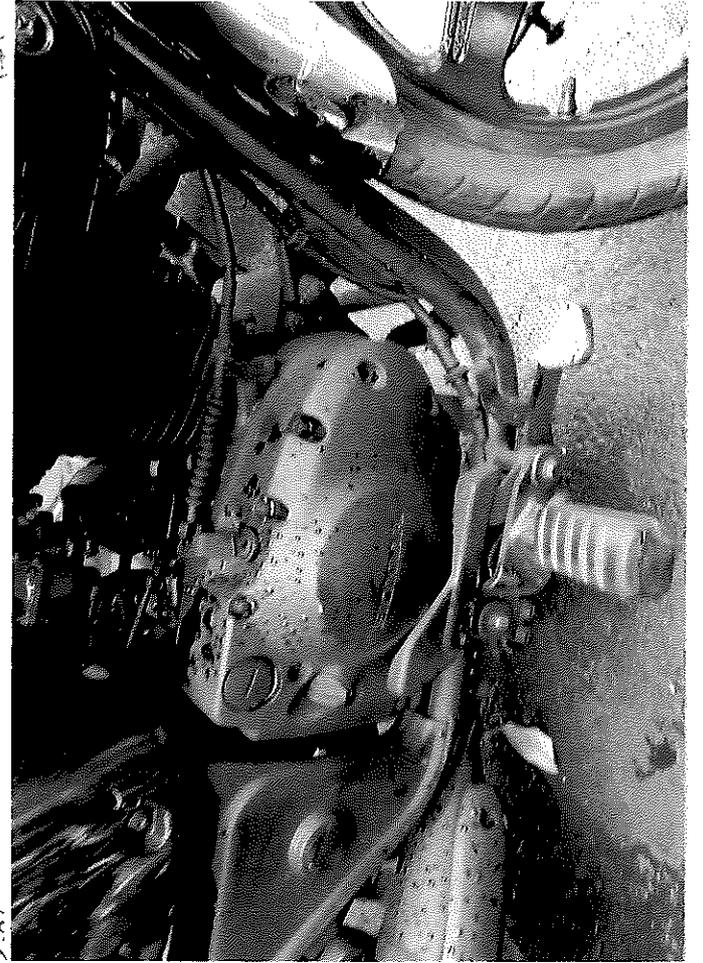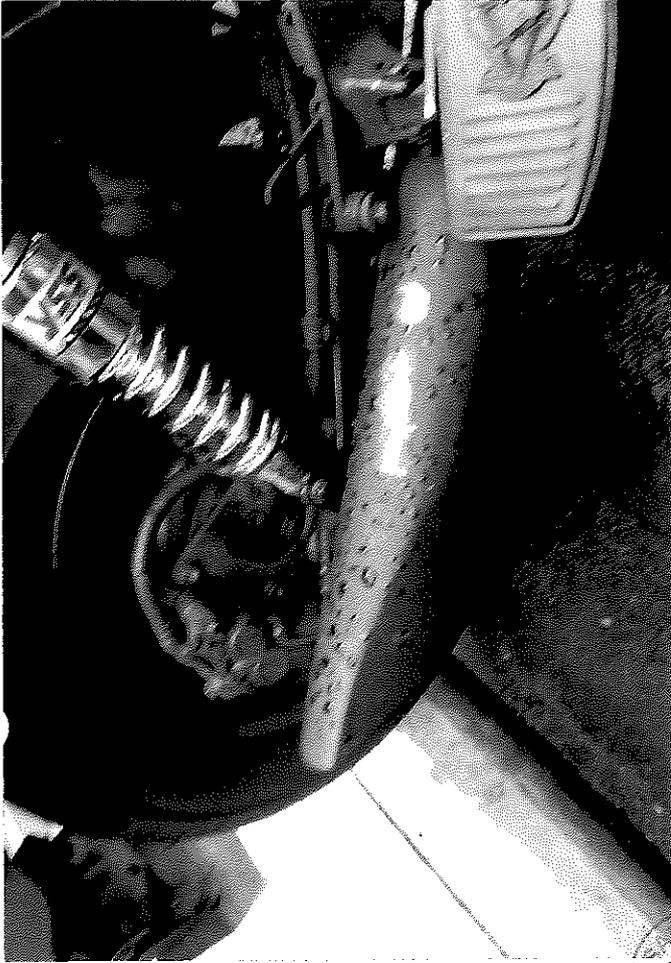

ARMED SERVICES
HOT

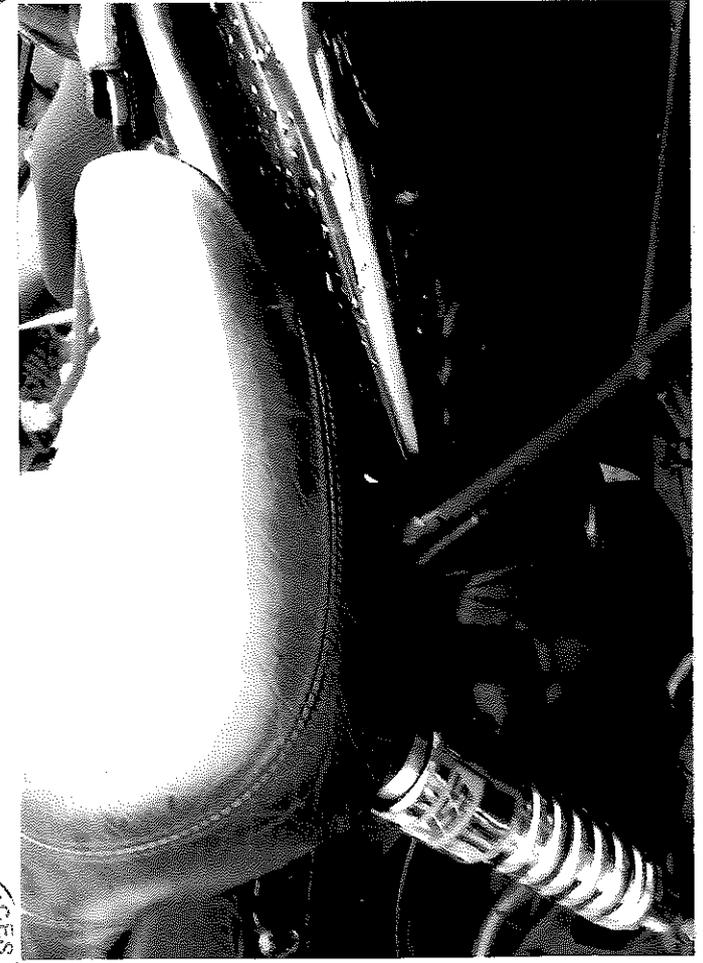

ARMED SERVICES
HOT

RAISAL SER
O * S



RAISAL SERVICES
O * S




SERVICES
O * S

ICES * C

AS



APRIL 1984
SERVICES * S

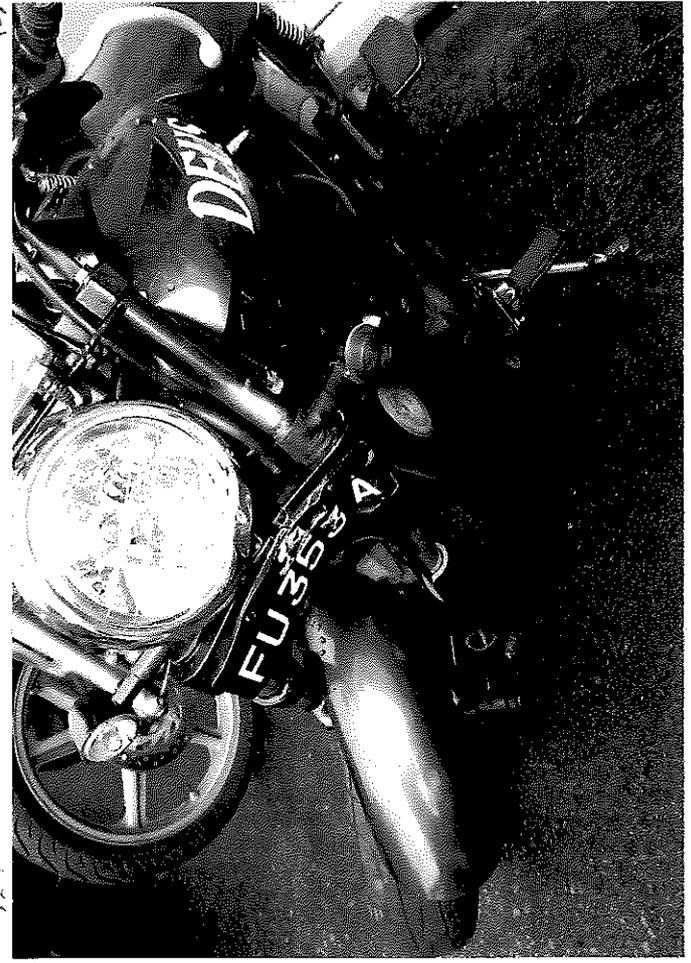

S *

APRIL 1984




AL SERVICES



PRAISAL SERVICE
* HO *




SER
* OH 4 *

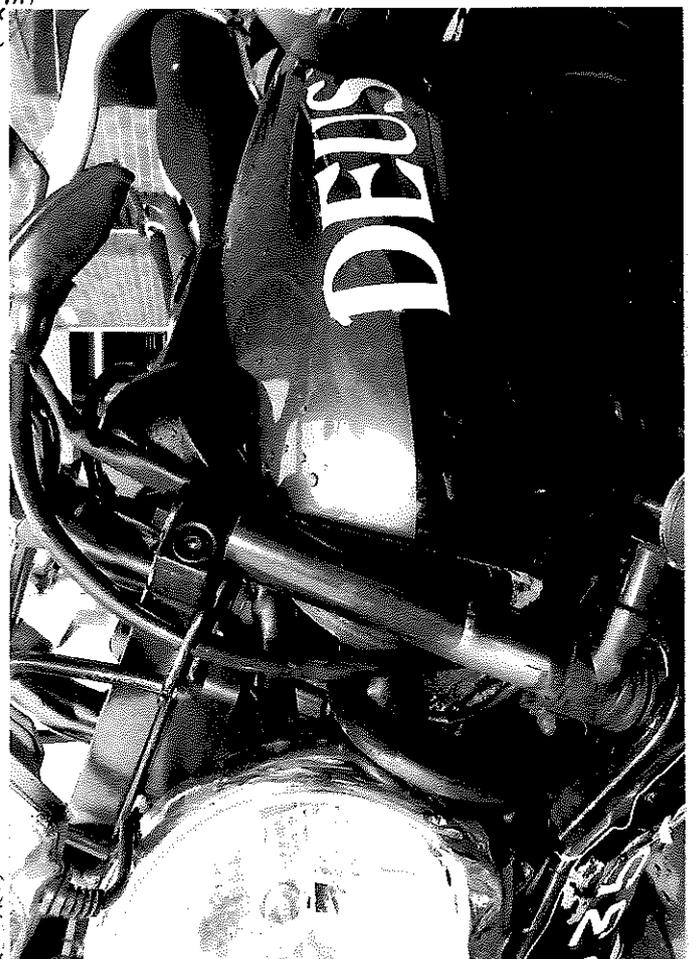

APPROVAL SERVICES



APPROVAL SERVICES

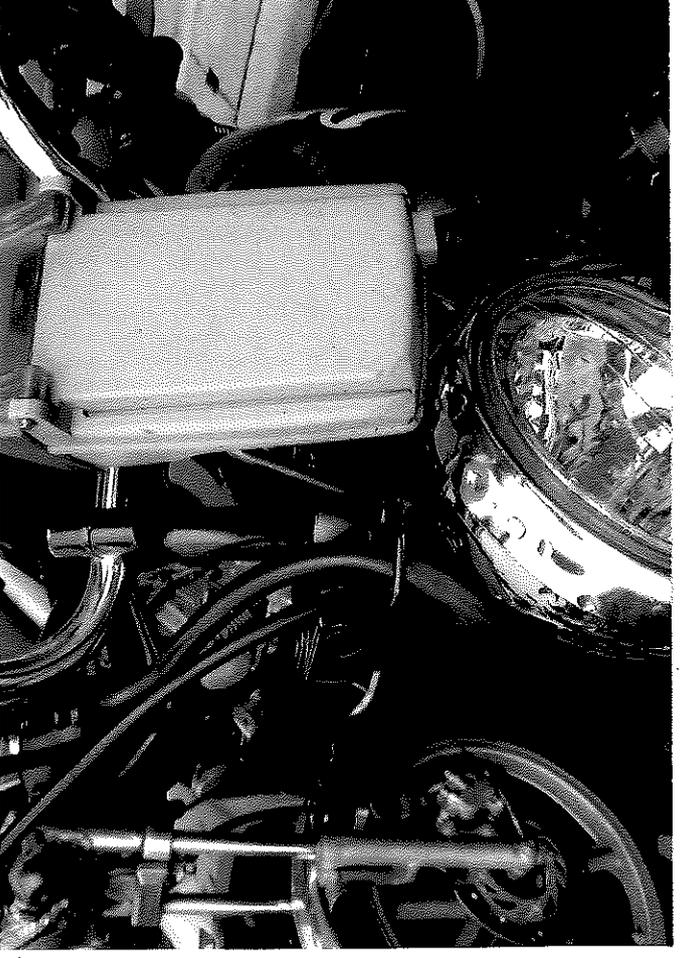

APPROVAL SERVICES


RAISAL SERVICE

OH




RAISAL SERVICE

OH

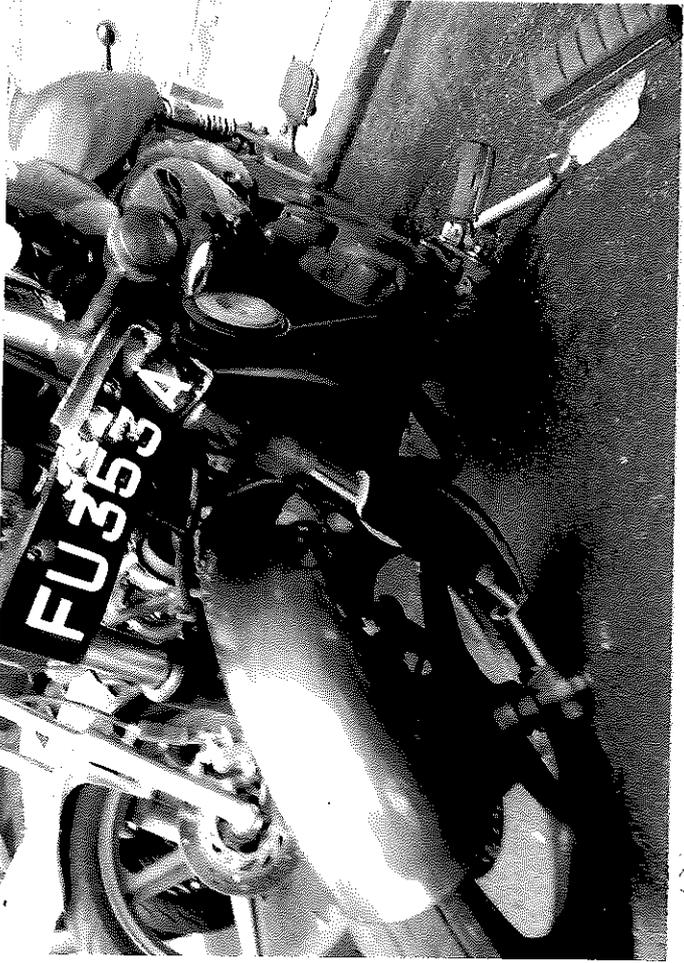

OH APPR * SERVICES

APPR
SERVICES

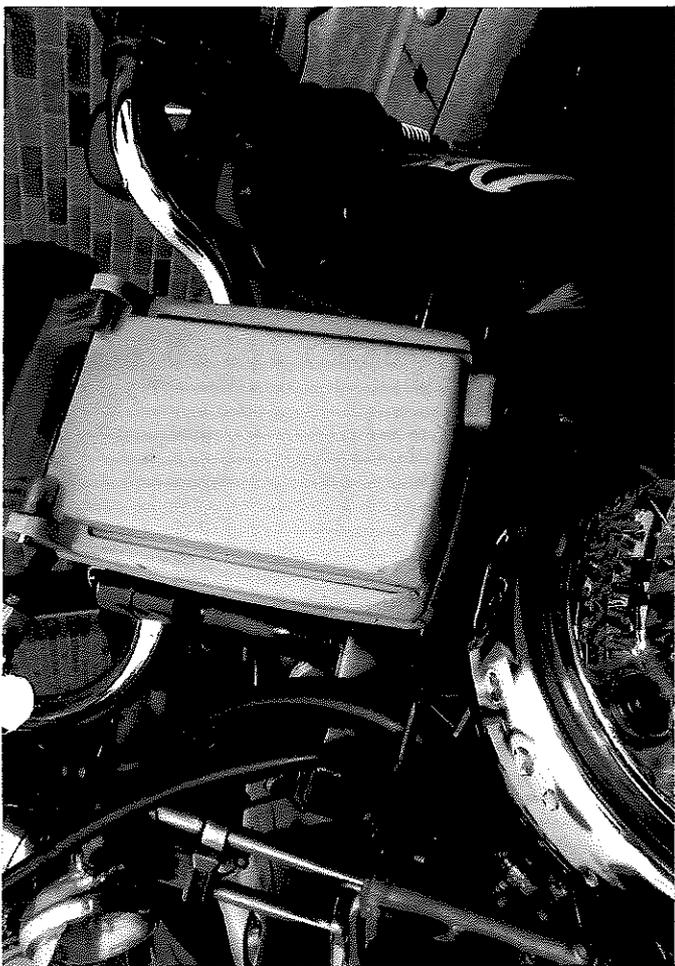


APPR
SERVICES



APPR
SERVICES

RAISAL SERVIC
D*

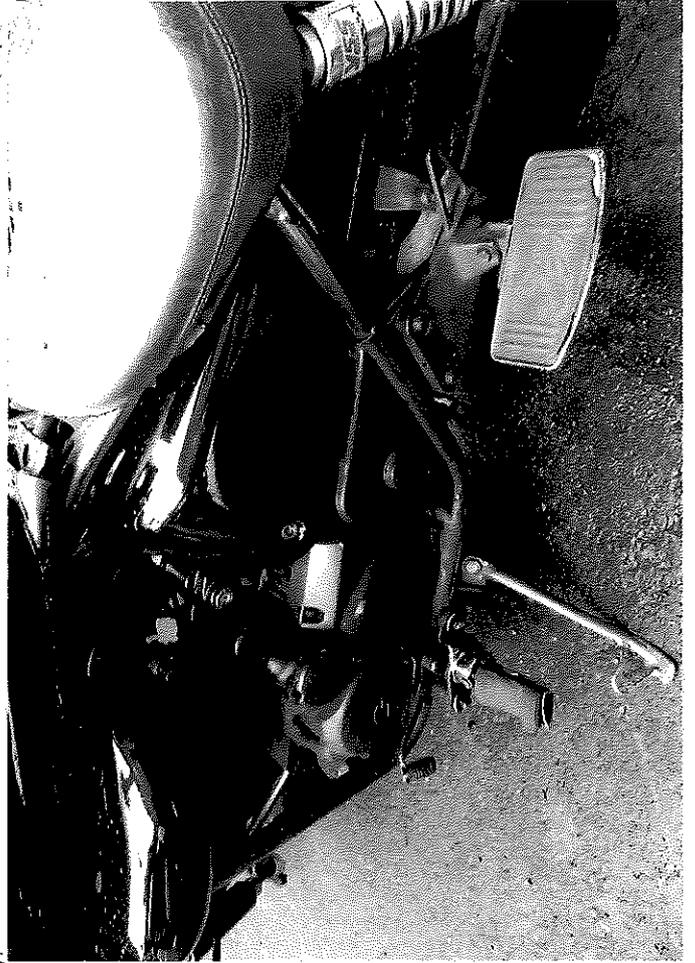


PRAISAL SERVIC
HO




SERVIC
*OH APP

APPRAISAL SERVICE
PHOENIX, ARIZONA

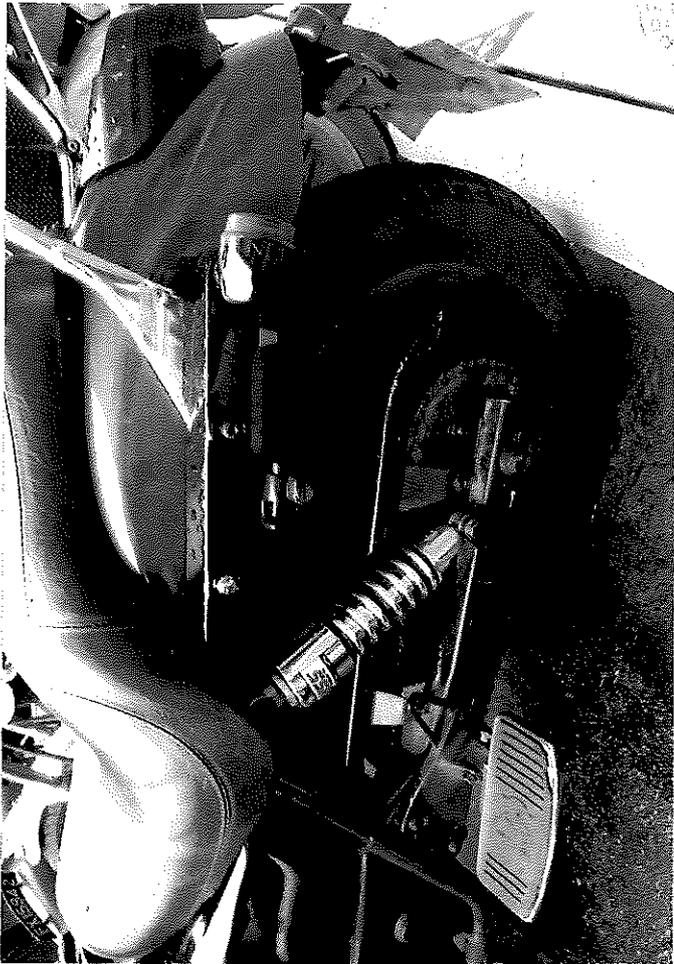


APPRAISAL SERVICE
PHOENIX, ARIZONA

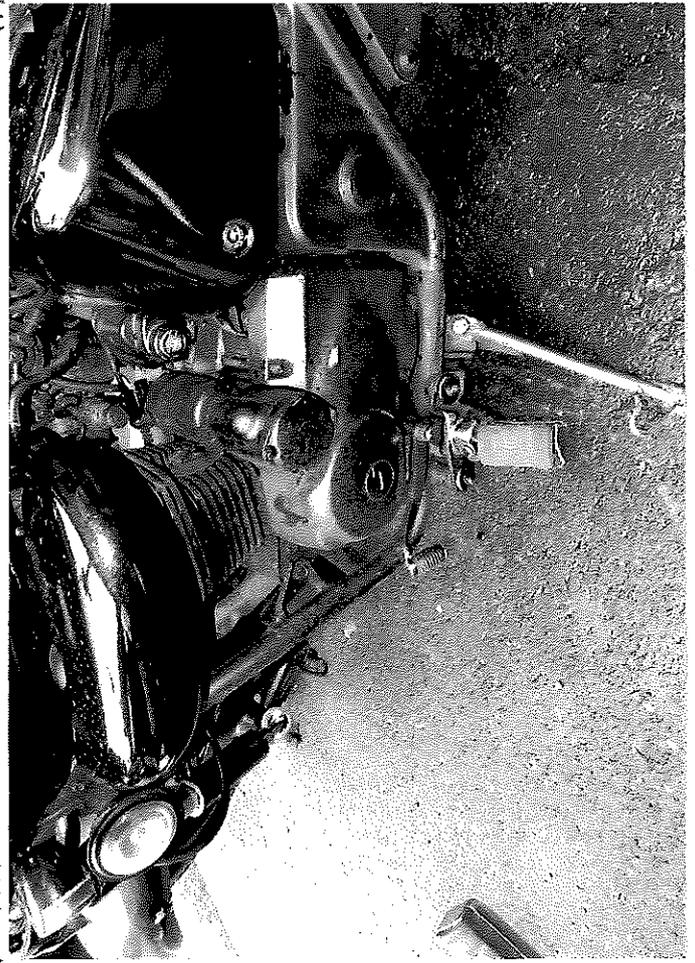

APPRAISAL SERVICE
PHOENIX, ARIZONA



ASAM
★ OFF

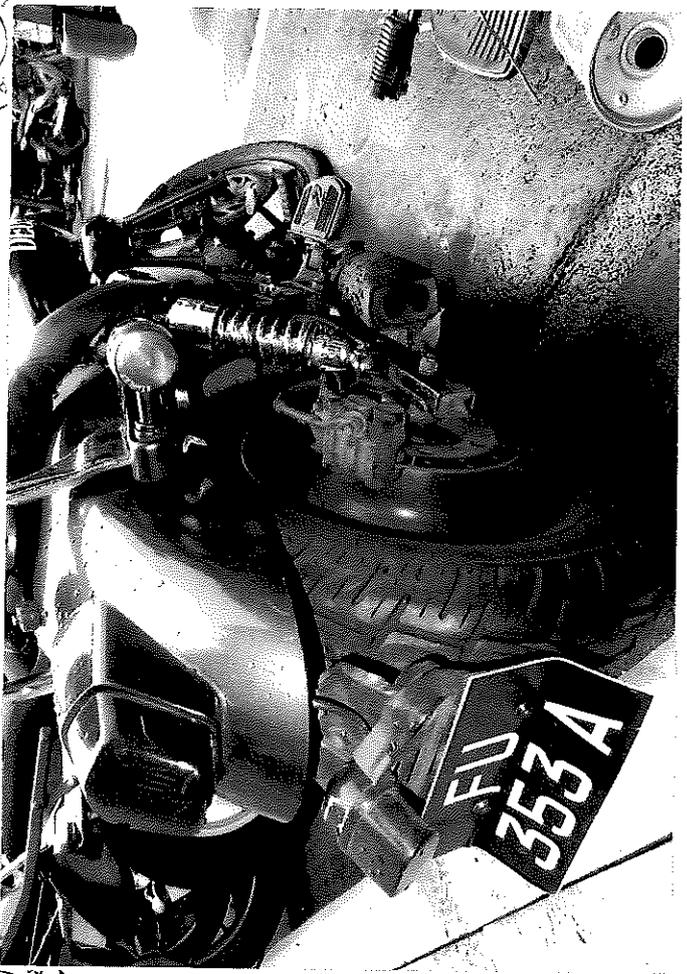

PREP
SERVICES ★



SAL SEPR
H AR

