



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

QBE INSURANCE (S) PTE LTD

INV No. AC2204664

1 RAFFLES QUAY #29-10 SOUTH TOWER
SINGAPORE 048583

INV Date 28/07/2022
Reference CC6/QBE21007864/Aea3q2
Code QBE

PROFESSIONAL SERVICE FEE

Vehicle No. SKR 2843X
Insured Veh. SLK 6599A
Claim No. VC014629
Policy No. 2021-V0026996-MVA
Accident Date 15/07/2021
Inspection Date 19/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
QBE INSURANCE (S) PTE LTD 1 RAFFLES QUAY #29-10 SOUTH TOWERSINGAPORE 048583			Ref: CC6/QBE21007864/Aea3q2	
			Date: 28/07/2022	
			Code: QBE	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLK 6599A	Veh. Inspected	SKR 2843X	
Policy No.	2021-V0026996-MVA	Coverage (\$)	0.00	
Claim No.	VC014629	Excess (\$)	0.00	
Assign From		Assign Date	19/07/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA VIOS	c.c	1497	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	MHFBT9F3306029824	Colour	SILVER	
Odometer	122050 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/60 R15	YOKOHAMA	6 mm	
L/H Front Tyre	185/60 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	185/60 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	185/60 R15	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	15/07/2021	Inspection Date	19/07/2021	
Survey held at	KANG CAR REPAIRERS PTE LTD NO.1 KAKI BUKIT AVE 6 #02-06 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKR 2843X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOT LID	DENTED	765.80	765.80
1	BOOT LID GARNISH	NOT NECESSARY	161.60	-
1	BOOT LID LOGO	NECESSARY	63.80	63.80
1	BOOT LID 'VIOS' EMBLEM	NECESSARY	43.60	43.60
1	BOOT LID LOCK	DAMAGED	195.90	195.90
1	BOOT LID LOCK CHECKER	NOT NECESSARY	39.90	-
1	BOOT LID RUBBER	CUT	166.40	166.40
1	REAR PANEL	DENTED	620.10	620.10
1	REAR PANEL TRIM	CRACKED	231.10	231.10
1	REAR FENDER INNER TRIM RH	NOT NECESSARY	355.90	-
1	TAIL LAMP RH	CRACKED	375.90	375.90
1	TAIL LAMP PANEL RH	TO REPAIR SEE LABOUR	297.90	-
1	TAIL LAMP LH	NOT NECESSARY	375.90	-
1	REAR BUMPER	DEFORMED	492.20	492.20
1	REAR BUMPER REINFORCEMENT	DENTED	316.10	316.10
2	REAR BUMPER SMALL RETAINERS	NOT NECESSARY	145.40	-
2	REAR BUMPER SIDE RETAINERS	NECESSARY	227.80	227.80
1	REAR REFLECTOR -RH	CRACKED	179.80	179.80
	LESS 25% DISCOUNT		-1,263.78	-919.63
			3,791.32	2,758.87
<u>SPECIAL NETT ITEMS</u>				
1	BOOT LID 502 STICKER (SN)	NECESSARY	35.00	35.00
1	SET REAR PANEL TRIM CLIPS (SN)	NECESSARY	30.00	20.00
1	SET REAR FENDER INNER TRIM CLIPS RH (SN)	NOT NECESSARY	40.00	-
1	REAR FENDER STICKER RH (SN)	NOT NECESSARY	290.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	40.00	30.00
2	REAR 'L' PLATE BRACKETS (SN)	NECESSARY	70.00	50.00
1	'L' PLATE (SN)	BENT	50.00	50.00
1	SET REAR BUMPER STICKER (SN)	NECESSARY	280.00	280.00

Report Ref No. CC6/QBE21007864/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR NUMBER PLATE (SN)	BENT	30.00	30.00
			865.00	495.00
	LABOUR			
	TO REMOVE AND REPLACE THE DAMAGED PARTS ,KNOCK OUT ACCIDENT DENTED PORTIONS ,AND FOR CUTTING /WELDING WORKS.INCLUSIVE OF THE REPAIR OF TAIL LAMP PANEL RH .		1,000.00	900.00
	TO SPRAY PAINTING.		1,000.00	900.00
	TO SPRAY UNDERSEAL.		100.00	80.00
	TO REPLACE INNER TRIM .		100.00	80.00
	TO CHECK WIRING.		50.00	30.00
	TO REPLACE STICKERS .	NOT NECESSARY	80.00	-
			2,330.00	1,990.00
GRAND TOTAL			6,986.32	5,243.87

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,200.00
---	--	--	-----------------

Report Ref No. CC6/QBE21007864/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKR 2843X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

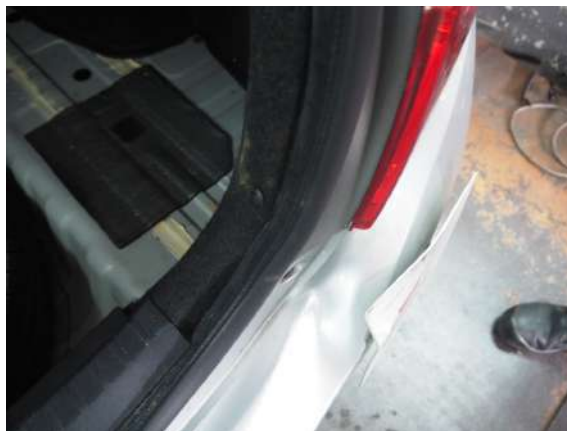



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

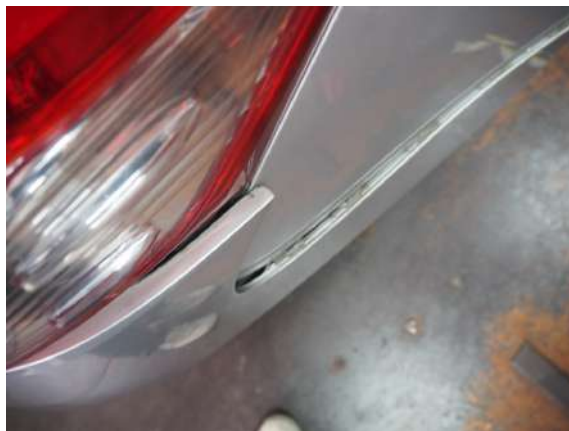



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKR 2843X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

