



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2108327

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 02/12/2021
Reference CC4/FCI21007920/Ara3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLX 11A
Insured Veh. YN 7902G
Claim No. D21002130MFCV/1
Policy No. D-21097582MFCV
Accident Date 17/07/2021
Inspection Date 13/10/2021

Description	Total
Survey Inspection	325.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	325.00
GST (7%)	22.75
Grand Total	347.75

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI21007920/Ara3q2	
			Date: 02/12/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	YN 7902G	Veh. Inspected	SLX 11A
	Policy No.	D-21097582MFCV	Coverage (\$)	0.00
	Claim No.	D21002130MFCV/1	Excess (\$)	0.00
	Assign From	ESTHER	Assign Date	26/07/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA ALPHARD	c.c	2494
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	JTNGF3DH508003617	Colour	SILVER
	Odometer	106927 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	235/50 R18	BRIDGESTONE	6 mm
	L/H Front Tyre	235/50 R18	BRIDGESTONE	6 mm
	R/H Rear Tyre	235/50 R18	BRIDGESTONE	6 mm
	L/H Rear Tyre	235/50 R18	BRIDGESTONE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	17/07/2021	Inspection Date	13/10/2021
	Survey held at	SM AUTOMOTIVE BLK C, 1 KAKI BUKIT AVENUE 6 #01-43 SINGAPORE 417883		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLX 11A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	1,791.30	870.00
1	REAR BUMPER SIDE RETAINER LH	CRACKED	85.60	85.60
1	REAR BUMPER CORNER LH	DEFORMED	512.30	385.00
1	REAR BUMPER CORNER SIDE RETAINER LH	CRACKED	81.60	81.60
1	REAR BUMPER REVERSE SENSOR	DAMAGED	321.60	321.60
1	REAR BUMPER REVERSE SENSOR COVER	NOT NECESSARY	68.40	-
1	REAR BUMPER REFLECTOR LH	NOT NECESSARY	154.10	-
1	REAR END PANEL (INNER)	TO REPAIR SEE LABOUR	595.40	-
1	REAR END PANEL (OUTER)	TO REPAIR SEE LABOUR	799.10	-
1	REAR TAILLAMP LH	CUT	1,248.60	685.00
1	REAR TAILLAMP LOWER BRACKET LH	NOT NECESSARY	68.40	-
1	REAR BUMPER UNDER COVER	NOT NECESSARY	145.60	-
1	REAR TAILGATE LAMP LH	CUT	446.40	446.40
1	LH REAR FENDER	TO REPAIR SEE LABOUR	1,998.70	-
1	LH REAR FENDER INNER COWLING	NOT NECESSARY	180.60	-
1	LH REAR SLIDING DOOR	NOT NECESSARY	2,148.60	-
	LESS 25% DISCOUNT		-2,661.58	-718.80
			7,984.72	2,156.40
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	80.00	-
			160.00	30.00
	<u>LABOUR</u>			
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL (INNER),REAR END PANEL (OUTER) AND LH REAR FENDER .		1,200.00	450.00
	LABOUR FOR SPRAY PAINTING.		1,000.00	800.00
	WIRING CHECK .		80.00	30.00

Report Ref No. CC4/FCI21007920/Ara3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR FOR REMOVE & REFIX REAR UPHOLSTERY /ROOF LINING.	NOT NECESSARY	300.00	-
	TO APPLY TUFF COATING /RUST PROOF ACCIDENT AREAS .		200.00	50.00
	LABOUR FOR REMOVE & TRANSFER LH REAR SLIDING DOOR FITTING.	NOT NECESSARY	300.00	-
			3,080.00	1,330.00
GRAND TOTAL			11,224.72	3,516.40
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,800.00

Report Ref No. CC4/FCI21007920/Ara3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

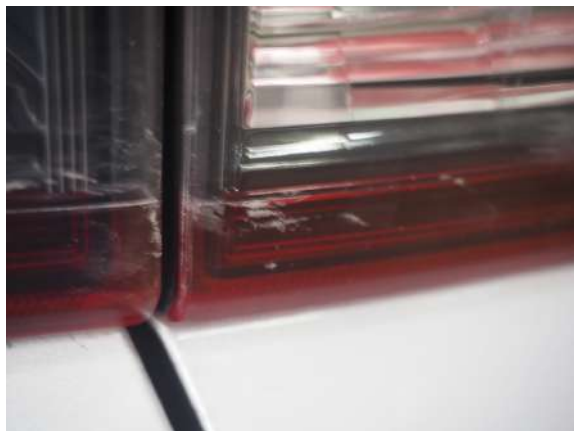



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 11A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

