

CN MOTORS PTE. LTD.

1 Kaki Bukit Ave 6, Blk C #01-41 Autobay@Kaki Bukit, Singapore 417883

Email: admin@cnmotorspl.com

Tel: 6509 5545 Fax: 6509 5567

UEN: 202026492W GST Reg No: 202026492W

29/07/2021

Blk 1 Kaki Bukit Ave 6

01-43

Singapore 417883

Accident date: 28/07/2021

Estimated repair cost for vehicle no: SJZ6499A MITSUBISHI LANCER 1.5 MIVEC

CHASSIS:JMYSRCY2AAU000556 (2009)

S/n	Qty	Items	U/price	Amount
1	1	BONNET <i>Dented</i>	\$1,445.60	\$1,445.60 ✓ 809
2	2	BONNET HINGE <i>new</i>	\$125.60	\$251.20 +
3	1	BONNET LOCK <i>new</i>	\$224.60	\$224.60 +
4	1	FRONT BUMPER <i>Distorted</i>	\$898.40	\$898.40 ✓ 798
5	1	FRONT BUMPER REINFORCEMENT <i>Bent</i>	\$352.60	\$352.60 ✓
6	1	FRONT BUMPER TOP BRACKET <i>Bent</i>	\$185.60	\$185.60 ✓
7	2	FRONT BUMPER SIDE RETAINER <i>4 d</i>	\$25.40	\$50.80 25.40
8	1	FRONT BUMPER TOP RUBBER <i>lt</i>	\$45.10	\$45.10 ✓
9	1	FRONT BUMPER FOG LAMP COVER LH <i>del</i>	\$68.10	\$68.10 ✓
10	1	FRONT BUMPER CLIPS BRACKET LH <i>new</i>	\$62.10	\$62.10 +
11	1	FRONT BUMPER LOWER GRILLE <i>del</i>	\$112.30	\$112.30 ✓
12	2	FRONT BUMPER LOWER GRILLE COVER <i>new</i>	\$34.80	\$69.60 +
13	1	FRONT BUMPER UNDER COVER <i>torn</i>	\$212.80	\$212.80 ✓
14	1	FRONT GRILLE <i>crack</i>	\$247.60	\$247.60 ✓
15	1	FRONT GRILLE CHROME <i>new</i>	\$289.40	\$289.40 +
16	1	FRONT SUPPORT PANEL LH <i>new</i>	\$268.70	\$268.70 +
17	1	LH FRONT HEADLAMP <i>crack</i>	\$699.40	\$699.40 ✓
18	1	LH FRONT FENDER <i>Distorted</i>	\$688.50	\$688.50 ✓ 596
19	1	LH FRONT FENDER INNER SHIELD <i>torn</i>	\$196.60	\$196.60 ✓
20	1	LH FRONT SHOCK ABSORBER <i>Bent</i>	\$489.10	\$489.10 ✓ 367
21	1	LH FRONT LOWER ARM <i>Bent</i>	\$561.60	\$561.60 ✓ 347
22	1	LH FRONT KNUCKLER ARM <i>new</i>	\$489.70	\$489.70 ✓ 354
23	1	LH FRONT KNUCKLER ARM BEARING <i>new</i>	\$235.90	\$235.90 ✓
24	1	STEERING RACK & PINION <i>new</i>	\$1,948.40	\$1,948.40 +
25	1	LH FRONT ABS SENSOR <i>new</i>	\$357.60	\$357.60 +
26	1	LH FRONT DRIVE SHAFT <i>new</i>	\$1,419.50	\$1,419.50 +

TOTAL : \$11,870.80

LESS 10 % \$1,187.08

SUB-TOTAL : \$10,683.72

\$5,910.20

\$3,191.8

S/N	Qty	ITEMS / SPECIAL NETT	U/price	Amount
1	1	FRONT BUMPER CLIPS <i>per</i>	\$80.00	\$80.00 <i>-30</i>
2	1	LH FRONT FENDER INNER SHIELD CLIPS <i>per</i>	\$60.00	\$60.00 <i>-20</i>
3	1	FRONT GRILLE CLIPS <i>per</i>	\$60.00	\$60.00 <i>-20</i>
4	1	LH FRONT SPORT RIM <i>at</i>	\$450.00	\$450.00 <i>✓</i>
5	1	LH FRONT TYRE <i>new</i>	\$220.00	\$220.00 <i>+</i>
			TOTAL:	\$870.00

530

TOTAL PARTS : \$11,553.72

Labour charges

1	LABOUR FOR PANEL BEATING	\$1,400.00 <i>-800</i>
2	LABOUR FOR SPRAYPAINTING	\$1,200.00 <i>-800</i>
3	WIRING CHECK	\$80.00 <i>-30</i>
4	TO APPLY TUFF COATING/RUST PROOF ACCIDENT AREAS	\$300.00 <i>-60</i>
5	LABOUR FOR RESET & DIAGNOSE WARNING LIGHT ON	\$200.00 <i>+</i>
6	TO CONDUCT WHEEL ALIGNMENT	\$150.00 <i>-80</i>
7	LABOUR FOR REMOVE & RENEW LH FRONT UNDER CARRIAGE	\$600.00 <i>-220</i>
8	LABOUR FOR REMOVE & PRESS OUT WHEEL BEARING	\$120.00 <i>+</i>

Subtotal :- \$4,050.00

Total:- \$15,603.72

LKK Auto Com. hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices subject to confirmation
- Third party is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplier (s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature

Date


Adrian L
4/s 30/07/21

O.B. Prys

total: 7739.18

4/s: 6.2K

6.2K

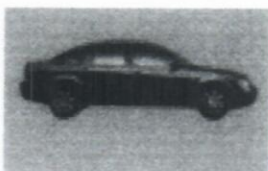

PEOPLES AUTO TRADING
BLK 3007 UBI ROAD 1 #01-400
TEL 6741 4646



COMPUTERIZED ALIGNMENT SPECIALISTS

CUSTOMER	NEW HOCK TECK	DATE	Jul 29, 2021 11:27:06 AM
FIRST NAME			
LICENSE NO.	SJZ 6499 A		
MILEAGE	178483		
MAKE	CUSTOM	MODEL	MITSUBISHI LANCER CY
NOTES			

Front Wheel SPECS DIAGNOSIS ADJUSTMEN

	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.00	0.00	1.00			8.10				8.10		
PARTIAL TOE	-0.50	0.00	0.50		8.00		0.10		7.80		0.30	
SET BACK	---	---	---			0°44"				0°44"		
CAMBER	-0°44"	0°00"	0°44"		0°16"		-0°32"	0°48"	0°14"		-0°30"	0°46"
CASTER	1°30"	2°30"	3°30"		2°48"		2°42"	0°06"	2°48"		2°42"	0°06"
KING-PIN	---	---	---		12°54"		13°20"	0°26"	12°54"		13°20"	0°26"
INCL.ANGLE	---	---	---		13°10"		12°48"		13°08"		12°48"	
Toe-out on turns	---	---	---		---		---		---		---	
STEERING IN	---	---	---		---		---		---		---	
STEERING OUT	---	---	---		---		---		---		---	

Rear Wheel SPECS DIAGNOSIS ADJUSTMEN

	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.00	1.00	3.10			0.00				0.00		
PARTIAL TOE	-0.50	0.50	1.50		1.10		-1.00		1.10		-1.00	
SET BACK	---	---	---			-0°04"				-0°04"		
CAMBER	-1°44"	-1°00"	-0°14"		-0°28"		-1°00"	0°30"	-0°28"		-1°00"	0°30"
THRUST ANGLE	-0°08"	0.00	0°08"			0°10"				0°10"		