



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2201794

INV Date 10/05/2022

Reference CC4/LPC21008100/Rpa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLM 9015M
Insured Veh. XE 2148J
Claim No. 20/20/21/VC00/024806
Policy No. Z/20/VC00/108112
Accident Date 28/07/2021
Inspection Date 29/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21008100/Rpa3q2 Date: 10/05/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 2148J	Veh. Inspected	SLM 9015M	
Policy No.	Z/20/VC00/108112	Coverage (\$)	0.00	
Claim No.	20/20/21/VC00/024806	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	29/07/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS HYBRID 1.8 CVT	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTDKB3FU503555264	Colour	GREY	
Odometer	455714 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	DUNLOP	6 mm	
L/H Front Tyre	195/65 R15	DUNLOP	6 mm	
R/H Rear Tyre	195/65 R15	DUNLOP	6 mm	
L/H Rear Tyre	195/65 R15	DUNLOP	6 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	28/07/2021	Inspection Date	29/07/2021	
Survey held at	BORNEO MOTORS (S) PTE LTD 2 PANDAN CRESCENT SINGAPORE 128462			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLM 9015M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SUNDRIES (SN)	NECESSARY	30.00	30.00
1	SEALANT (SN)	NECESSARY	60.00	60.00
1	LENS & BODY ,RR (SN)	CRACKED	456.50	456.50
1	LENS & BODY ,RR (SN)	SERVICEABLE	506.70	-
1	COVER ,RR BUMPER (SN)	DEFORMED	447.20	447.20
1	GUARD ,RR BUMPER (SN)	CRACKED	582.20	582.20
10	PIECE ,RR BUMPER (SN)	NECESSARY	45.00	41.00
1	FILLER ,RR BUMPER (SN)	CRACKED	124.90	124.90
1	RETAINER ,RR BUMPER (SN)	CRACKED	118.90	118.90
1	RETAINER ,RR BUMPER (SN)	SERVICEABLE	117.70	-
1	REINFORCEMENT (SN)	SERVICEABLE	336.30	-
1	PANEL SUB-ASSY (SN)	BENT	881.80	881.80
1	TROUGH ,BACK DOOR (SN)	SERVICEABLE	104.60	-
1	PANEL BONDING AD (SN)	NOT NECESSARY	267.20	-
1	DUCT ASSY ,QUARTER (SN)	NOT NECESSARY	67.50	-
1	COVER SUB-ASSY (SN)	SERVICEABLE	209.10	-
1	MOULDING ,RR DOOR (SN)	NECESSARY	93.20	93.20
1	MOULDING ASSY ,RR (SN)	NECESSARY	114.70	114.70
1	MOULDING ,RR DOOR (SN)	NECESSARY	39.00	39.00
1	PANEL SUB -ASSY ,RR (SN)	BUCKLED	1,306.50	1,306.50
1	STRIPE RR DOOR (SN)	NECESSARY	22.10	22.10
1	STRIPE RR DOOR (SN)	NECESSARY	35.30	35.30
1	STRIPE RR DOOR (SN)	NECESSARY	15.50	15.50
1	LOCK ASSY ,RR DOOR (SN)	SERVICEABLE	567.30	-
1	REGULATOR SUB-ASSY STRIPE RR DOOR (SN)	SERVICEABLE	208.40	-
1	MOTOR ASSY ,POPWER (SN)	SERVICEABLE	932.80	-
1	RIVET (SN)	NECESSARY	1.50	1.50
1	WEATHERSTRIP ,RR (SN) (ADDITIONAL)	NECESSARY	36.50	36.50
1	WEATHERSTRIP RR (SN) (ADDITIONAL)	NECESSARY	36.50	36.50
10	RIVET (SN) (ADDITIONAL)	NECESSARY	38.00	38.00
10	RIVET (SN) (ADDITIONAL)	NECESSARY	15.00	15.00

Report Ref No. CC4/LPC21008100/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
10	RIVET (SN) (ADDITIONAL) <u>LABOUR</u> TO CHECK WIRING AND LIGHTING TO WATER TEST FOR LEAK. TO TRANSFER RHR DOOR GLASS ,BOARD MECHANISM TO NEW PANEL. TO REPLACE REAR RH SIDE ACCIDENT DAMAGE PARTS STRAIGHTEN /REALIGN ALL OTHER AFFECTED AREAS . TO SPRAY PAINT ON REAR RH SIDE ACCIDENT AFFECTED AREAS .	NECESSARY	20.00	20.00
			7,837.90	4,516.30
			122.40	122.40
			360.00	360.00
			4,320.00	3,600.00
			3,540.00	2,360.00
			8,342.40	6,442.40
GRAND TOTAL			16,180.30	10,958.70
RECOMMENDED COST OF REPAIRS				10,958.70

Report Ref No. CC4/LPC21008100/Rpa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLM 9015M

INSPECTION

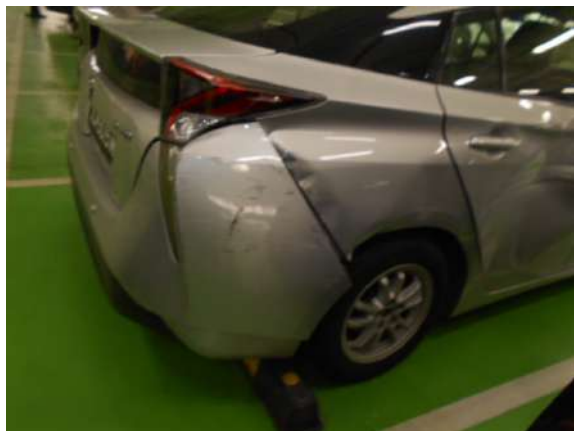



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLM 9015M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

