



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2202131

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 13/04/2022
Reference CC4/LPC21008244/Eea3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMQ 6832H
Insured Veh. SDF 7712D
Claim No. 20/21/21/VC20/024821
Policy No. Z/20/VC20/108817
Accident Date 03/08/2021
Inspection Date 18/08/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21008244/Eea3q2 Date: 13/04/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SDF 7712D	Veh. Inspected	SMQ 6832H	
Policy No.	Z/20/VC20/108817	Coverage (\$)	0.00	
Claim No.	20/21/21/VC20/024821	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	04/08/2021	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. 520i	c.c	1998	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	WBAJA12010BT82772	Colour	WHITE	
Odometer	18043 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/50 R18	BRIDGESTONE	5 mm	
L/H Front Tyre	215/50 R18	BRIDGESTONE	5 mm	
R/H Rear Tyre	215/50 R18	BRIDGESTONE	5 mm	
L/H Rear Tyre	215/50 R18	BRIDGESTONE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/08/2021	Inspection Date	18/08/2021	
Survey held at	PERFORMANCE MOTORS LTD 303 ALEXANDRA ROAD SINGAPORE 159941			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMQ 6832H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SUNDRIES (SN)	NECESSARY	150.00	150.00
1	BODYWORK ADHESIVE K5A (50ML) (SN)	NECESSARY	116.15	116.15
1	CLEARNER R1 (100 ML) (SN)	NECESSARY	26.15	26.15
1	PLAQUE 74MM (SN)	NECESSARY	71.95	71.95
1	COMPLETE TAIL TRIM (SN)	DENTED	841.95	841.95
1	LH BRACKET OPENING AID (SN)	NOT NECESSARY	96.05	-
1	RH BRACKET OPENING AID (SN)	NOT NECESSARY	96.05	-
1	TAIL GATE ALUMINIUM (SN)	TO REPAIR SEE LABOUR	1,758.45	-
1	REAR BUMPER CARRIER (SN)	DENTED	582.55	582.55
1	REAR BUMPER BOTTOM REINFORCEMENT (SN)	BROKEN	75.90	75.90
1	REAR BUMPER CENTRE GUIDE (SN)	BROKEN	177.25	177.25
1	REAR BUMPER LH SIDE GUIDE (SN)	NOT NECESSARY	177.25	-
1	REAR BUMPER RH SIDE GUIDE (SN)	NOT NECESSARY	177.25	-
1	REAR BUMPER TRIM STRIP (SN)	BROKEN	105.70	105.70
1	REAR BUMPER PANEL PRIMED (PD) (SN)	BROKEN	1,627.25	1,627.25
1	LETTERING 520I (SN)	NECESSARY	64.75	64.75
1	PLAQUE 82MM (SN)	NOT NECESSARY	71.95	-
2	GROMMET (SN)	NECESSARY	1.60	1.60
1	LOCK TRUNK LID (SN)	NOT NECESSARY	230.30	-
10	EXPANDING RIVET D=8MM (SN)	NOT NECESSARY	11.00	-
1	INDERBODY PANELLING REAR (SN)	BROKEN	41.20	41.20
1	TRUNK LID GASKET (SN)	NECESSARY	129.35	129.35
1	SENSOR WIRE FOR SMART OPENER TOP (SN)	NOT NECESSARY	46.55	-
1	SENSOR WIRE FOR SMART OPENER BOTTOM (SN)	NOT NECESSARY	51.20	-
10	EXPANDING NUT (SN)	NECESSARY (2 PCS ONLY)	5.50	2.00
2	DECOUPING RING PDC TORQUE CONVERTER (SN)	NOT NECESSARY	10.30	-
2	ULTRASONIC SENSOR ALPINWEISS (U300) (SN)	NOT NECESSARY	766.30	-
50	BLIND RIVET AVIBVLB (SN)	NECESSARY	27.50	27.50
5	SCREW (SF PLUS M5X15) (SN)	NECESSARY (3 PCS ONLY)	2.75	1.65

Report Ref No. CC4/LPC21008244/Eea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	(DG/SL) BODY ADHESIVE K5B (195ML) (SN)	NECESSARY	336.75	336.75
50	PUNCH RIVET N4 (SN)	NECESSARY	27.50	27.50
3	(S/L) SEAM SEAL 300ML (SN)	NECESSARY (1 PCS ONLY)	101.40	33.80
			8,005.80	4,440.95
	LABOUR			
	TO REPLACE REAR BUMPER ,BOOT LID ,TAIL PANEL INCLUDING TO KNOCK OUT DENTED AREA CAUSED BY THE ACCIDENT.INCLUSIVE OF THE REPAIR OF TAIL GATE ALUMINIUM.		4,250.00	3,400.00
	TO RESPRAY REAR BUMPER BOOT LID ,TAIL PANEL ,REAR LEFT FENDER ,REAR RIGHT FENDER AND BOOT COMPARTMENT.		5,120.00	2,678.00
	TO CARRY OUT BODY CAVITY PRESERVATION (PER PANEL).		118.00	112.00
	TO REPLACE BOOTLID SMART OPENER TOP AND BOTTOM SENSOR LINE INCLUDING PROGRAM AND CONDUCT CHECK FOR PROPER FUNCTION .		661.00	627.00
	TO TRANSFER LOCK MECHANISM FRONT OLD TO NEW BOOTLID INCLUDING CONDUCT CHECK ON NEW BOOTLID CENTRAL LOCKING SYSTEM FOR PROPER FUNCTION .	NOT NECESSARY	531.00	-
	TO REMOVE AND INSTALL FUSE BOX AT THE REAR SECTION TO FACILITATE REPAIR.	NOT NECESSARY	531.00	-
	TO CHECK ELECTRICAL WIRING SYSTEM AND LIGHTING AT THE REAR SECTION FOR PROPER FUNCTION.		177.00	168.00
			11,388.00	6,985.00
GRAND TOTAL			19,393.80	11,425.95
RECOMMENDED COST OF REPAIRS				11,425.95

Report Ref No. CC4/LPC21008244/Eea3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 6832H

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

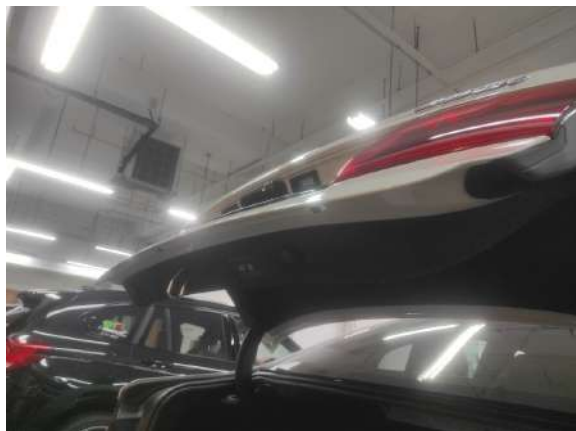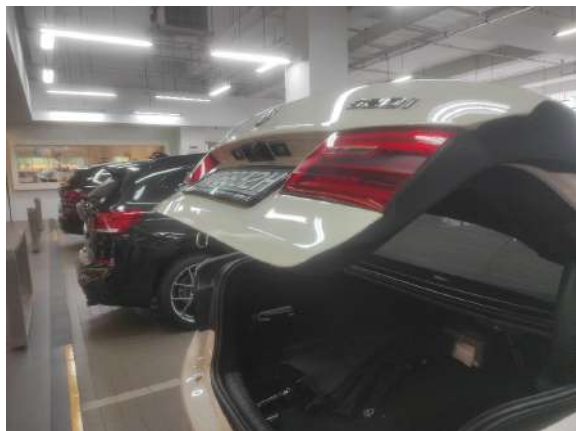




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

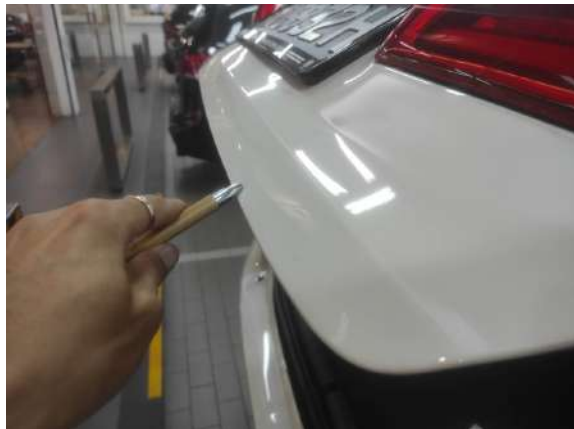



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 6832H

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

