


176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721
Mobile: (65) 8263 6295 Email: thiamhenghuat@gmail.com

Date: 11/08/2021
Claim Type: TP
VRN: SCN7922J

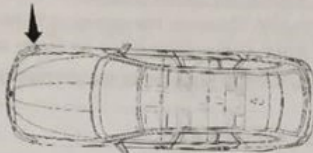

Not Notarized
11 Sep @ 4000h
Brewery After Paving

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front fender o/s	1	\$ 1,129.00	\$ 1,129.00
2	Front fender inner shield o/s	1	\$ 285.00	\$ 285.00
3	Headlamp o/s 3001.75	1	\$ 3,165.00	\$ 3,165.00
4	Headlamp lower bracket o/s	1	\$ 109.00	\$ 109.00
5	Front bumper 972.25	1	\$ 1,469.00	\$ 1,469.00
6	Front bumper under cowling	1	\$ 396.00	\$ 396.00
7	Front bumper side retainer	2	\$ 114.00	\$ 228.00
8	Front bumper foglamp o/s	1	\$ 487.00	\$ 487.00
9	Front bumper foglamp garnish o/s	1	\$ 266.00	\$ 266.00
10	Front bumper lower grille	1	\$ 565.00	\$ 565.00
11	Radiator grille bracket	1	\$ 147.00	\$ 147.00
12	Front shock absorber o/s 449.20	1	\$ 689.00	\$ 689.00
13	Front shock absorber mounting o/s	1	\$ 195.00	\$ 195.00
14	Front lower arm o/s	1	\$ 487.00	\$ 487.00
15	Front wheel knuckle o/s 465.50	1	\$ 598.00	\$ 598.00
16	Front wheel bearing o/s 215	1	\$ 290.00	\$ 290.00
17	Front end link o/s	1	\$ 214.00	\$ 214.00
18	Headlamp top support o/s	1	\$ 215.00	\$ 215.00
19	Front bumper reinforcement	1	\$ 677.00	\$ 677.00
20	Front bumper impact absorber	1	\$ 189.00	\$ 189.00
21	Front fender inner top bracket o/s	1	\$ 159.00	\$ 159.00
22	Front fender "HYBRID" emblem o/s	1	\$ 73.00	\$ 73.00
23	Wiper washer tank	1	\$ 267.00	\$ 267.00
24	Wiper washer tank motor	1	\$ 313.00	\$ 313.00
Subtotal				\$ 12,612.00
List discount				25.00%
Total				\$ 9,459.00

Repair Estimate

Special nett items

No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front bumper clips	12	\$ 5.50	\$ 66.00
2	Front fender inner shield clips o/s	8	\$ 5.50	\$ 44.00
3	Front tyre o/s	1	\$ 380.00	\$ 380.00
4	Front alloy rim o/s	1	\$ 550.00	\$ 550.00
5	Sundries	1	\$ 50.00	\$ 50.00
Total				\$ 1,090.00

501n
X
X
3501n
X

Labour

No.	Description	Work unit	Amount
1	To dismantle / renew accident damaged portions. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	7	\$ 1,400.00
2	To disconnect front wire harness of electrical components to facilitate repairs, reconnect and check functions including focusing headlamps.	0.25	\$ 50.00
3	To remove and refit o/s front tyre & rims. To perform tyre balancing.	0.25	\$ 50.00
4	To remove and refit o/s front undercarriage for replacement of parts.	1	\$ 200.00
5	To conduct computerized wheel alignment.	0.5	\$ 100.00
6	Supply spray paint material and necessary items to respray affected area / panel.	6	\$ 1,200.00
7	To rust proof all affected portions after repair.	0.5	\$ 100.00
Total labour			\$ 3,100.00

2501
201
201
1401
601
2201
X

Estimate Grand Total \$ 13,649.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: