



PRIORITY SERVICES

Insurance Loss Adjusters and Motor Appraisers

Blk 779 Yishun Avenue 2

#01-1545 Singapore 760779

Tel: 6293 4822 Fax: 6296 3283

E-mail: admin@priorityservices.sg

Messrs. Sompoo Insurance Pte Ltd
50 Singapore Land Tower
#05-01/06 Raffles Place
Singapore 048623

Bill No : DN/01639/20

Date : 22/9/2020

Dr.

To

Survey Fee (S\$) : 300.00

Photographs (S\$) :

Transport (S\$) :

Resurvey (S\$) :

Miscellaneous (S\$) :

Services rendered including photographs and transport charges

(S\$) : 300.00

Our Reference : TP-0139/08/20

Insured : XD 8817 C

Date Of Accident : 26/06/2020

Policy / Cert. No. : Paper Survey

Your Claim No : CMTD2001923/AGC

Vehicle : Mercedes Benz C180 Coupe (A) - SKL 8223 C

Dollars : Three Hundred ONLY

For PRIORITY SERVICES

E & O.E.



PRIORITY SERVICES

Insurance Loss Adjusters and Motor Appraisers
Blk 779 #01-1545 Yishun Ave 2 Singapore 760779
Tel: 62934822 Fax: 62963283
E-mail: admin@priorityservices.sg

Date: 22 September 2020
Your Ref: CMTD2001923/AGC
Our Ref: TP-0139/08/20

Motor Claims Department
M/s. Sompo Insurance Pte. Ltd.
50 Raffles Place #05-01/06
Singapore Land Tower
Singapore 048623

Attention: Ms. Agnes Chan

Madam,

Inspection of 2019 Mercedes Benz C180 Coupe (S)
Registration No.: SKL 8223 C
Odometer Reading: 23857 km
Chassis No.: WDD2053402F827462

We refer to your instructions to us to conduct a paper survey of the above vehicle. A pre-repair survey was conducted on 29-06-2020, followed by inspection of dismantled parts on 01-07-2020 and resurvey after repairs on 15-07-2020.

The following documents were received: -

- 1) Copy of survey report by M/s. Vicom Ltd
- 2) 300 copies of photos depicting damages sustained by SKL 8223 C
- 3) Accident reports by drivers of SKL 8223 C and XD 8817 C

The vehicle sustained front LH and rear RH damages during an accident on 26-06-2020.

Repair cost submitted was \$57,014.71 part-by-part.

We append below our findings: -

<u>Replacement of Parts</u>		<u>Revised Amount</u>	<u>Our Recommendation</u>
1pc.	Boot lid	\$ 2,859.25	\$ 2,273.75
1pc.	Boot lid logo	145.00	145.00
1pc.	Boot lid camera unit	1,804.00	1,180.00
1pc.	Boot lid lamp o/s	985.30	597.30
1pc.	Boot lid inner lock – refit	483.60	-
1pc.	Boot lid striker	84.50	84.50
1pc.	Boot lid weatherstrip	295.60	295.60
1pc.	Boot lid inner trim board	983.60	157.23

1pc.	Boot lid lifter motor	\$ 1,470.00	\$ 931.70
1pc.	Rear ECU	2,415.80	957.91
1pc.	Rear ECU bracket	198.60	198.60
1pc.	Rear bumper	1,893.60	1,457.45
1pc.	Rear bumper side retainer o/s	125.60	125.60
1pc.	Rear bumper centre bracket	110.20	110.20
1pc.	Rear bumper reinforcement	892.30	712.25
1pc.	Rear bumper diffuser	482.20	233.41
1pc.	Rear bumper diffuser outer chrome	365.00	236.64
2pcs.	Rear bumper number plate lamp	250.00	250.00
2pcs.	Reverse sensor	526.00	357.50
1pc.	Rear end panel	1,752.30	1,166.28
1pc.	Rear end panel top garnish	410.80	144.66
1pc.	Tail lamp o/s	1,023.50	630.75
1pc.	Tail lamp base panel o/s – repair	587.20	-
1pc.	Tail lamp lower bracket o/s	185.00	185.00
1pc.	Tail lamp outer garnish o/s	296.30	296.30
1pc.	Bonnet	2,582.60	2,114.35
1pc.	Bonnet insulator	361.40	239.97
2pcs.	Bonnet lock assy	516.00	137.22
1pc.	Bonnet lock bracket n/s	357.50	36.41
1pc.	Bonnet lock latch n/s	190.20	68.00
1pc.	Bonnet logo	108.60	108.60
1pc.	Front bumper	1,982.60	1,580.69
1pc.	Front bumper top rubber	168.30	168.30
1pc.	Front bumper top beam	742.63	224.99
1pc.	Front bumper side retainer n/s	247.30	100.43
1pc.	Front bumper inner sponge	278.90	164.74
1pc.	Front bumper reinforcement – slightly dented/repairable/repared	782.30	-
1pc.	Front grille centre logo	250.00	250.00
1pc.	Front bumper centre grille – not necessary	1,882.50	-
1pc.	Front bumper centre grille base – not necessary	652.30	-
1pc.	Front bumper fog lamp garnish LH – not consistent	104.00	-
1pc.	Front logo base	498.60	35.00
1pc.	Front logo chrome	198.30	143.59
1pc.	Front grille base	245.80	125.00
1pc.	Front grille top RH	175.70	125.00
1pc.	Front grille bottom RH	198.10	135.00
1pc.	Front grille top LH	174.30	125.00
1pc.	Front grille bottom LH	198.20	135.00
1pc.	Front radar sensor	3,582.30	1,177.59
1pc.	Front radar sensor cover	398.20	29.50
1pc.	Front support panel	2,984.60	743.36
1pc.	Front support panel top garnish	451.20	43.82
1pc.	Front support panel bracket	177.60	177.60
1pc.	Front fender n/s	1,443.50	929.45
1pc.	Front fender inner cowling n/s	243.60	243.60
2pcs.	Front windscreen side moulding – not affected	974.40	-
1pc.	Air-con condenser	1,982.30	1,472.72
1pc.	Radiator	1,758.00	1,272.00
1pc.	Radiator side bracket	281.60	281.60
1pc.	Radiator support beam	415.80	415.80
1pc.	Cooling fan assy – cowling cracked	2,458.70	1,750.00

1pc.	Intercooler – not affected	\$ 1,882.60	\$ -
1pc.	Headlamp n/s	3,892.60	3,340.00
1pc.	Air guide garnish	241.30	241.30
		<u>56,689.68</u>	<u>30,863.26</u>
	Less 10%	5,668.97	3,086.33
		<u>\$ 51,020.71</u>	<u>\$ 27,776.93</u>

Special Nett Items:-

1pc.	Boot lid spoiler	\$ 680.00	\$ 680.00
1pc.	Boot lid inner trim board clips – not affected	20.00	-
4pcs.	Rear bumper reverse sensor seal	40.00	40.00
1pc.	Rear end panel sealant – not necessary	60.00	-
1pc.	Tail lamp base panel sealant – not necessary	30.00	-
1pc.	Bonnet insulator clips – not affected	20.00	-
2pcs.	Front fender inner cowling clips – not affected	14.00	-
2pcs.	Front windscreen side moulding clips – not affected	20.00	-
1bot	Air-con fluid	60.00	60.00
1bot	Radiator coolant	60.00	60.00
	Total For Parts:-	<u>\$ 52,024.71</u>	<u>\$ 28,616.93</u>

Labour Charges:-

R & R rear upholstery.	\$ 200.00	\$ 200.00
R & R boot lid component }	80.00	80.00
R & R boot lid camera unit. }	40.00	-
R & R boot lid lifter motor. }	180.00	-
R & R reverse sensor.	40.00	40.00
R & R rear ECU.	180.00	180.00
R & R fuel filler pipe.	60.00	-
Check wiring rear.	20.00	20.00
Rust proofing rear.	60.00	60.00
Panel beating rear.	1,000.00	800.00
Spray painting rear.	1,000.00	1,000.00
R & R air-con condenser.	120.00	120.00
R & R radiator. }	80.00	80.00
R & R intercooler. }	80.00	-

Diagnostic reset fault code.	\$ 200.00	\$ 20.00
Check wiring front.	20.00	20.00
Rust proofing front.	30.00	-
Panel beating front.	800.00	600.00
Spray painting front.	800.00	600.00
	=====	=====
Total (Part-By-Part) :-	\$ 57,014.71	\$ 32,436.93
	=====	=====

Estimated period of repairs: 15 working days

Pre-accident Market Value : About \$ 160,000.00
 PARF/COE rebate : \$ 68,197.00

Vehicle within economical limit to repair.

We leave the decision of settlement to you.

Assuring you of our best services always


Yours faithfully

PRIORITY SERVICES



JIMMY S. T. LEE AMSOE, AMIRTE, MSAAA
Motor Appraiser

Surveyed by:

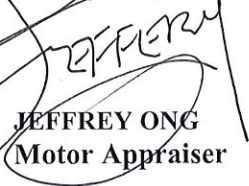

JEFFREY ONG
Motor Appraiser