



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV No. AC2200152

INV Date 07/01/2022

Reference CC4/FCI21008670/Aga3q2

Code FCI2

### PROFESSIONAL SERVICE FEE

Vehicle No. SKK 4263T  
Insured Veh. SG 5016K  
Claim No. D21002338MFBP/1  
Policy No. D-21097502MFBP  
Accident Date 14/08/2021  
Inspection Date 18/08/2021

Description	Total
Survey Inspection	521.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>521.00</b>
<b>GST (7%)</b>	<b>36.47</b>
<b>Grand Total</b>	<b>557.47</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI21008670/Aga3q2 Date: 07/01/2022 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SG 5016K	Veh. Inspected	SKK 4263T
Policy No.	D-21097502MFBP	Coverage (\$)	0.00
Claim No.	D21002338MFBP/1	Excess (\$)	0.00
Assign From	RACHEL WU	Assign Date	18/08/2021
2. Vehicle Particulars & Condition			
Make & Model	MERCEDES BENZ C 200	c.c	1796
Engine No.	HIDDEN	Year of Reg.	2010
Chassis No.	WDD2040482A460421	Colour	WHITE
Odometer	172997 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
R/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	14/08/2021	Inspection Date	18/08/2021
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKK 4263T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	BOOT LID	BUCKLED	1,589.60	1,589.60
1	BOOT LID BADGE	NECESSARY	98.70	98.70
1	BOOT LID EMBLEM C200	NECESSARY	98.70	98.70
1	BOOT LID EMBLEM CGI	NECESSARY	96.30	96.30
1	BOOT LID INNER LOCK	NOT NECESSARY	298.60	-
1	BOOT LID WEATHERSTRIP	NOT NECESSARY	208.50	-
1	BOOT LID INNERTRIM	NOT NECESSARY	308.70	-
1	BOOT LID OUTER GARNISH	NOT NECESSARY	325.80	-
1	REAR BUMPER	DEFORMED	1,429.60	1,429.60
2	REAR BUMPER SIDE RETAINERS @\$98.60	NECESSARY	197.20	197.20
2	REAR BUMPER ATTACHMENT RETAINERS @\$95.30	NOT NECESSARY	190.60	-
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR BUMPER APRON GARNISH	NOT NECESSARY	156.00	-
1	REAR BUMPER REINFORCEMENT	DENTED	605.80	605.80
1	REAR BUMPER CENTER CHROME MOULDING	NECESSARY	169.00	169.00
2	REAR BUMPER SIDE CHROME MOULDING @\$138.60	NECESSARY	277.20	277.20
1	REAR BUMPER TOP COVER	NOT NECESSARY	65.20	-
1	REAR BUMPER LOWER SIDE COVER RH	NOT NECESSARY	72.00	-
4	REAR BUMPER REVERSE SENSOR @\$225.80	DAMAGED (2 PCS ONLY)	903.20	451.60
4	REAR BUMPER REVERSE SENSOR HOLDER @\$38.90	NECESSARY	155.60	100.00
2	TAILLAMPS @\$698.30	N/S CRACKED	1,396.60	698.30
2	TAILLAMPS INNER SEALER @\$38.00	NECESSARY	76.00	20.00
2	SET TAILLAMPS CLIPS @\$30.00	NECESSARY	60.00	20.00
2	TAILLAMPS RAILING GARNISH @\$45.00	NOT NECESSARY	90.00	-
2	SET TAILLAMPS RAILING GARNISH CLIPS @\$20.00	NOT NECESSARY	40.00	-
1	END PANEL	TO REPAIR SEE LABOUR	987.60	-
1	END PANEL TOP TRIM	CRACKED	195.20	195.20
1	SET END PANEL TOP TRIM CLIPS	NECESSARY	30.00	10.00
1	SPARE TYRE PANEL	NOT NECESSARY	987.50	-

Report Ref No. CC4/FCI21008670/Aga3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SPARE TYREP TOP BOARD	NOT NECESSARY	589.60	-
1	SPARE TYRE PANEL TOOLS TRAY	NOT NECESSARY	256.30	-
2	REAR FENDER INNER SHIELD @\$165.30	NOT NECESSARY	330.60	-
2	SET REAR FENDER INNER SHIELD CLIPS @\$30.00	NOT NECESSARY	60.00	-
2	REAR FENDER INNER TRIM @\$305.80	NOT NECESSARY	611.60	-
2	SET REAR FENDER INNER SHIELD CLIPS @\$30.00	NOT NECESSARY	60.00	-
2	REAR FENDER AIR DUCTS @\$98.50	NOT NECESSARY	197.00	-
1	REAR EXHAUST SILENCER	NOT NECESSARY	1,668.00	-
1	REAR EXHAUST GASKET	NOT NECESSARY	46.00	-
2	REAR EXHAUST MOUNTINGS @\$72.00	NOT NECESSARY	144.00	-
1	REAR EXHAUST TOP HEAT PLATE	NOT NECESSARY	185.20	-
1	REAR EXHAUST SIDE HEAT PLATE	NOT NECESSARY	168.90	-
	LESS 10% DISCOUNT		-1,547.64	-610.72
			13,928.76	5,496.48
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET BODY PANEL JOINT SEALANT (SN)	NECESSARY	120.00	60.00
1	REAR EXHAUST CHROME PIPE (SN)	NOT NECESSARY	180.00	-
1	SET BOOTLID VINYL STICKER (SN)	NECESSARY	350.00	150.00
1	SET REAR BUMPER CHROME LINING STICKER (SN)	NECESSARY	250.00	100.00
1	REAR BUMPER DIFFUSER STICKER (SN)	NECESSARY	200.00	120.00
			1,100.00	430.00
	<b><u>LABOUR</u></b>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF END PANEL .		1,600.00	700.00
	SPRAY PAINTING .		1,600.00	750.00
	CHECK WIRING .		100.00	30.00
	ANTI RUST.		180.00	60.00
	REMOVE AND INSTALL CARPET AND SEAT.		150.00	60.00
	REMOVE AND INSTALL REVERSE SENSOR .		90.00	60.00
	REMOVE AND INSTALL REAR EXHAUST SILENCER .	NOT NECESSARY	150.00	-
	RESET AND REPROGRAM SRS UNIT.	NOT NECESSARY	300.00	-



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND INSTALL FRONT SENSOR .		90.00	50.00
			4,260.00	1,710.00
<b>GRAND TOTAL</b>			<b>19,288.76</b>	<b>7,636.48</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>6,100.00</b>

Report Ref No. CC4/FCI21008670/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SKK 4263T

## INSPECTION






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

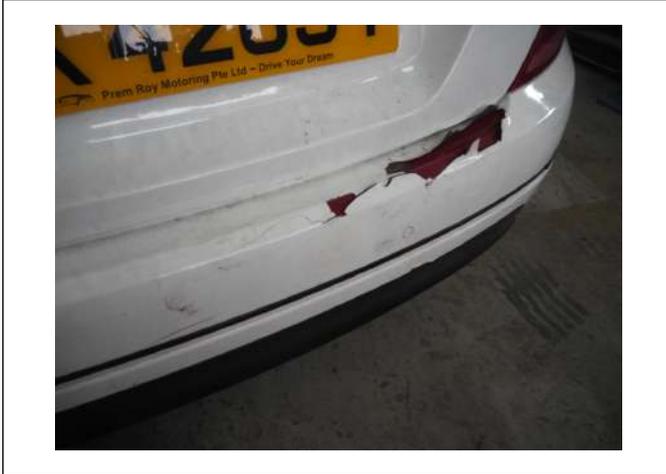



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

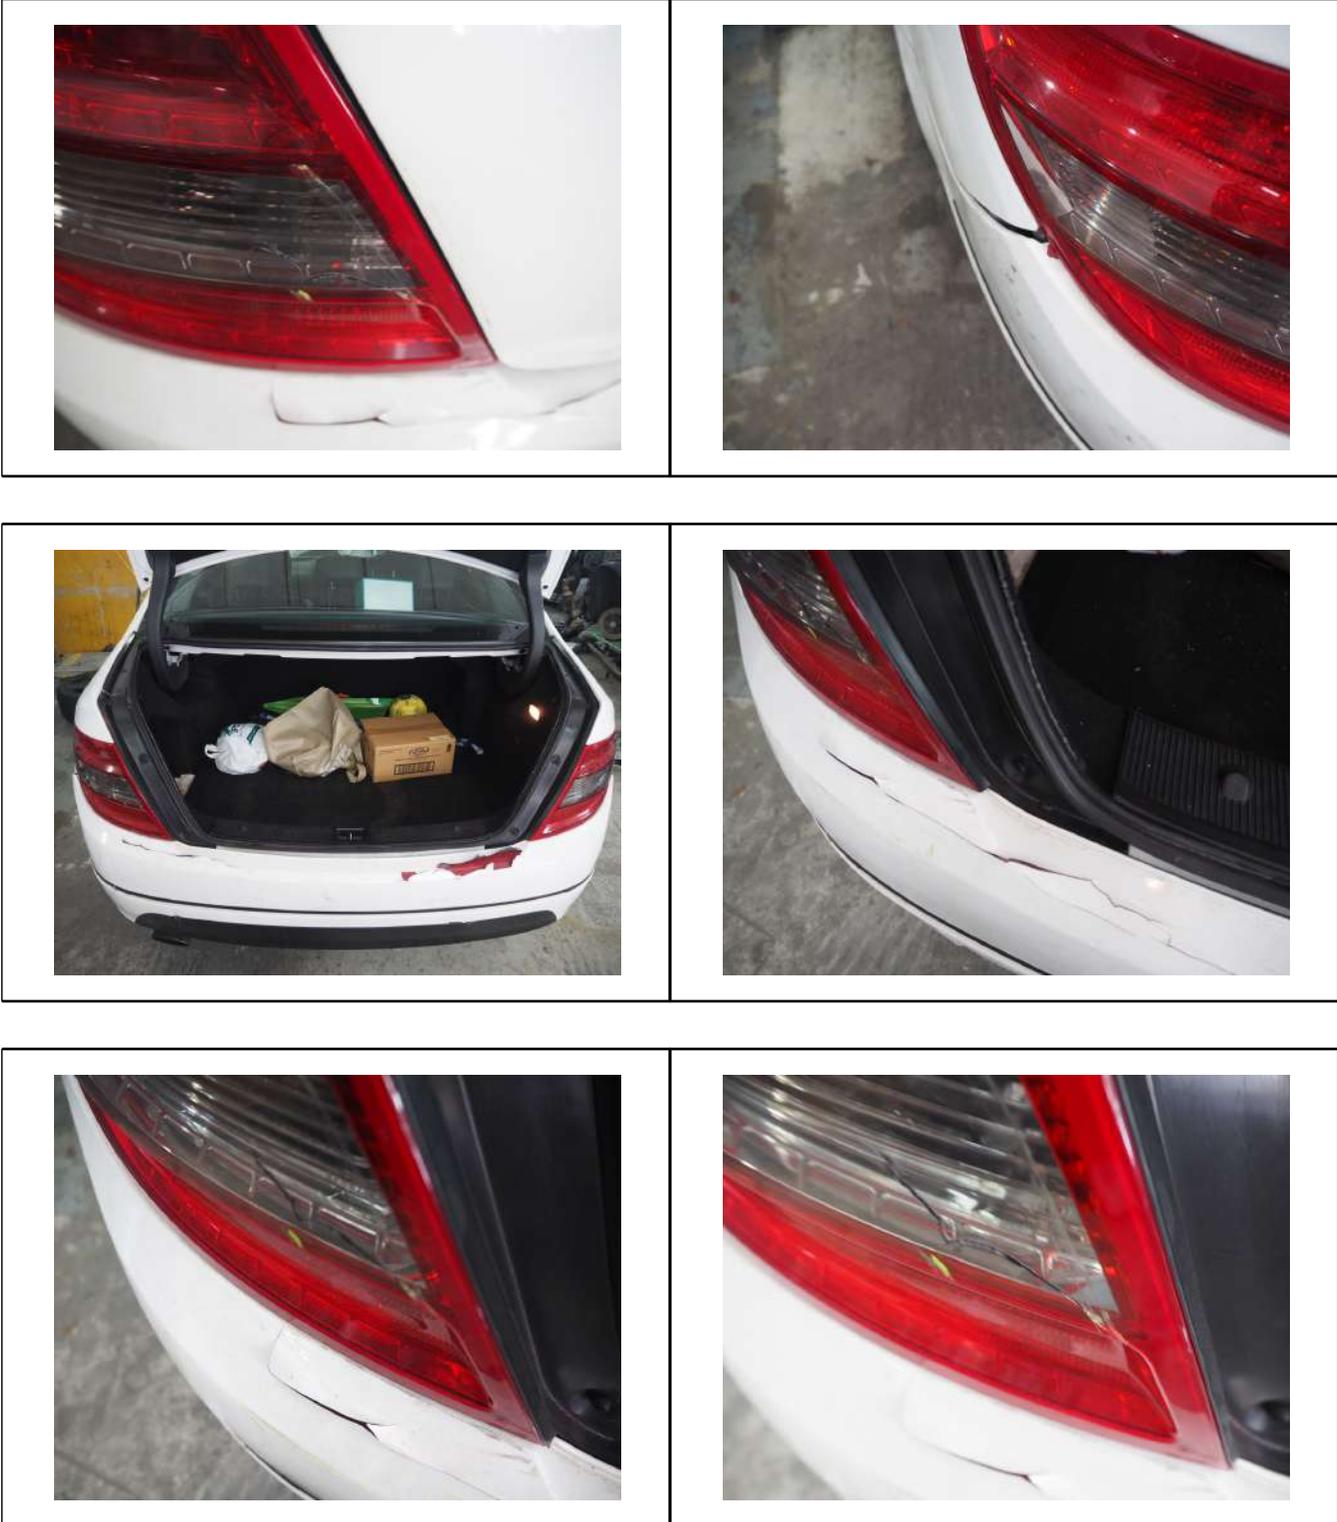



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

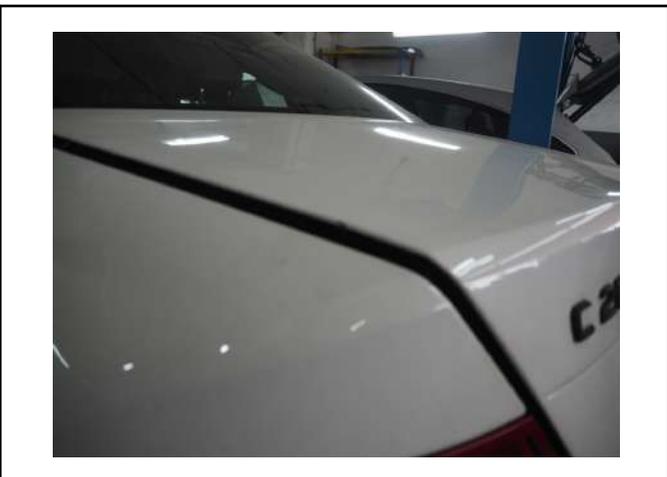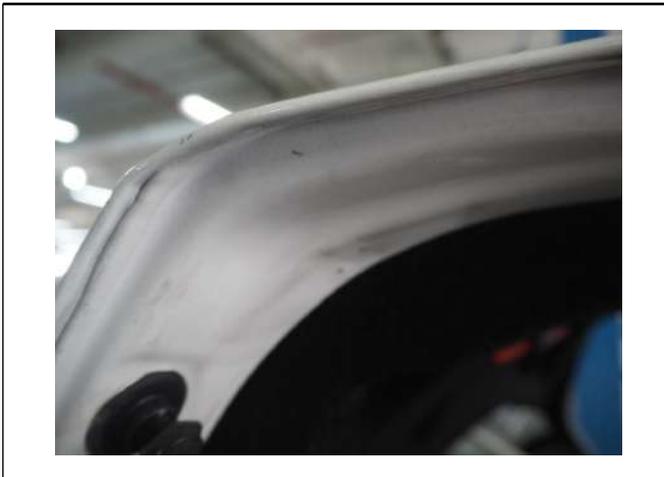




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

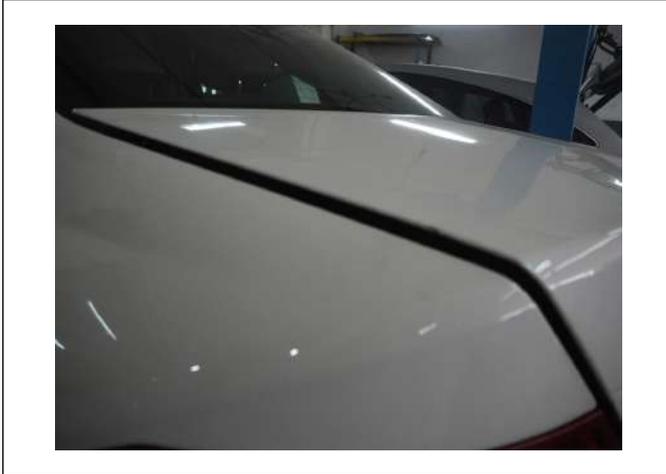



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SKK 4263T

## RE-INSPECTION

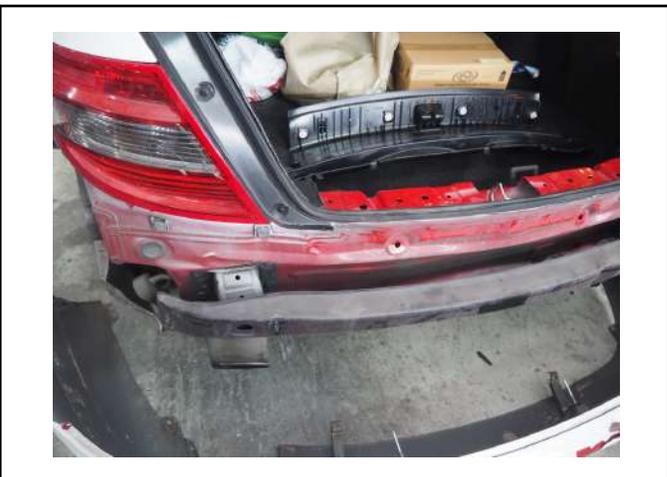



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKK 4263T

RE-INSPECTION

