



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2106922
3 ANSON ROAD #16-00	INV Date	06/10/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21008695/Uea3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SMM 8855A
Insured Veh.	SLC 8201B
Claim No.	SNM21D204616/C02
Policy No.	DMHCSNA00004192100
Accident Date	18/08/2021
Inspection Date	19/08/2021

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD  
3 ANSON ROAD #16-00  
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC6/CTI21008695/Uea3q2

Date: 06/10/2021

Code: CTI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SLC 8201B	<b>Veh. Inspected</b>	SMM 8855A
<b>Policy No.</b>	DMHCSNA00004192100	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	SNM21D204616/C02	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	19/08/2021

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	KIA CERATO EX (A)	<b>c.c</b>	1591
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2019
<b>Chassis No.</b>	KNAF3416MK5045133	<b>Colour</b>	WHITE
<b>Odometer</b>	30103 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	205/55 R16	KUMHO	6 mm
<b>L/H Front Tyre</b>	205/55 R16	KUMHO	6 mm
<b>R/H Rear Tyre</b>	205/55 R16	KUMHO	6 mm
<b>L/H Rear Tyre</b>	205/55 R16	KUMHO	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	18/08/2021	<b>Inspection Date</b>	19/08/2021
<b>Survey held at</b>	HUP MOTOR TRADING & SERVICE BLK 9004 TAMPINES ST 93 #01-120 SINGAPORE 528838		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMM 8855A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	BOOT LID	DENTED	1,297.00	1,297.00
1	BOOT LID LOGO EMBLEM	NECESSARY	52.00	52.00
1	BOOT LID N/S REFLECTER	NOT NECESSARY	608.00	-
8	BOOT LID INSULATOR CLIPS @\$3.80	NOT NECESSARY	30.40	-
1	REAR BUMPER	DEFORMED	688.00	688.00
10	REAR BUMPER CLIPS @\$3.80	NECESSARY	38.00	38.00
1	REAR BUMPER N/S REVERSE LAMP ASSY	SERVICEABLE	181.00	-
1	REAR BUMPER REINFORCEMENT	CRACKED	354.00	354.00
1	REAR BUMPER REINFORCEMENT N/S STAY BRACKET	NOT NECESSARY	65.00	-
2	REAR BUMPER REINFORCEMENT O/S & N/S TOP BRACKET @\$18.00	NOT NECESSARY	36.00	-
3	REAR BUMPER REINFORCEMENT LOWER BRACKET @ \$18.00	NOT NECESSARY	54.00	-
1	REAR BUMPER DAMPER	NOT NECESSARY	72.00	-
2	REAR BUMPER O/S & N/S SIDE RETAINER @\$28.00	NOT NECESSARY	56.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	342.00	-
	LESS 10% DISCOUNT		-387.34	-242.90
			3,486.06	2,186.10
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR NUMBER PLATE & FRAME (SN)	NOT NECESSARY	40.00	-
1	BOOT LID SPOILER SEALANT (SN)	NOT NECESSARY	50.00	-
1	REAR BUMPER LOWER SPOILER (SPORT) (SN)	CUT / DEFORMED	800.00	800.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	SERVICEABLE	200.00	-
1	REAR BUMPER N/S REVERSE LAMP GARNISH (SN)	SERVICEABLE	145.00	-
			1,235.00	800.00
<b><u>LABOUR</u></b>				
	TO WIRING CHECK UP .		50.00	20.00
	TO REMOVE & REFIX CARPET ,FLOOR BOARD COVER ,GARNISH ,SPARE TYRE TOOL SET & NECESSARY PARTS.		150.00	80.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE ,REFIX & PUMP SEALANT FOR BOOT LID TOP SPOILER .		150.00	50.00
	TO RESPRAY TUFF-KOTE ON ALL AFFECTED ACCIDENT PARTS.		80.00	30.00
	LABOUR CHARGE TO REMOVE & CUT OUT DAMAGED PARTS ,TO JACK ,STRAIGHTEN & KNOCKING OUT REAR END PANEL & NECESSARY PARTS,TO WELD ,RENEW & ALIGN ABOVE PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL .		1,000.00	520.00
	TO PUTTY & RESPRAY PAINTING (PEARL COLOUR) ON ALL AFFECTED ACCIDENT PARTS.		1,350.00	800.00
			2,780.00	1,500.00
	<b>GRAND TOTAL</b>		<b>7,501.06</b>	<b>4,486.10</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>4,486.10</b>

Report Ref No. CC6/CTI21008695/Uea3q2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMM 8855A

## INSPECTION






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

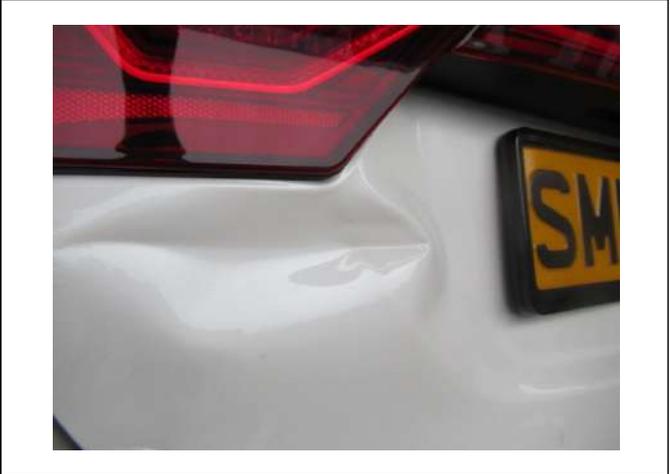




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

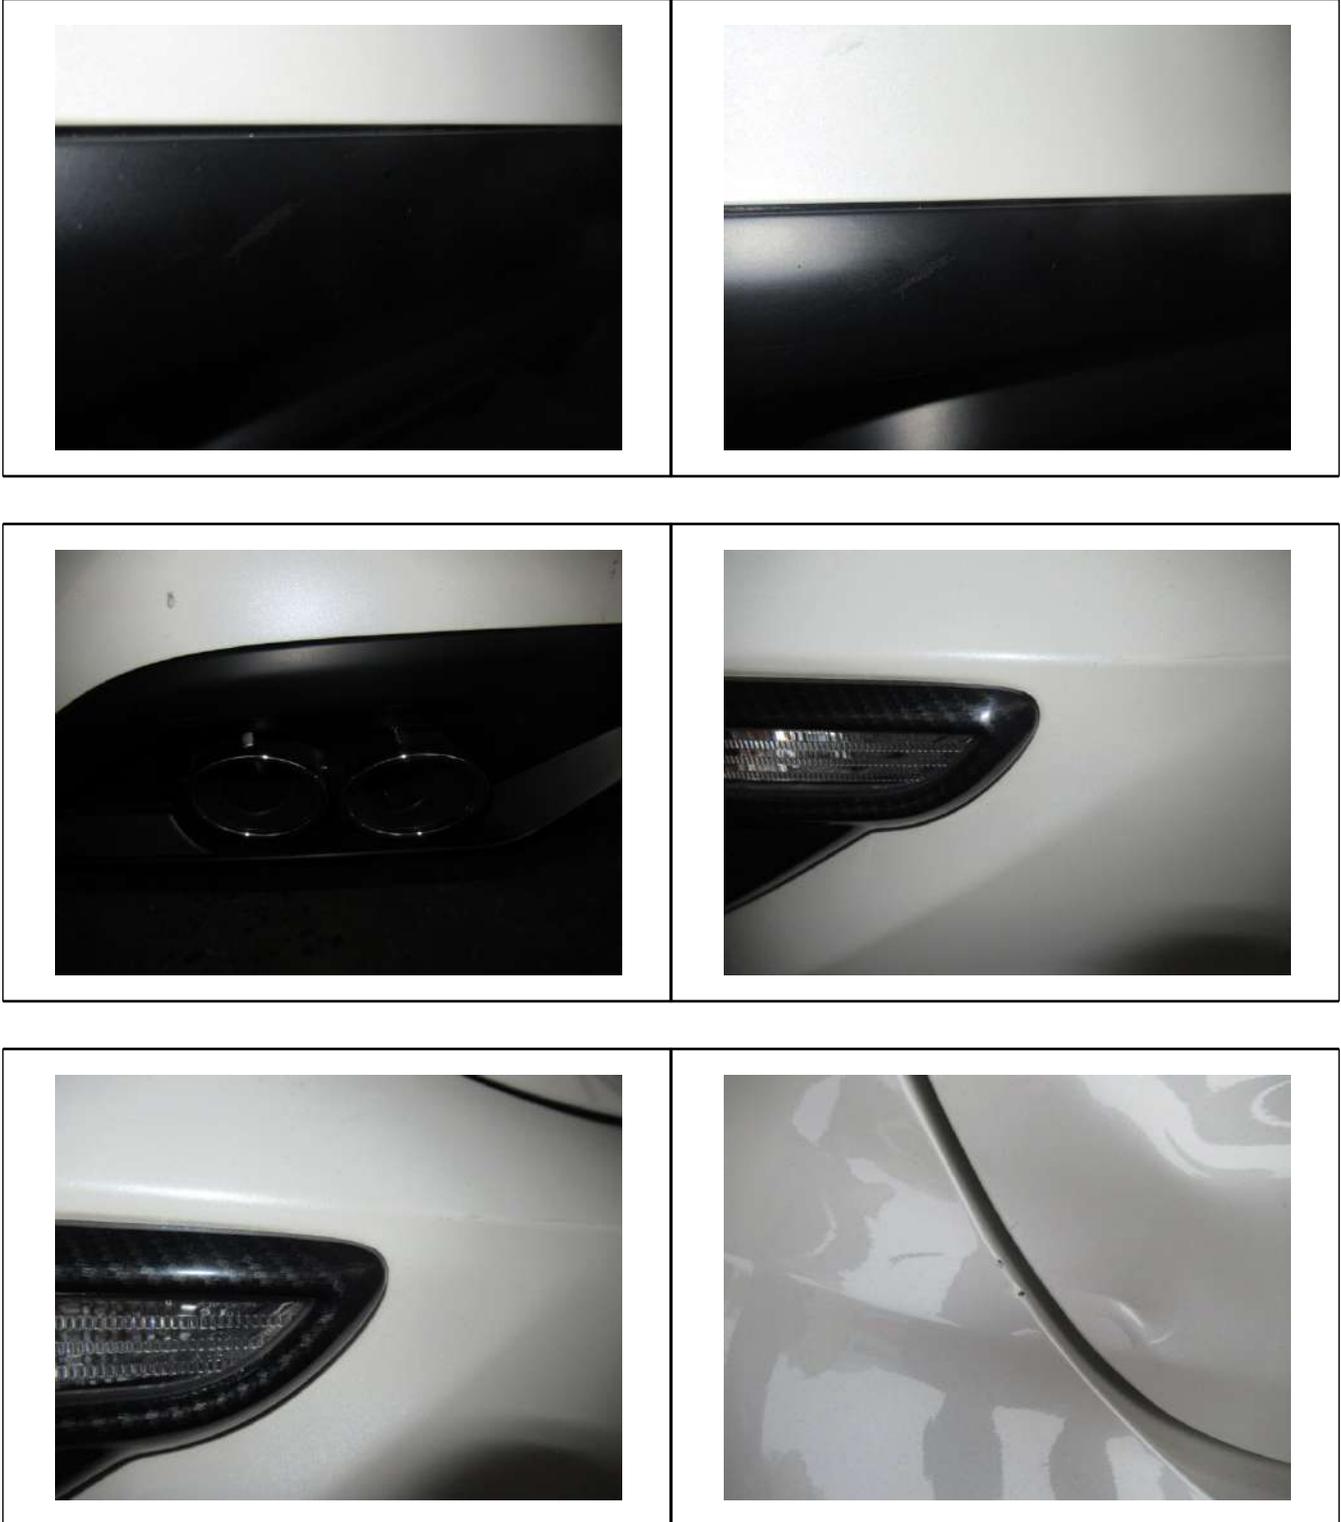



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

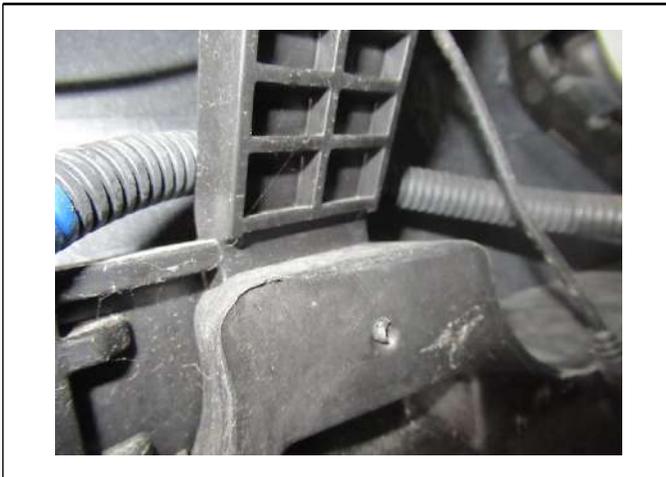



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SMM 8855A**

**RE-INSPECTION**

