

ASS. REC. BY:

Tang JH

REF:

CS/A1621008862/T1v83

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD ☒ TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

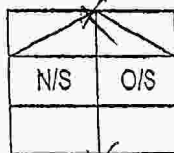
Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

454K.

IDAC Accident Report _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

WP'

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No:

SLD8439C

Yr Regn:

2016, June

Type: M ☒ Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make:

Mazda 3

c.c

1496

Colour

Red

A/C: Insured / Std / NI / NA

Sp. Reading

127313

T/Radio: Insured / Std / NI / NA

Eng/No: _____

G/No: _____

JM6BM42A-8 G0342439

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or _____

Brake: In order / Jammed / Leaked / Burnt or _____

Modl: Nil / S/Rim / STD A/Rim or _____

Tyre Size:

F:

215/60R16

R:

n

BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. _____ 6 mm

R/Bal. _____ 6 mm

L/Bal. _____ 6 mm

L/Bal. _____ 6 mm

D.O.A. _____

D.O.I.

24/8/21

Survey held at

TSL Auto.

Des. of Damages: ☒ Frt / ☒ Rear / O/S / N/S / U/C / Rooftop or _____

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee:

☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

: Tech. Invs (\$ _____)

Photos

Others

Rep. Format: _____

Lump Sum / L&M %

TSL AUTO GARAGE

QUOTATION/ESTIMATE

RE: REPAIR VEHICLE ON MAZDA 3

VEHICLE NO : SLD8439C

DATE : 24/08/2021

PARTS DESCRIPTION

LIST ITEMS

QTY UNTIL PRICE AMOUNT

1 REAR BUMPER	917	1	\$1,023.90	\$1,023.90 de ✓
2 REAR BUMPER REINFORCEMENT	574	1	\$796.70	\$796.70 bt ✓
3 REAR BUMPER SIDE RETAINER		2	\$79.80	\$159.60 RH X LH crn ✓
4 REAR BUMPER REFLECTOR		2	\$154.30	\$308.60 RH X LH crn ✓
5 REAR BUMPER CENTER BRACKET		1	\$19.80	\$19.80 rec ✓
6 REAR BUMPER TOW COVER		1	\$58.30	\$58.30 ent ✓
7 REAR BUMPER REVERSE SENSOR	400	2	\$290.80	\$581.60 nw ✓
8 REAR BUMPER REVERSE SENSOR WIRE HARNESS		1	\$170.60	\$170.60 x nn ✓
9 REAR BOOTLID		1	\$1,499.40	\$1,499.40 Rx ✓
10 REAR BOOTLID LAMP	499	2	\$565.40	\$1,130.80 RH X LH crn ✓
11 REAR BOOTLID EMBLEM LOGO		1	\$108.90	\$108.90 rec ✓
12 REAR BOOTLID EMBLEM MAZDA 3		1	\$94.70	\$94.70 rec ✓
13 REAR BOOTLID EMBLEM SKYACTIVE		1	\$87.50	\$87.50 rec ✓
14 REAR BOOTLID LOCK		1	\$280.40	\$280.40 x nn ✓
15 REAR WEATHER STRIPE		1	\$172.80	\$172.80 ent ✓
16 REAR BOOTLID LOCK DETECTOR		1	\$314.80	\$314.80 x nn ✓
17 REAR TAILLAMP	790.60	2	\$1,040.40	\$2,080.80 RH X LH crn ✓
18 REAR END PANEL	557	1	\$676.30	\$676.30 bt ✓
19 REAR END PANEL TOP GARNISH		1	\$180.30	\$180.30 de ✓
20 FRONT BUMPER	866.80	1	\$1,264.10	\$1,264.10 de ✓
21 FRONT BUMPER REINFORCEMENT	459.20	1	\$750.10	\$750.10 bt ✓
22 FRONT BUMPER LOWER GRILLE		1	\$308.50	\$308.50 x nn ✓
23 FRONT BUMPER TOW COVER		1	\$45.60	\$45.60 x nn ✓
24 FRONT BUMPER SPONGE garnish		1	\$285.60	\$285.60 de ✓
25 FRONT BUMPER SIDE RETAINER		2	\$66.50	\$133.00 new ✓
26 FRONT BUMPER LOWER COVER		1	\$189.20	\$189.20 X } x nn ✓
27 FRONT BUMPER FOG LAMP		2	\$321.10	\$642.20 x }
28 FRONT BUMPER FOG LAMP OUTER COVER		2	\$277.80	\$555.60 x }
29 FRONT GRILLE	874	1	\$970.10	\$970.10 crn ✓
30 FRONT GRILLE UPPER MOULDING		1	\$483.30	\$483.30 de ✓
31 FRONT GRILLE CHROME MOULDING		1	\$276.40	\$276.40 crn ✓
32 FRONT GRILLE LOGO		1	\$104.90	\$104.90 new ✓
33 FRONT GRILLE TOP GARNISH		1	\$320.50	\$320.50 de ✓
34 FRONT GRILLE TOP BARCKET		1	\$89.10	\$89.10 crn ✓
35 BONNET		1	\$1,458.40	\$1,458.40 x nn ✓
36 BONNET RUBBER SEAL		2	\$31.90	\$63.80 x nn ✓
37 BONNET LOCK		1	\$208.60	\$208.60 x nn ✓
38 FRONT SUPPORT PANEL		1	\$885.90	\$885.90 x nn ✓

Written by
TO THOMSON
SINGAPORE 3078
0500

39 FRONT SUPPORT PANEL TIE BAR

SLD8439C

- 40 FRONT SUPPORT PANEL SIDE GUIDE
- 41 FRONT SUPPORT PANEL UPPER GARNISH
- 42 FRONT SUPPORT PANEL LOWER GARNISH
- 43 FRONT HEADLAMP
- 44 FRONT HEADLAMP LOWER BRACKET

1	\$287.50	\$287.50 X un
2	\$135.30	\$270.60 X 7 un
1	\$68.10	\$68.10 X 7 un
1	\$51.10	\$51.10 X 7 un
812 LH X 2	\$1,623.30	\$3,246.60 RH Crs
LH X 2	\$87.10	\$174.20 RH rec

TOTAL: 9331.60 \$18,206.10 \$22,879.80
 LESS 20%: 7465.28 \$3,641.22 \$4,575.96
 TOTAL: \$14,564.88 \$18,303.84

S/NETT ITEMS

- 1 REAR BUMPER CLIPS
- 2 REAR END PANEL TOP GARNISH CLIPS
- 3 REAR END PANEL SEALANT
- 4 FRONT BUMPER CLIPS
- 5 FRONT NUMBER PLATE WITH CASING
- 6 FRONT GRILLE CLIPS

1	\$80.00	\$80.00 30nc
1	\$60.00	\$60.00 20nc
1	\$80.00	\$80.00 X un
1	\$80.00	\$80.00 30nc
1	\$60.00	\$60.00 X un
1	\$50.00	\$50.00 20nc
TOTAL: 100	\$410.00	\$410.00

TOTAL SPARE PARTS: \$14,974.88 \$18,713.84

LABOUR DESCRIPTION

- 1 LABOUR FOR PANEL BEATING
- 2 LABOUR FOR SPRAYPAINTING
- 3 TO RUST PROOF / TUFF COAT ON REAR ACCIDENT AREAS
- 4 LABOUR FOR REMOVE & REFIX AIR CON CONDENSER TO FACILITATE THE REPAIR TOP UP & VACCUM AIR CON GAS
- 5 WIRING CHECK
- 6 LABOUR FOR REMOVE & TRANSFER REAR BOOTLID FITTING
- 7 LABOUR FOR REMOVE & REFIX RADIATOR TO FACILITATE THE REPAIR

AMOUNT
 \$1,800.00 1000
 \$1,800.00 1000
 \$300.00 40
 \$200.00 X un
 \$100.00 30nc
 \$250.00 X un
 \$150.00 X un

TOTAL LABOUR: \$4,400.00

TOTAL PARTS AND LABOUR: \$23,113.84

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

7465.28
 100
 2070
 9635.28
 45\$ 7700
 8 days

Tanpku
 97195749.
 24/8/21 0330pm
 4/5 Resurvey after repair
 0 Bokeys