

ASS. REC. BY: Steve


CS/CTI21008926/Eqc

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD/TP/WS/TPRES/OD-RES/EVA/INV/MV
To Inspect Vehicle No: _____
at Workshop m/s _____
at _____
Insured: _____
Policy No. _____
Claims No. SNM21D204669/C01
Sum Insured: _____ Excess: 1300
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

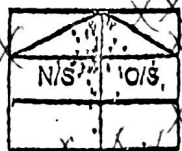

Est. or Market Value: 57K
IDAC Accident Report _____ Consistent? : Yes or No
GIA / PR Seen _____ Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Cum Sum: _____ % 3 Vol.: Yes or No
CA / REV / REP. / 24 HRS
Date: _____ Person Contacted: _____ Vehicle: IN/OUT

Veh No: SCA 16P Yr Regn: 11/18/17
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
Make: NISSAN Sylphy C.O. 1598
Colour: White A/O: Insured / Std / NI / N
Sp. Reading: 100972 TIRadio: Insured / Std / NI / N
Eng/No: _____
C/No: MINI BBA 317203026
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Locked / Burnt or
Brake: In order / Jammed / Locked / Burnt or
Mod: Nil / S/Rim / STD A/Rim or
Tyre Size: F: 205/55R16
R: 11
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or
Front _____ Rear _____
R/Bal. 5 mm R/Bal. 5 mm
L/Bal. 5 mm L/Bal. 5 mm
D.O.A. 28/8/21 O.O.I. 25/8/21
Survey held at Goldhill
Des. of Damages: Frnt / Rear / O/S / N/S / U/C / Roof or
The U/C / Chassis frame / Body Structure affected due to collision

Date/Time	Action/Instruction
	26/08/21@12.16pm revert to Alfred Tph via Merimen.
	03/09/21@3.23pm Ramesh informed that they willing to undertake
	COR at \$18662 by email.
	07/09/21@4.29pm So chow informed C/A at \$18662 via Merimen.
	07/09/21@2.27pm Informed Ramesh C/A not more than \$18662 or
	whichever lower & ex-\$1300 by email.
25/10/21	Submit Uneconomical Total Loss report. as the owner accepted insurance's offer.

Date/Time, File, Pass to: ☐ : Prel. Report25/10 Typist ☐ : Final Report

Date/Time, File, Pass to:

Approved: MER-OD/TL-E

Date/Time, File, Pass to:

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Inve (\$ _____)☐ : Wash/wind (\$ _____)

Survey Fee:

Transportation

\$ _____

Fringe

Quota

TOTAL

Goldbell Engineering Pte Ltd
8 Tuas Ave 18, Singapore
638892

Insurer Reference: SCA16P
Repairer Reference: SCA16P
Date calculated: 24/08/2021 4:15 PM

Full Report
Registration: SCA16P
Printed: 24/08/2021 4:15 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Catherine Chong Kai Ling	Currency:	SGD
Claim Reference:	SCA16P	Date of Incident:	23/08/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	NISSAN		
Model:	SYLPHY (B17T)		
Sub Model:	BASE MODEL		
Model Sheet Number:	71 PT 01		
Registration:	SCA16P		
VIN number:			
Odometer:	100972		
Model Specs			
AIR CONDITIONING	FOG LAMPS	RR PARK DIST CONTROL	1.6 LTR 85 KW
TWO COAT METALLIC	PREPARE OFF VEHICLE		

Steve (LKK)
25/8/21, 12:33pm

00-AL AL
EXAM - ?
L/S
My AL sy
25 dys

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

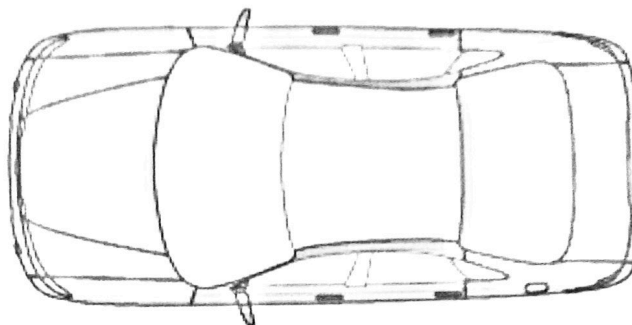

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	JOB ALLOWANCE		5.0	21.00
7639A1)	R + R REAR AXLE BODY INCLUDES: R + R WHEELS AND BRAKE DRUMS, DETACH + REFIT SPRING STRUTS AND HAND BRAKE CABLE, ADJUST HAND BRAKE		17.0	71.40
7639A1)	RENEW REAR AXLE BODY (REMOVED) INCLUDES: R + R REAR AXLE BODY, RENEW ATTACHED PARTS IF NECESSARY		13.0	54.60
UE63A1)	R + R FRONT UPPER PANEL		5.0	21.00
UE11A1	RENEW BOTH FRONT WINGS INCLUDES: BOTH FRONT WINGS, BOTH HEADLAMP, BUMPER AND R + R ATTACHED PARTS WING		16.0	67.20
UA10A1)	ADJUST HEADLAMPS RENEW FRONT BUMPER (REMOVED) INCLUDES: R + R/RENEW ATTACHED PARTS		3.0	12.60

Code	Description	WU	Price SGD
RE21A1)	RENEW HEADLAMPS (REMOVED)	1.0	4.20
UE30A1	R + R BONNET INSULATION	2.0	8.40
VB10A1)	R + R L/R DOOR SILL COVER	1.0	4.20
VB10A1)	R + R R/R DOOR SILL COVER	1.0	4.20
UJ10E1	R + R L/OUTSIDE MIRROR	2.0	8.40
UH28A1)	INCLUDES: R + R FRONT DOOR TRIM R + R LEFT FRONT OUTER DOOR HANDLE (DOOR TRIM REMOVED)	3.0	12.60
UJ10E1	R + R R/OUTSIDE MIRROR	2.0	8.40
UH28A1)	INCLUDES: R + R FRONT DOOR TRIM R + R RIGHT FRONT OUTER DOOR HANDLE (DOOR TRIM REMOVED)	3.0	12.60
UH16A1	R + R R/F OUTER WINDOW CHANNEL MOULDING	2.0	8.40
UK10A1	RENEW RIGHT REAR DOOR INCLUDES: R + R DOOR, CONVERT ALL ATTACHED PARTS, ADJUST DOOR, APPLY RUST PROOFING WAX	15.0	63.00
UT20A1	R + R RIGHT ROOF MOULDING	2.0	8.40
NO NUMBER	RENEW R/R SIDE PANEL AND END PANEL INCLUDES: R + R REAR SEAT, SEAL, TAIL LAMPS, REAR BUMPER AND ALL TRIMS IN THE REPAIR SECTION	90.0	378.00
8004A1)	R + R R/R QTR GLASS	7.0	29.40
UC10A1)	RENEW REAR BUMPER (REMOVED)	2.0	8.40
NO NUMBER	R + R L/R PARKING SYSTEM SENSOR	1.0	4.20
NO NUMBER	R + R REAR CENTRE PARKING AID SENSOR	1.0	4.20
NO NUMBER	R + R R/R PARKING SYSTEM SENSOR	1.0	4.20
FB40A1	R + R FUEL FLAP	2.0	8.40
UM10A1	RENEW BOOTLID INCLUDES: LOAD COMP COVER, BOTH INNER TAILLAMPS AND REQUIRED ATTACHED PARTS R + R	20.0	84.00
UM12A1)	R + R BOOT LID BOTH HINGES	5.0	21.00
8002A1)	R + R REAR WINDOW INCLUDES: R + R ADDITIONAL BRAKE LAMP	20.0	84.00
CD10A2)	R + R RADIATOR INCLUDES: R + R RADIATOR SHROUD, DRAIN + REFILL COOLANT	3.0	12.60
DA10A2	R + R AIR FILTER AND ELEMENT (ADD/WORK)	4.0	16.80
AW56A2	R + R R/ENGINE MOUNTING	3.0	12.60
7524A1)	R + R CONDENSER	2.0	8.40
7404B1)	EXCHANGE STEERING BOX (REMOVED)	6.0	25.20
PW10A1)	R + R L/F TYRE (WHEEL REMOVED)	2.0	8.40
PW10A1)	R + R R/F TYRE (WHEEL REMOVED)	2.0	8.40
7204A1)	R + R L/F CONTROL ARM	2.0	8.40
7204A1)	R + R R/F STEERING KNUCKLE	2.0	8.40
7205A1)	R + R FRONT STEERING KNUCKLE ASS WORK	11.0	46.20
7202A1)	R + R L/F STRUT	1.0	4.20
7202A1)	R + R R/F STRUT	1.0	4.20
7202A1)	DISS/ASS L/F SUSPENSION STRUT REMOVED	1.0	4.20
7202A1)	DISS/ASS R/F SUSPENSION STRUT	1.0	4.20
7203A1)	DIS + ASS L/F AND R/F SPRING STRUT (REM)	12.0	50.40
7225A1)	R + R LEFT FRONT DRIVE SHAFT	3.0	12.60
7226A1)	R + R RIGHT FRONT DRIVE SHAFT	3.0	12.60
7227A1)	DETACH + REFIT FRONT DRIVE SHAFTS	13.0	54.60

Code	Description	WU	Price SGD
7224A1	RENEW FRONT AXLE BEAM INCLUDES: STEERING GEAR, FRT STABILISER AND REQUIRED ATTACHED PARTS R + R ALIGN + ADJUST FRONT	25.0	105.00
WD64A1)	BLEED REAR BRAKE SYSTEM	3.0	12.60
PW10A1)	R + R L/R TYRE (WHEEL REMOVED)	2.0	8.40
PW10A1)	R + R R/R TYRE (WHEEL REMOVED)	2.0	8.40
PW10A1)	R + R TYRE/S AND/OR WHEEL/S	2.0	8.40
PW10A1)	FIT + BALANCE TYRE (SPARE WHEEL)	3.0	12.60
752811	DRAIN/REFILL AIR CONDITIONING	6.0	25.20
NN	REAR R&R / NEW PARTS	50.0*	210.00
0471	BONNET REPAIR <i>paint only</i>	20.0*	84.00
1481	LEFT FRONT DOOR REPAIR	5.0*	21.00
1482	RIGHT FRONT DOOR REPAIR	5.0*	21.00
1781	L/R DOOR REPAIR	10.0*	42.00
3481	L/R SIDE PANEL CPL REPAIR	30.0*	126.00
1005	WHEELHOUSE R/F	40.0*	168.00
1008	R/R OUTER WHEELHOUSE 4162	40.0*	168.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		55.70	557.0
Total of Labour			2,339.40

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	4.0
	L/F WING NEW PART PAINTING	10.0
	R/F WING NEW PART PAINTING	10.0
	R/R DOOR NEW PART PAINTING	15.0
	REAR PANEL NEW PART PAINTING	21.0
	BOOTLID NEW PART PAINTING	13.0
	R/R SIDE PANEL CPL NEW PART PAINTING	29.0
	FRONT BUMPER NEW PART PAINT K1G/P	32.0
	R/R DOOR OUT HANDLE NEW PART PAINT K1G/P	4.0
	R/R HANDLE TRIM NEW PART PAINT K1G/P	4.0
	REAR BUMPER NEW PART PAINT K1G/P	24.0
	RR CTR PARK SYS SENS NEW PART PAINT K1G/P	4.0
	BONNET REPAIR PAINTING >50%	25.0
	LEFT FRONT DOOR REPAIR PAINTING >50%	27.0
	RIGHT FRONT DOOR REPAIR PAINTING >50%	27.0
	L/R DOOR REPAIR PAINTING >50%	23.0
	L/R SIDE PANEL CPL REPAIR PAINTING >50%	23.0
	R/F WHEELHOUSE	20.0*

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	4.23
0741	L/F WING NEW PART PAINTING	21.67
0742	R/F WING NEW PART PAINTING	21.67
1782	R/R DOOR NEW PART PAINTING	40.25

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	25.85
2931	BOOTLID NEW PART PAINTING	32.51
3482	R/R SIDE PANEL CPL NEW PART PAINTING	40.70
0281	FRONT BUMPER NEW PART PAINT K1G/P	129.60
1866	R/R DOOR OUT HANDLE NEW PART PAINT K1G/P	1.80
1868	R/R HANDLE TRIM NEW PART PAINT K1G/P	1.80
2581	REAR BUMPER NEW PART PAINT K1G/P	93.60
2683	RR CTR PARK SYS SENS NEW PART PAINT K1G/P	0.90
0471	BONNET REPAIR PAINTING >50%	33.58
1481	LEFT FRONT DOOR REPAIR PAINTING >50%	38.71
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	38.71
1781	L/R DOOR REPAIR PAINTING >50%	30.81
3481	L/R SIDE PANEL CPL REPAIR PAINTING >50%	29.23

Labour Cost - Paint

	42.00 SGD/h	Hrs	WU	Price SGD
Factor				
Time Paint			315.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	34.80	348.0	1,461.60

Material Cost - Paint

	Price SGD
New Part Painting	182.65
New Part Painting - Plastic K1G/PUR	227.70
Repair Painting	171.04
Surface-/Blend Paint	4.23
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	626.92

Spare Parts

prices as at 2015-06-01/01					Price SGD
Code	Description	Part Number	Part Source		
0281	FRONT BUMPER	62022 3ST1H	Original	✓	300.00
0295	FRT BUMPER ABSORBER	62090 3ST0A	Original	✓	144.00
0317	L/F BUMPER BRACKET	62225 3ST1A	Original	✓	30.00
0318	R/F BUMPER BRACKET	62224 3ST1A	Original	✓	30.00
0340	FRT BUMPER SUPPORT	F2032 3STMH	Original	✓	276.00
0565	LEFT HEADLAMP ASSY	26075 3SB1A	Original	✓	420.00
0566	RIGHT HEADLAMP ASSY	26025 3SB1A	Original	✓	420.00
0637	L/F FOG LAMP	26155 8994A	Original	✓	216.00
0638	R/F FOG LAMP	26150 8994A	Original	✓	216.00
0651	L/FOG LAMP COVER	62257 3RA0A	Original	✓	78.00
0652	R/FOG LAMP COVER	62256 3RA0A	Original	✓	78.00
0741	L/F WING	F3101 3SBMB	Original	✓	336.00
0742	R/F WING	F3100 3SBMB	Original	✓	336.00
0841	L/F WHEELHOUSE COVER	63843 3SU0A	Original	✓	0.00

Code
0842

1662

1782

1832

1866

1868

1878

1924

1926

2581

2619

2620

2625

2626

2683

2703

2711

2931

2944

2953

2954

2981

2987

2997

2998

3015

3016

3017

3018

3151

3160

3161

3291

3292

3295

3296

3307

3308

3359

3360

3482

3679

3680

3783

3862

4080

4465

4907

4972

4978

4982

4985

7011

7035

Description

Part Number

Part Source

Price SGD

R/F WHEELHOUSE
COVER

63842 3SU0A

Original

TAI

0.00

R/F OUT WINDOW SEAL

80820 3SB0A

Original

CUT

102.00

R/R DOOR

H210M 3SBMA

Original

DO

780.00

R/R QUARTER GLASS

83300 3SB1A

X

?

0.00

R/R DOOR OUT HANDLE

80640 JN00A

Original

?

186.00

R/R HANDLE TRIM

80646 JN00A

Original

?

57.60

R/R DOOR LOCK

82500 3SB0A

Original

BT

192.00

R/R OUT WINDOW GSKT

82820 3SB0A

Original

CUT

102.00

R/R UPP DR FRM MLDG

82818 3SB0A

Original

APC

36.00

REAR BUMPER

85022 3ST6H

Original

MIS

336.00

L/R INN BUMPER BRKT

85227 3ST1A

Original

BR

36.00

R/R INN BUMPER BRKT

85226 3ST1A

Original

BR

36.00

L/R BUMP IMPACT DAMP

85093 3ST0A

Original

X APC

42.00

R/R BUMP IMPACT DAMP

85092 3ST0A

Original

MIS

42.00

RR CTR PARK SYS SENS

25994 3SJ0B

Original

MIS

120.00

REAR NO PLATE REINF

KNPL0

Original

BR

30.00

REAR PANEL

G9110 3SBMA

Original

DO

300.00

BOOTLID

H430M 3SMMA

Original

DO

600.00

BOOTLID SEAL

84830 3SB3J

Original

CR4

72.00

L/BOOT HINGE

H4400 3RAMA

Original

BT

66.00

R/BOOT COMPART

H4400 3RAMA

Original

BT

66.00

HINGE

BOOT LOCK CYLINDER

H4660 85F25

Original

BT

72.00

BOOT LID MOULDING

84810 3ST0A

Original

BR

144.00

L/BOOTLID SPRING

H4433 3RAMA

Original

?

0.00

R/BOOTLID SPRING

H4432 3RAMA

Original

?

0.00

REAR BADGE

84890 3RA0A

Original

APC

45.60

BADGE MODEL

84890 3RA1A

Original

APC

66.00

VERSION BADGE

84895 3SH7A

X

?

0.00

EQUIPMENT BADGE

90892 BG00A

X

?

0.00

REAR SCREEN

79700 3SB0A

Original

?

384.00

REAR SCREEN BOND KIT

G2891 89925

Original

APC

0.00

REAR SCREEN SEAL

G2716 89900

Original

APC

0.00

L/R OUTER LAMP

26559 3SB0A

Original

BR

150.00

R/R OUTER LAMP

26554 3SB0A

Original

BR

180.00

L/R INNER LAMP

26559 3SB3A

Original

CUT

120.00

R/R INNER LAMP

26554 3SB3A

Original

BR

120.00

L/R BUMPER REFLECTOR

26565 5C000

Original

MIS

42.00

R/R BUMPER REFLECTOR

26560 5C000

Original

MIS

42.00

L/NUMBER PLATE LAMP

26510 9Y00A

Original

BR

66.00

R/NUMBER PLATE LAMP

26510 9Y00A

Original

DO

780.00

R/R SIDE PANEL CPL

G8100 3RAMA

Original

X

38.40

L/BUMP CLOSING PART

78819 3SB0A

Original

TAI

38.40

R/BUMP CLOSING PART

78818 3SB0A

Original

BR

0.00

REAR AIR GRILLE

76805 2DR0A

Original

X

0.00

R/QTR WDW BOND KIT

KNGKWI1

Original

BT

66.00

FUEL FILLER FLAP

78830 3RA0A

Original

?

780.00

CONDENSER

92100 3ST0A

Original

CR4

264.00

BOOTLID TRIM

84966 3SB0A

Original

CR4

66.00

R/UPP C-PILLAR TRIM

76934 3SB0A

Original

Code	Description	Part Number	Part Source	Price SGD
7036	R/DRIVE SHAFT CPL	39100 3RA1B	Original	1,020.00
7053	L/F TRACK CONT ARM	54501 3ST0A	Original	180.00
7054	R/F TRACK CONT ARM	54500 3ST0A	Original	180.00
7077	L/F STRUT	E4303 3ST0A	Original	336.00
7078	R/F STRUT	E4302 3ST0A	Original	336.00
7081	L/F STEERING KNUCKLE	40015 1KA1A	Original	480.00
7082	R/F STEERING KNUCKLE	40014 1KA1A	Original	480.00
7095	L/UPP SPRING SEAT	54321 1KA0B	Original	78.00
7096	R/UPP SPRING SEAT	54320 1KA0B	Original	78.00
7131	L/F WHEEL HUB	40202 3RA0B	Original	336.00
7141	L/F BRAKE DISC	40206 3ST0A	Original	192.00
7142	R/F BRAKE DISC	40206 3ST0A	Original	192.00
7201	L/FR WHEEL	40300 3RA0C	Original	420.00
7202	R/FR WHEEL	40300 3RA0C	Original	420.00
7227	L/FR TYRE	195/65 R 15 .. H	Original	180.00
7228	R/FR TYRE	195/65 R 15 .. H	Original	180.00
7261	FRONT STABILISER	54611 3ST0A	Original	216.00
7267	L/F STABILISER BUSH	54613 3RA0C	Original	15.60
7268	R/F STABILISER BUSH	54613 3RA0C	Original	15.60
7273	L/LOWER TOWING STRUT	54618 CY00A	Original	42.00
7274	R/LOWER TOWING STRUT	54618 CY00A	Original	42.00
7300	STEERING GEAR ASSY	48001 3RH1A	Original	1,380.00
7761	RADIATOR	21410 3ST0B	Original	576.00
8391	AIR FILTER ASSY	16500 3RA0C	Original	650.00
8665	ENG SUPPORT BRACKET	11210 1KA1A	Original	504.00
9081	REAR AXLE HOUSING	55501 3ST0B	Original	1,140.00
9181	L/R WHEEL HUB	43202 3RA0B	Original	336.00
9182	R/R WHEEL HUB	43202 3RA0B	Original	336.00
9201	L/RR SHOCK ABSORBER	E6210 3ST0A	Original	156.00
9202	R/RR SHOCK ABSORBER	E6210 3ST0A	Original	156.00
9551	L/RR WHEEL	40300 3RA0C	Original	420.00
9552	R/RR WHEEL	40300 3RA0C	Original	420.00
9565	L/RR TYRE	195/65 R 15 .. H	Original	180.00
9566	R/RR TYRE	195/65 R 15 .. H	Original	180.00
9986	AIR CON COOLANT	NO NUMBER	Original	50.00
9987	COOLANT/ANTIFREEZE	NO NUMBER	Original	50.00
1001	LOWER CHROME STRIP	BOOT LID	Original	102.00
1002	REAR	BOOT FLOOR	Original	384.00
1003	R/LUG G45323STMA	4178 RR PNL	Original	90.00
1004	G66303SBMA CPILAR IN	4182	Original	840.00
		(Fender inner RH side)		0.00
f: OEM Parts	Savings			
n: Non-OEM Parts	Subtotal			24,847.20
u: Used parts	Total			24,847.20

Extras

Code	Description	Price SGD
1000	REAR GLASS sealant	50.00*
1007	QUARTER GLASS RH sealant	50.00*
1009	WHEEL ALIGNMENT	160.00*
	Total Extras	260.00

Code	Description	Price SGD	
Final Calculation			
		SGD	SGD
Parts		24,847.20	
Total Parts			24,847.20
Labour Time Base 10 WU/h			
Total 557.0 WU X 42.00 SGD/h		2,339.40	
Total of Labour			2,339.40
Total Of Extras			260.00
Paint Work Time Base 10 WU/h			
Labour Cost 348.0 WU X 42.00 SGD/h		1,461.60	
Material Cost		626.92	
Total Paint Including Material			2,088.52
Repair Cost Excludes GST			29,535.12
GST (+7.0%)			2,067.46
Repair Cost Included GST			31,602.58

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.