



## Advanced Automotive Consultancy Pte Ltd

159, Yishun St 11, #04-106, S760159  
Business Regn No : 201416413W  
Tel/ Fax no: 67568321

### Tax Invoice

YAP YAW XIANG

Invoice No. : AAC 20 SEPT 05

c/o EQUATOR BROTHERHOOD  
Blk 25, Kaki Bukit Rd 4 Synergy@KB, #03-79  
Singapore 417800

Invoice Date : 2-Sep-2020

Terms : 30 Days

Ref No. : TP-FBR1660UEB/0520/05

Vehicle No. : FBR1660U

Date of Accident : 30-Apr-2020


Date of Survey : 13-May-2020

| Description                                                                          | Amount           |
|--------------------------------------------------------------------------------------|------------------|
| (1) Survey Of Vehicle<br>- A set of survey report<br>- Correspondence & Consultation | SGD \$300.00     |
| (2) Transportation Charges including resurvey                                        | SGD \$150.00     |
| (3) Attached Photographs (128 pcs)                                                   | SGD \$128.00     |
| <br>Total                                                                            | <br>SGD \$578.00 |
| <br>GRAND TOTAL                                                                      | <br>SGD \$578.00 |

E. & O.E.

Cheque should be crossed and made payment to "Advanced Automotive Consultancy Pte Ltd"



  
Authorised By



## **Advanced Automotive Consultancy Pte Ltd**

Business Regn No: 201416413W

### **ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT**

|                                                                                                                                                                  |   |                                                                                       |                          |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------|---|---------------------------------------------------------------------------------------|--------------------------|
| <b>1 REFERENCE</b>                                                                                                                                               |   |                                                                                       |                          |
| Our reference no                                                                                                                                                 | : | TP/FBR1660U/EB/0520/08                                                                |                          |
| Date of request                                                                                                                                                  | : | 13-May-2020                                                                           |                          |
| Date of survey                                                                                                                                                   | : | 13-May-2020                                                                           |                          |
| Date of accident                                                                                                                                                 | : | 30-Apr-2020                                                                           |                          |
| Requested by                                                                                                                                                     | : | YAP YAW XIANG<br>C/o Blk 25 Kaki Bukit Rd 4 Synergy@KB, #03-79 Singapore 417800       |                          |
| Type of claim                                                                                                                                                    | : | Third party                                                                           |                          |
| Workshop                                                                                                                                                         | : | EQUATOR BROTHERHOOD<br>Blk 25, Kaki Bukit Rd 4 Synergy@KB, #03-79<br>Singapore 417800 |                          |
| <b>2 DETAILS OF VEHICLE</b>                                                                                                                                      |   |                                                                                       |                          |
| Registration No.                                                                                                                                                 | : | FBR1660U                                                                              |                          |
| Make & Model                                                                                                                                                     | : | AEROX GDR155A CVT ABS                                                                 |                          |
| Date of registration                                                                                                                                             | : | 7-Mar-2020                                                                            |                          |
| Engine No.                                                                                                                                                       | : | G3J8E0145083                                                                          |                          |
| Engine Capacity                                                                                                                                                  | : | 155CC                                                                                 |                          |
| Chassis No.                                                                                                                                                      | : | MH3SG4640LJ070587                                                                     |                          |
| Speedometer reading                                                                                                                                              | : | -                                                                                     |                          |
| Colour                                                                                                                                                           | : | BLACK                                                                                 |                          |
| <b>3 STATIC CHECK</b>                                                                                                                                            |   |                                                                                       |                          |
| Steering                                                                                                                                                         | : | In order                                                                              | Paintwork : Good         |
| Footbrake                                                                                                                                                        | : | In order                                                                              | Modification : Nil       |
| Handbrake                                                                                                                                                        | : | In order                                                                              | General condition : Good |
| <b>4 TYRE CONDITION</b>                                                                                                                                          |   |                                                                                       |                          |
|                                                                                                                                                                  |   | <u>Nearside/Make</u>                                                                  | <u>Size</u>              |
| Front tyre                                                                                                                                                       | : | 3mm/IRC                                                                               | 110/80-14                |
| Rear tyre                                                                                                                                                        | : | 3mm/IRC                                                                               | 140/70-14                |
| <b>5 POINT OF IMPACT</b>                                                                                                                                         |   |                                                                                       |                          |
| The said vehicle has sustained an impact damages on the front, right and right portion. Kindly refer to the attached photographs for more detail of the damages. |   |                                                                                       |                          |
| <b>6 REMARK</b>                                                                                                                                                  |   |                                                                                       |                          |
| This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.                                                     |   |                                                                                       |                          |

## Advanced Automotive Consultancy Pte Ltd

### Annex A : Assesement / Adjustment on Spare Parts

TP/FBR1660U/EB/0520/08

| Item              | Vehicle Parts Description                               | Condition                  | Qty | W/shop Est. (\$) | Disc (%) | Adjusted Cost (\$) |          |
|-------------------|---------------------------------------------------------|----------------------------|-----|------------------|----------|--------------------|----------|
| <b>List Items</b> |                                                         |                            |     |                  |          |                    |          |
| 1                 | Yamaha front suspension(left/right)                     | distorted/grazed           | 2   | \$600.00         | 10%      | \$540.00           | ✓        |
| 2                 | Yamaha under bracket                                    | distorted                  | 1   | \$200.00         | 10%      | \$180.00           | ✓        |
| 3                 | Yamaha steering bearing                                 | necessary                  | 1   | \$110.00         | 10%      | \$99.00            | ✓        |
| 4                 | Yamaha front rim                                        | wobble/warped              | 1   | \$280.00         | 10%      | \$252.00           | ✓        |
| 5                 | Yamaha front wheel shaft                                | dented/bent                | 1   | \$45.00          | 10%      | \$40.50            | ✓        |
| 6                 | Yamaha front wheel bearing                              | rattle                     | 2   | \$70.00          | 10%      | \$63.00            | ✓        |
| 7                 | Yamaha front wheel seal                                 | necessary                  | 2   | \$30.00          | 10%      | \$27.00            | ✓        |
| 8                 | Yamaha handle bar                                       | distorted                  | 1   | \$85.00          | 10%      | \$85.50            | ✓        |
| 9                 | Yamaha headlight                                        | broken                     | 1   | \$290.00         | 10%      | \$261.00           | ✓        |
| 10                | Yamaha windshield                                       | scratched                  | 1   | \$45.00          | 10%      | \$40.50            | ✓        |
| 11                | Yamaha front brake lever (right)                        | intact                     | 1   | \$35.00          | 100%     | \$0.00             | X SVC    |
| 12                | Yamaha front brake master cylinder (right)              | intact                     | 1   | \$120.00         | 100%     | \$0.00             | X SVC    |
| 13                | Yamaha rear brake lever (left)                          | grazed                     | 1   | \$35.00          | 10%      | \$31.50            | ✓        |
| 14                | Yamaha rear brake parking mechanism (left)              | repair                     | 1   | \$30.00          | 100%     | \$0.00             | X SVC    |
| 15                | Yamaha rear brake lever holder (left)                   | distorted/grazed           | 1   | \$45.00          | 10%      | \$40.50            | X SVC    |
| 16                | Yamaha front brake hose                                 | intact                     | 1   | \$85.00          | 100%     | \$0.00             | X SVC    |
| 17                | Yamaha front brake caliper                              | intact                     | 1   | \$180.00         | 100%     | \$0.00             | X SVC    |
| 18                | Yamaha front brake pad                                  | intact                     | 1   | \$35.00          | 100%     | \$0.00             | X SVC    |
| 19                | Yamaha front brake disc                                 | warped                     | 1   | \$110.00         | 10%      | \$99.00            | X SVC    |
| 20                | Yamaha horn                                             | intact                     | 1   | \$45.00          | 100%     | \$0.00             | X SVC    |
| 21                | Yamaha front signal light(left/right)                   | broken left/grazed right   | 2   | \$120.00         | 10%      | \$108.00           | ✓        |
| 22                | Yamaha mirrors (left/right)                             | bent/grazed                | 2   | \$70.00          | 10%      | \$63.00            | 22.50- ✓ |
| 23                | Yamaha signal light cover (left)                        | broken                     | 1   | \$50.00          | 10%      | \$45.00            | ✓        |
| 24                | Yamaha signal inner garnish (left/right)                | broken left/deformed right | 2   | \$130.00         | 10%      | \$117.00           | ✓        |
| 25                | Yamaha exhaust bracket                                  | repair                     | 1   | \$220.00         | 100%     | \$0.00             | X R      |
| 26                | Yamaha exhaust                                          | intact                     | 1   | \$420.00         | 100%     | \$0.00             | X SVC    |
| 27                | Yamaha exhaust cover                                    | grazed                     | 1   | \$60.00          | 10%      | \$54.00            | ✓        |
| 28                | Yamaha radiator                                         | intact                     | 1   | \$220.00         | 100%     | \$0.00             | X SVC    |
| 29                | Yamaha radiator cover                                   | grazed                     | 1   | \$50.00          | 10%      | \$45.00            | ✓        |
| 30                | Yamaha air box cover (top)                              | intact                     | 1   | \$50.00          | 100%     | \$0.00             | X SVC    |
| 31                | Yamaha CVT cover (lower)                                | grazed                     | 1   | \$80.00          | 10%      | \$72.00            | ✓        |
| 32                | Yamaha meter fairing outer (matte black)                | intact                     | 1   | \$40.00          | 100%     | \$0.00             | X SVC    |
| 33                | Yamaha meter fairing inner(colored)                     | cut/grazed                 | 1   | \$65.00          | 10%      | \$58.50            | ✓        |
| 34                | Yamaha front headcowl V-shaped fairing (colored)        | grazed/cracked             | 1   | \$55.00          | 10%      | \$49.50            | ✓        |
| 35                | Yamaha front side garnish-left/right (matte grey)       | grazed/shifted/distorted   | 2   | \$180.00         | 10%      | \$162.00           | ✓        |
| 36                | Yamaha front side fairing Z-shaped-left/right (colored) | grazed/cracked/broken      | 2   | \$220.00         | 10%      | \$198.00           | ✓        |

| Item                    | Vehicle Parts Description                                | Condition          | Qty | W/shop<br>Est. (\$) | Disc<br>(%) | Adjusted<br>Cost (\$) |       |
|-------------------------|----------------------------------------------------------|--------------------|-----|---------------------|-------------|-----------------------|-------|
| 37                      | Yamaha tail side fairing-left/right (colored)            | scratched          | 2   | \$150.00            | 10%         | \$135.00              | ✓     |
| 38                      | Yamaha center tail fairing (colored)                     | intact             | 1   | \$40.00             | 100%        | \$0.00                | X SVC |
| 39                      | Yamaha front mudguard (colored)                          | grazed             | 1   | \$95.00             | 10%         | \$85.50               | ✓     |
| 40                      | Yamaha front mudguard garnish (matte black)              | cracked/grazed     | 1   | \$65.00             | 10%         | \$58.50               | ✓     |
| 41                      | Yamaha step board-left/right (matte black)               | grazed/cut         | 2   | \$120.00            | 10%         | \$108.00              | ✓     |
| 42                      | Yamaha step board rubber (left/right)                    | dislodged/grazed   | 2   | \$130.00            | 10%         | \$117.00              | ✓     |
| 43                      | Yamaha step board side lower garnish-right (matte black) | grazed             | 1   | \$85.00             | 10%         | \$76.50               | ✓     |
| 44                      | Yamaha inner leg shield (matte black)                    | cracked            | 1   | \$80.00             | 10%         | \$72.00               | ✓     |
| 45                      | Yamaha footrest garnish (left)                           | grazed             | 1   | \$60.00             | 10%         | \$54.00               | ✓     |
| 46                      | Yamaha panel stay                                        | cracked            | 1   | \$50.00             | 10%         | \$45.00               | ✓     |
| 47                      | Yamaha pillion footrest (right)                          | grazed             | 1   | \$25.00             | 10%         | \$22.50               | ✓     |
| 48                      | Yamaha pillion footrest bracket (right)                  | distorted          | 1   | \$20.00             | 10%         | \$18.00               | X SVC |
| 49                      | Yamaha centre compartment                                | distorted/shifted  | 1   | \$20.00             | 10%         | \$18.00               | X SVC |
| 50                      | Yamaha compartment cover lid (left)                      | deformed/distorted | 1   | \$30.00             | 10%         | \$27.00               | X SVC |
| 51                      | Yamaha compartment outer side garnish (right/left)       | distorted/shifted  | 2   | \$160.00            | 10%         | \$144.00              | X SVC |
| 52                      | Yamaha middle side fairing-right (colored)               | grazed             | 1   | \$75.00             | 10%         | \$67.50               | X SVC |
| 53                      | YSS rear suspension                                      | distorted          | 1   | \$420.00            | 10%         | \$378.00              | X SVC |
| 54                      | Yamaha rear suspension bush                              | necessary          | 1   | \$40.00             | 10%         | \$36.00               | X SVC |
|                         |                                                          |                    |     | <u>\$6,180.00</u>   |             | <u>\$4,194.00</u>     |       |
| S/Nett Items            |                                                          |                    |     |                     |             |                       |       |
| 1                       | Motul coolant                                            | not necessary      | 1   | \$55.00             |             | \$0.00                | X SVC |
| 2                       | Playlife grip set                                        | cut                | 1   | \$35.00             |             | \$35.00               | ✓     |
| 3                       | Motul brake fluid                                        | intact             | 1   | \$15.00             |             | \$0.00                | X SVC |
| 4                       | GIVI box 46L                                             | grazed             | 1   | \$380.00            |             | \$380.00              | X SVC |
| 5                       | GIVI box base plate                                      | necessary          | 1   | \$110.00            |             | \$110.00              | X SVC |
| 6                       | GIVI box rack                                            | distorted          | 1   | \$85.00             |             | \$85.00               | X SVC |
| 7                       | Handphone holder                                         | intact             | 1   | \$60.00             |             | \$0.00                | X SVC |
| 8                       | IU unit                                                  | faulty             | 1   | \$175.00            |             | \$175.00              | X SVC |
| 9                       | IU bracket                                               | intact             | 1   | \$15.00             |             | \$0.00                | X SVC |
| 10                      | Front number plate                                       | bent               | 1   | \$15.00             |             | \$10.00               | ✓     |
|                         |                                                          |                    |     | <u>\$945.00</u>     |             | <u>\$795.00</u>       |       |
| Total for Spare Parts : |                                                          |                    |     | <u>\$7,125.00</u>   |             | <u>\$4,989.00</u>     |       |

Advanced Automotive Consultancy Pte Ltd

**Annex B : Adjustment on Labour and Spray Painting**

TP/FBR1860U/EB/0520/08

| Item                                | Job Description                                                                                                                               | Workshop<br>Est. (\$) | Adjusted<br>Cost (\$) |      |
|-------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------|-----------------------|-----------------------|------|
| 1                                   | To remove & replace front rim, front wheel bearing, axle shaft, tripple clamps, front fork, steering cone, front brake disc, rear suspension. | \$450.00              | \$300.00              | 100- |
| 2                                   | To remove & replace above body damaged parts, check wiring & lighting system                                                                  | \$650.00              | \$500.00              | 300- |
| 3                                   | To conduct chassis alignment                                                                                                                  | \$480.00              | \$350.00              | 100- |
| 4                                   | Towing -from traffic police compound to workshop                                                                                              | \$80.00               | \$50.00               | /    |
| 5                                   | Towing -workshop to accident reporting center                                                                                                 | \$80.00               | \$50.00               | X    |
| 6                                   | Towing -accident reporting center to workshop                                                                                                 | \$80.00               | \$50.00               | X    |
|                                     |                                                                                                                                               | \$1,820.00            | \$1,300.00            |      |
| TOTAL FOR LABOUR & SPRAY PAINTING : |                                                                                                                                               | \$1,820.00            | \$1,300.00            |      |

**Summary**

|                                     | Workshop<br>Est. (\$) | Adjusted<br>Cost (\$) |
|-------------------------------------|-----------------------|-----------------------|
| TOTAL FOR SPARE PARTS :             | \$7,125.00            | \$4,989.00            |
| TOTAL FOR LABOUR & SPRAY PAINTING : | \$1,820.00            | \$1,300.00            |
| TOTAL REPAIR COSTS :                | \$8,945.00            | \$6,289.00            |

5 repair days

**Advanced Automotive Consultancy Pte Ltd**

TP/FBR1660/WEB/0520/06

**Annex C: Recommendation**

We have inspected thoroughly the actual damages found on the vehicle and our assessment is appended in the Annex(es) attached. The condition and age of the vehicle was considered before we reached our recommendation as to whether the parts need replacement or repair.

M/S Equator Brotherhood estimated repair cost is S\$8,945.00 and we have adjusted it to S\$6,289.00 on a part by part basis. However, taking into consideration the age of the vehicle and the availability of used/recondition components. We, therefore recommend a contract lump sum repair cost.


The repairer have agreed to undertake the repairs on a contract lump sum of S\$5,650.00, according to acceptable quality and standard. (Repairer discretion to repair parts, to replace with old parts, or to replace with OEM or genuine parts)

The entire repair of the damaged vehicle should be completed within a reasonable period of 7 working days.

We have advised the repairer that the inspection was conducted strictly on a WITHOUT PREJUDICE basis and we have not given any instruction and authorisation to proceed with the repair of the vehicle.

We are reverting the matter to you for your discretion and enclosed is our invoice for service rendered.

Yours faithfully,

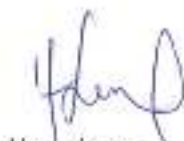


Henry Low -  
Automotive License Appraiser  
CMTM, DMTM, IPTM (UNF)









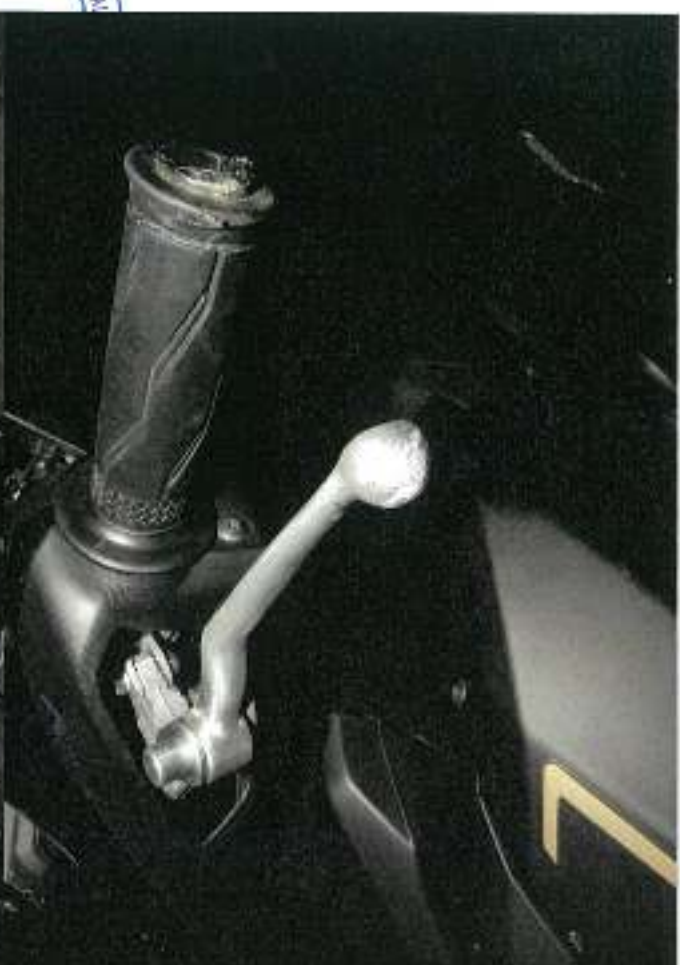

































FBR 1660 U



FBR 1660 U









FBR 1660 U



FBR 1660 U



FBR 1660 U





FBR 1660 U



FBR 1660 U



FBR 1660 U





FBR 1660 U



FBR 1660 U



FBR 1660 U



FBR 1660 U















