



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2200398

INV Date 18/01/2022

Reference CC4/LPC21009046/Apa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBH 4288U
Insured Veh. GBB 6764E
Claim No. 20/21/21/VC05/024884
Policy No. Z20VC05006251
Accident Date 24/08/2021
Inspection Date 26/08/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21009046/Apa3q2 Date: 18/01/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBB 6764E	Veh. Inspected	GBH 4288U	
Policy No.	Z20VC05006251	Coverage (\$)	0.00	
Claim No.	20/21/21/VC05/024884	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	25/08/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PROACE	c.c	1560	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	YARVBBHVBGZ103542	Colour	GREY	
Odometer	94932 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/65 R16C	MICHELIN	6 mm	
L/H Front Tyre	215/65 R16C	MICHELIN	6 mm	
R/H Rear Tyre	215/65 R16C	MICHELIN	6 mm	
L/H Rear Tyre	215/65 R16C	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	24/08/2021	Inspection Date	26/08/2021	
Survey held at	TAN LIM MOTOR PTE LTD NO.1 DEFU LANE 6 SINGAPORE 539365			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBH 4288U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	850.00	850.00
1	O/S REAR BUMPER REFLECTOR	NOT NECESSARY	150.00	-
1	REAR BUMPER REINFORCEMENT	BENT	580.00	580.00
2	REAR BUMPER SIDE BRACKET @\$85.00	O/S DAMAGED	170.00	85.00
1	O/S TAILGATE	DENTED	2,350.00	1,850.00
1	O/S TAILGATE LOCK	DAMAGED	300.00	300.00
1	O/S TAILGATE INNER TRIMBOARD	REPEATED	250.00	-
1	O/S TAILGATE WEATHERSTRIP	NOT NECESSARY	85.00	-
1	O/S TAILGATE PROACE EMBLEM	NECESSARY	105.00	105.00
1	O/S TAILGATE GLASS	SHATTERED	890.00	890.00
1	O/S TAILGATE INNER TRIM	DEFORMED	180.00	180.00
1	O/S TAILLAMP	CRACKED	330.00	330.00
	LESS 25% DISCOUNT		-1,560.00	-1,292.50
			4,680.00	3,877.50
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER PARKING SENSOR (SN)	DAMAGED	3,502.00	200.00
1	CORPORATE STICKER (SN)	NECESSARY	250.00	100.00
1	O/S TAILGATE GLASS SEALANT (SN)	NECESSARY	50.00	50.00
1	O/S TAILGATE GLASS INNER SEAL (SN)	NECESSARY	470.00	80.00
			4,272.00	430.00
<u>LABOUR</u>				
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		60.00	30.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		120.00	60.00
	TO REMOVE AND REFIT O/S TAILGATE GLASS.		80.00	60.00
	TO TRANSFER OF O/S TAILGATE FITTINGS AND PERFORM WATER SEEPAGE TEST.		150.00	60.00
	TO REINSTALL OF REAR BUMPER PARKING SENSOR .		120.00	50.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		1,200.00	600.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING ,KNOCKING AND STRAIGHTEN THE NECESSARY PORTION ,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.		850.00	500.00
			2,580.00	1,360.00
GRAND TOTAL			11,532.00	5,667.50
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,500.00

Report Ref No. CC4/LPC21009046/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBH 4288U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

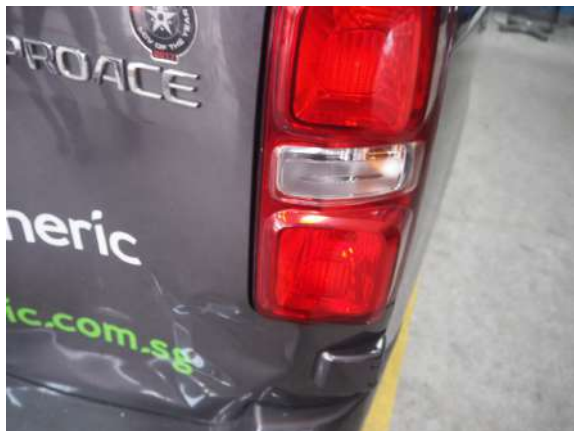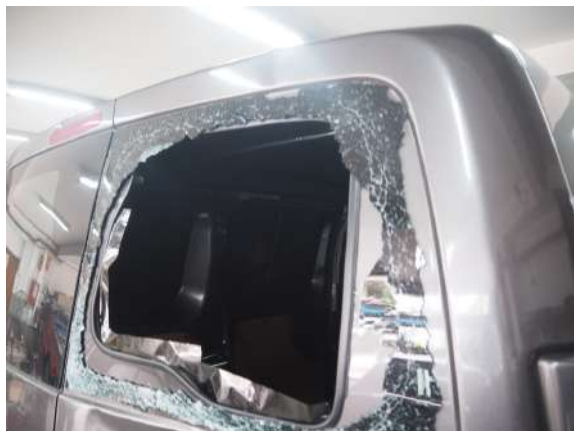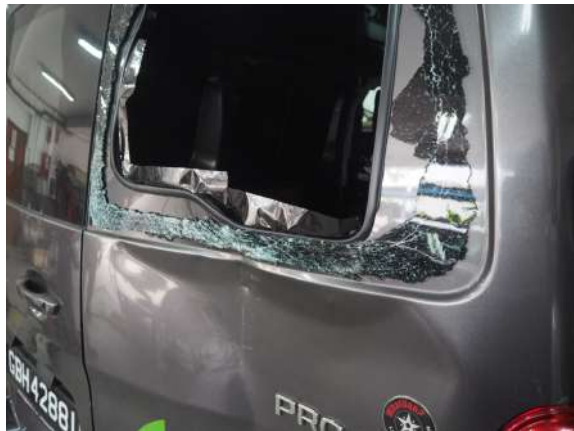



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBH 4288U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBH 4288U

RE-INSPECTION

