

ASS. REC. BY:

Steve

CS/11121009000/EF3

ASSIGNMENT

From:

Date:

Estimated Cost:

QD/TP/WS/TPRES/OD-RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

at

Insured:

Policy No.

D19MFL0005549_01

Claims No.

Sum Insured:

Excess:


1500

(Giloni's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

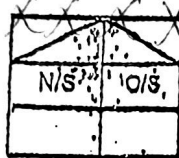

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repair:

15

days

Res.:

Yes or No

Cum Sum:

%

3 Val.: Yes or No

QA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

GBL 1997E

Yr Regn:

29/3/21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Tractor or

Make:

Toyota Hiace

C.G.

2982

Colour:

Orange

A/C:

Insured / Std / NI / N

Sp. Reading

3149

T/Radio:

Insured / Std / NI / N

Eng/No:

C/No:

JTH/T0204025/650

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Locked / Burnt or

Brake: In order / Jammed / Locked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

195R15C

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

4

mm

R/Bal.

4

mm

U/Bal.

4

mm

U/Bal.

4

mm

D.O.A.

26/8/21

D.O.I.

31/8/21

Survey held at

Efficient Motor

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body structure affected due to collision

Date / Time Action / Instruction

MV-80K

31/08/21 @ 3.05pm revert to Derrick Tan via Merimen.

01/09/21 @ 3.33pm Meena informed C/A & ex: \$1500 via Merimen.

01/09/21 @ 6.25pm Informed wksp C/A not more than LS \$15K & ex: \$1500 by email.

Steve finalised with EZer LS \$10000, 15 days (Red \$13744, 58%)

Date/Time, File, Pass to:



: Prel. Report

Days Of Repair:

15

Resurvey No. of Trips:

1

Survey Fee:

Transportation:

S. & RS. S:

Photos:

Others:

TOTAL

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Insp (\$



: VV&I (\$

MER-OD

10000

EFFICIENT MOTOR & ENGINEERING WORKS PTE LTD

56 LOYANG WAY # 06-07 ENTERPRISE BUILDING SINGAPORE 508775

VEHICLE NO : GBL1997E

MAKE & MODEL : TOYOTA / HIACE VAN TURBO 5DR MT

CHASSIS NO : JTFHT02P400251650

DATE : 30 AUG 2021

CLAIM TYPE : OD CLAIM

D.O.A : 26 AUG 2021

TO : INDIA INTERNATIONAL INSURANCE PTE LTD

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

S/No.	QTY	DESCRIPTION	CONDITION / REMARKS	COST PRICE	TOTAL PRICE
1	1	FRONT BUMPER / BR		\$ 190.00	\$ 190.00
2	1	FRONT BUMPER GRILLE / BR		\$ 75.00	\$ 75.00
3	2	FRONT BUMPER SIDE RETAINER LH/RH / BR		\$ 65.00	\$ 130.00
4	2	FRONT FOG LAMP COVER LH/RH (RH) / MIS		\$ 50.00	\$ 100.00
5	1	FRONT BUMPER REINFORCEMENT / DO		\$ 100.00	\$ 100.00
6	1	FRONT BUMPER CENTER BEAM / BT		\$ 55.00	\$ 55.00
7	1	FRONT GRILLE TOP / MIS		\$ 100.00	\$ 100.00
8	1	FRONT GRILLE LOWER / MIS		\$ 120.00	\$ 120.00
9	1	FRONT GRILLE INNER / MIS		\$ 180.00	\$ 180.00
10	2	HEADLAMP ASSY LH/RH / BR		\$ 280.00	\$ 560.00
11	2	HEADLAMP BRACKET LH/RH / MIS		\$ 10.00	\$ 20.00
12	1	BONNET / DO		\$ 200.00	\$ 200.00
13	1	BONNET LOCK / BT		\$ 40.00	\$ 40.00
14	2	BONNET HINGE LH/RH / BT		\$ 30.00	\$ 60.00
15	1	BONNET STAND / MIS		\$ 15.00	\$ 15.00
16	2	FRONT CORNER PANEL LH/RH / DO		\$ 65.00	\$ 130.00
17	1	BRACE PANEL / BT		\$ 25.00	\$ 25.00
18	1	FRONT SUPPORT PANEL / DO		\$ 150.00	\$ 150.00
19	2	FRONT SUPPORT REINF LOWER LH/RH (RH) / DO		\$ 75.00	\$ 150.00
20	2	TOWING COVER / MIS		\$ 15.00	\$ 30.00
21	1	AIR CLEANER BOX / BR		\$ 250.00	\$ 250.00
22	1	AIR INTAKE DUCT / MIS		\$ 65.00	\$ 65.00
23	1	DASHBOARD ?		\$ 450.00	\$ 450.00
24	1	DASHBOARD REINFORCEMENT ?		\$ 280.00	\$ 280.00
25	1	FRONT WINDSCREEN GLASS / BR		\$ 600.00	\$ 600.00
26	1	FRONT WINDSCREEN GLASS MOULDING / AK		\$ 50.00	\$ 50.00
27	1	WIPER PANEL GARNISH / BR		\$ 180.00	\$ 180.00
28	2	WIPER PANEL GARNISH LH/RH (SMALL) / MIS		\$ 20.00	\$ 40.00
29	1	WIPER LINK ASSY ?		\$ 120.00	\$ 120.00
30	1	WIPER MOTOR ?		\$ 300.00	\$ 300.00
31	1	TOYOTA LOGO / AK		\$ 45.00	\$ 45.00
32	1	FRONT STEP GARNISH RH / BR		\$ 65.00	\$ 65.00
33	1	FRONT BODY PILLAR OUTER RH / DO		\$ 250.00	\$ 250.00
34	1	COWL SIDE LOWER PANEL RH / DO		\$ 110.00	\$ 110.00
35	1	COWL SIDE PANEL RH / DO		\$ 100.00	\$ 100.00
36	1	COWL SIDE TOP PANEL RH / DO		\$ 65.00	\$ 65.00
37	1	CENTER PILLAR RH X R		\$ 220.00	\$ 220.00
38	1	FRONT DOOR RH / DO		\$ 550.00	\$ 550.00
39	2	FRONT DOOR HINGE RH / BT		\$ 35.00	\$ 70.00
40	1	FRONT DOOR SIDE MIRROR RH / MIS		\$ 250.00	\$ 250.00
41	1	FRONT DOOR CHECKER RH ?		\$ 50.00	\$ 50.00
42	1	FRONT DOOR WEATHERSTRIP RH ?		\$ 75.00	\$ 75.00
43	1	FRONT DOOR WINDOW REGULATOR RH ?		\$ 100.00	\$ 100.00
44	1	FRONT DOOR REGULATOR MOTOR RH ?		\$ 220.00	\$ 220.00
45	1	FRONT DOOR LOCK RH / Jammed		\$ 180.00	\$ 180.00
46	1	FRONT DOOR OUTER MOULDING RH / NT		\$ 50.00	\$ 50.00

47	1	FRONT DOOR INNER TRIMBOARD RH	CR4	\$ 330.00	\$ 330.00
48	1	FRONT DOOR INNER SCUFF PLATE RH		\$ 95.00	\$ 95.00
49	1	HARNESS ASSY, WIRING COWL TO HEADLAMP	BR	\$ 1,100.00	\$ 1,100.00
50	2	HARNESS ASSY, WIRING CASING LH/RH	(RH) ml	\$ 35.00	\$ 70.00
51	1	WASHER TANK	CR4	\$ 80.00	\$ 80.00
52	1	RADIATOR SPARE TANK		\$ 140.00	\$ 140.00
53	1	RADIATOR	DD	\$ 550.00	\$ 550.00
54	1	CONDENSER	DD	\$ 450.00	\$ 450.00
55	1	A/C DISCHARGE HOSE		\$ 180.00	\$ 180.00
56	1	A/C SUCTION HOSE	DD	\$ 250.00	\$ 250.00
57	1	A/C LIQUID PIPE	DD	\$ 220.00	\$ 220.00
58	1	CONDENSER FAN BLADE		\$ 65.00	\$ 65.00
59	1	RADIATOR FAN BLADE		\$ 65.00	\$ 65.00
60	2	RADIATOR FAN MOTOR		\$ 350.00	\$ 700.00
61	1	INTERCOOLER	DD	\$ 500.00	\$ 500.00
62	1	INTERCOOLER BRACKET		\$ 30.00	\$ 30.00
63	2	INTERCOOLER AIR GUIDE	BR	\$ 55.00	\$ 110.00
64	1	RADIATOR FAN COWLING	BR	\$ 150.00	\$ 150.00
65	1	HEATER/AIRCON UNIT		\$ 1,100.00	\$ 1,100.00
66	1	BLOWER ASSY		\$ 450.00	\$ 450.00
67	1	BRAKE BOOSTER	DD	\$ 550.00	\$ 550.00
68	1	BRAKE BOOSTER PUMP	BT	\$ 300.00	\$ 300.00
69	1	ACCELERATOR PEDAL		\$ 200.00	\$ 200.00
70	1	BRAKE PEDAL		\$ 250.00	\$ 250.00
71	1	FRONT BODY PILLAR WEATHERSTRIP	X	\$ 130.00	\$ 130.00
72	1	STEP TOP PANEL	DD	\$ 50.00	\$ 50.00
73	1	STEP UNDER PANEL	DD	\$ 60.00	\$ 60.00
74	1	FRONT DOOR GLASS RH		\$ 120.00	\$ 120.00
75	1	BONNET HINGE BRACKET RH	DD	\$ 35.00	\$ 35.00
76	1	BRAKE PIPE 1	BT	\$ 85.00	\$ 85.00
77	1	BRAKE PIPE 2	BT	\$ 85.00	\$ 85.00
78	1	FRONT DOOR WHEEL ARC RUBBER RH		\$ 35.00	\$ 35.00
79	1	FRONT BODY PILLAR INNER LOWER RH		\$ 150.00	\$ 150.00
80	1	DASHBOARD DRIVER SIDE LOWER FINISHER		\$ 160.00	\$ 160.00
81	1	DASHBOARD METER SET FINISHER		\$ 120.00	\$ 120.00
82	1	DASHBOARD DRIVER AIR VENT FINISHER		\$ 95.00	\$ 95.00
83	1	FRONT DOOR SPEAKER RH		\$ 180.00	\$ 180.00
84	1	FRONT DOOR RUN CHANNEL RH		\$ 100.00	\$ 100.00
85	1	FRONT DOOR INNER QTR GARNISH RH		\$ 35.00	\$ 35.00
				\$ 15,455.00	\$ 16,540.00

TOTAL PRICE	\$ 16,540.00
PLUS 10%	\$ 1,654.00
SUB TOTAL PRICE	\$ 18,194.00

S/No.	QTY	DESCRIPTION	CONDITION / REMARKS	UNIT S/NETT	TOTAL S/NETT
1	1	FRONT BUMPER CLIPS SET	nrc	\$ 50.00	\$ 50.00
2	1	FRONT GRILLE CLIPS SET	nrc	\$ 50.00	\$ 50.00
3	1	FRONT DOOR TRIMBOARD CLIPS SET	nrc	\$ 50.00	\$ 50.00
4	2	FRONT DOOR CO.REG. STICKER	nrc	\$ 25.00	\$ 50.00
5	1	TOWING FEE	nrc	\$ 70.00	\$ 70.00
6	1	FRONT NO. PLATE	put	\$ 45.00	\$ 45.00
7	1	RADIATOR COOLANT	nrc	\$ 50.00	\$ 50.00
9	1	WINDSCREEN SEALANT	nrc	\$ 80.00	\$ 80.00
10	1	WINDSCREEN INNER SEAL	nrc	\$ 30.00	\$ 30.00
11	1	WINDSCREEN IU BRACKET	nrc	\$ 25.00	\$ 25.00
12	1	BRAKE FLUID	nrc	\$ 50.00	\$ 50.00
TOTAL S/NETT				\$ 525.00	\$ 550.00

our Charges

1	To cut & weld damaged panels FRONT LH/RH, firewall and front floor panel & inner panels chassis frame members, to remove & replace damaged parts.	\$ 2,000.00	1600
2	To check and rectify lighting & wiring harness	\$ 250.00	30
3	To Spray painting for Front L/RH, Portions & affected areas.	\$ 1,500.00	1200
4	To transfer front door rh components to new door.	\$ 100.00	50
5	To remove & refit radiator, condenser, other major components, top up A/C gas.	\$ 150.00	50
6	To remove and refit dashboard, heater, blower, & interior trims to facilitate repair.	\$ 350.00	200
7	To remove and refit front windscreen glass.	\$ 150.00	120
8	To reset diagnostic fault code.	\$ 250.00	X
9	To remove replace brake booster, pump, pipings and other brake components.	\$ 150.00	80
10	To do wheel alignment.	\$ 100.00	X

TOTAL LABOUR

\$ 5,000.00

Total Cost of Repairs

\$ 23,744.00

(Total parts + Total S/Nett + Total Labour Cost)

Steve (LKK)
31/8/21, 11.30am

OB- AM AL
Excess - ?

L/S

My AL sy
15 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: