


55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/TP/0718/2021/TF
DATE : 1-Sep-21
WIP : 42260

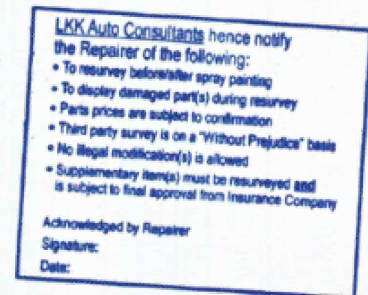

VEHICLE NOT IN WORKSHOP. KINDLY ARRANGE SURVEY TBC
YOUR INSURED VEH NO : SMM 9806 K

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept


Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MS. PRISCILLA LOO SOOK YEE
ADDRESS : 6 NIM DRIVE
SINGAPORE 807650

TELEPHONE : HP +65 9222 2068
TYPE OF CLAIM : THIRD PARTY CLAIM
POLICY NO : 1700038446-04
VEHICLE NO : **SJJ 6118 J**
MODEL CODE : AUDI Q7 2.0 TFSI QU
MODEL YEAR : 11/8/2017
ENGINE NO : CYR 033675
CHASSIS NO : WAUZZZ4M7HD042083
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 28/8/202
PLACE OF ACCIDENT : EAST COAST PARK (B1 CARPARK)

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SJJ 6118 J

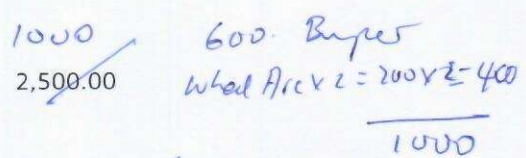S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE,CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR,HEADLIGHT WASHER ASSY AND FRONT PARKING ATD	S/N \$ 480.00	
2	TO REMOVE AND TRANSFER LHS HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 400.00	
3	TO DISMANTLE AND RENEW FRONT BUMPER AND LHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 1,350.00	
4	TO RESPRAY FRONT BUMPER, LHS FRONT BUMPER LOWER SPOILER AND BOTH FRONT WHEEL ARCH TRIMS.	\$ 2,500.00	
5	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 192.00	
TOTAL LABOUR CHARGES		: \$ 4,922.00	

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SJJ 6118 J

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER <i>Regis</i>	1	\$ 2,724.00	+
2	FRONT BUMPER FIXING PARTS <i>Rein</i>	1	\$ 447.00	+
3	FRONT BUMPER AIR GUIDE - LH <i>Rein</i>	1	\$ 67.00	+
4	FRONT BUMPER AIR GUIDE END CAP - LH <i>Rein</i>	1	\$ 36.00	+
5	FRONT BUMPER CLOSING ELEMENT - UPPER CENTRE <i>Rein</i>	1	\$ 377.00	+
6	FRONT BUMPER GRILLE - LOWER CENTRE <i>Rein</i>	1	\$ 206.00	+
7	FRONT BUMPER UNDERRUN BAR <i>Rein</i>	1	\$ 807.00	+
8	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>Rein</i>	1	\$ 210.00	+
9	FRONT BUMPER SPOILER - LH <i>Rein</i>	1	\$ 211.00	+
10	FRONT BUMPER MUD GUARD - LH <i>Rein</i>	1	\$ 44.00	+
11	FRONT BUMPER AIR GRILLE - LH <i>Rein</i>	1	\$ 297.00	+
12	FRONT BUMPER AIR GUIDE END CAP - LH <i>Rein</i>	1	\$ 33.00	+
13	FRONT BUMPER MUD GUARD DEFLECTOR - LH <i>Rein</i>	1	\$ 59.00	+
14	HORN - LH <i>Rein</i>	1	\$ 226.00	+
15	FRONT BUMPER PARKING AID - OUTER <i>Rein</i>	1	TBC	+
16	FRONT BUMPER PARKING AID SEAL RING <i>Rein</i>	4	\$ 14.00	+
17	HEADLIGHT MOUNTING - LH <i>Rein</i>	1	\$ 118.00	+
18	HEADLIGHT - LH <i>Rein</i>	1	\$ 10,021.00	+
19	HEADLIGHT LIFT CYLINDER - LH <i>Rein</i>	1	\$ 198.00	+
20	HEADLIGHT LIFT CYLINDER HOSE <i>Rein</i>	1	\$ 98.00	+
SUB TOTAL SPARE PARTS		:	\$ 16,193.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SJJ 6118 J

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT WHEEL HOUSING LINER - LH	1	\$ 239.00	+
22	RADIATOR AIR GUIDE - LH / LOWER	2	\$ 71.00	+
23	FRONT WHEEL ARCH TRIM - LH / RH	2	\$ 1,150.00	+
24	RADIATOR GRILLE	1	\$ 2,473.00	+
25	RADIATOR GRILLE COVER	1	\$ 72.00	+
26	RADIATOR GRILLE AUDI COVER	1	\$ 62.00	+
27	FRONT BUMPER TOP COVER	1	\$ 131.00	+
28	CAUTION STICKER	1	\$ 14.00	+
29	FRONT BUMPER CARRIER FORM	1	\$ 171.00	+
30	FRONT BUMPER CARRIER	1	\$ 964.00	+
31	FRONT BUMPER SUPPORT - LH / RH	2	\$ 72.00	+
32	FRONT BUMPER GUIDE SECTION - LH	1	\$ 44.00	+
33	FRONT NO. PLATE	S/N	\$ 60.00	+
34	SUNDRIES		\$ 300.00	+
TOTAL SPARE PARTS		:	\$ 22,016.00	
TOTAL LABOUR CHARGES		:	\$ 4,922.00	
GRAND TOTAL		:	\$ 26,938.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME : *Adrian L*
SURVEYED DATE : *06/09/21*
AUTHORISED DATE :
EXCESS COST :
LIABILITY :
REMARKS : *Not Authorised , 03 Days*

PLEASE NOTE : THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT