Qualified Automobile Accident Damage Appraisers/Loss Adjusters

601, Choa Chu Kand Street 62, # 04-07, Singapore 680601

Mobile Number: 96623655, Office Tel.: 67655661

E-mail address: aasschee@singnet.com.sg

RCB No. 43037800M

VEHICLE INSPECTION REPORT

To:

A R Link Services Pte. Ltd.

c/o Kuo Li Auto Workshop

Report No

TP/0027/09/2021

.

Block 5035, # 01-363 Ang Mo Kio Industrial Park 2

Singapore 569538

Date

07 September 2021

REFERENCE

Requested by Date of Request

Tan Chin Chee 31 August 2021

22 August 2021

Sum Insured

3rd Party Vehicle No. : Owner's Vehicle No. : YM 7687H **GBK 821R** Not Available

Date of Accident Date Inspected Inspected at

31 August 2021 Kuo Li Auto Workshop Policy No. Claim No.

Not Available Not Available

PARTICULARS OF VEHICLE

Reg. No. Vehicle Make Original Regn Date

COE Expiry Date

Left Front

Right Rear

Left Rear

GBK 821R

Toyota 24 December 2019 23 December 2039 23 December 2029 Vehicle Model ; Hiace Van Turbo 5Dr MT Engine No. Chassis No.

Engine Capacity: 2,982 cc.

Propellant

1KDB014877 JTFHT02P300249761 Diesel

Radio/Cassette Seat Belt Colour

Speedometer

Air Conditioner

: Yes : Yes : White 39,493 km

: Yes

CONDITION OF TYRES Right Front

Lifespan Expiry Date:

MAKE Bridgestone

Bridgestone

Bridgestone Bridgestone

SIZE 195 R15 195 R15 195 R15 195 R15

RIM Standard Standard Standard Standard % REMAINING 50% 50%

50%

50%

DESCRIPTION OF DAMAGES

NOTE: The above vehicle was SURVEYED WITHOUT PREJUDICE

The owner's vehicle sustained damages on the LH side portions.

\$

\$

\$

\$

\$

Estimated period of repairs:

05 (Five) working days

Repairer completed the repair in: 07 (Seven) days inclusive of Sunday and Public Holiday

Number of photographs taken at time of inspection and attached:

14 (Fourteen) + 04 (Four)Follow-up Survey

Follow-up Survey (After Repair/Painting) only.

SUMMARY OF REPAIR COSTS

Repairer's Estimate Revised Parts Revised Labour Total Revised Amount

Adjusted Amount

Total

Less: Owner's Excess

\$ Lump Sum \$

2.050.00 N.A. 2.050.00

3,582.25

1,174.29

1,400.00

2,574.29

Nett Total without GST

2,050.00

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

CHEE AIK THUNN (HP 96623655) ENG TECH, CAE MIMI / AM SAE-A MSAAA-Accident Damage Appraiser

Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655, Office Tel.: 67655661, E-mail Address: aasschee@singnet.com.sg

RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: GBK 821R

Attachment to report no. TP/0027/09/2021

REPAIRER'S ESTIMATE			OUR RECOMMENDATIONS		
Replacement Of Damaged Panels/Parts and Labour Charges		S\$ Price	Conditions	S\$ Price	
	REPLACEMENT OF DAMAGED PARTS	LESS 25%	LUMP SUM REPAIR	LESS 25%	
1.	1 pc LH sliding door 🗸	1,255.95	Dented/Bent - Allowable	1,255.95 🗸	
2.	1 pc LH body panel	1,063,95	Dented/Bent - Not Allowed	To repair	
3.	1 pc LH body panel sliding door rail 🗸	243,10	Dented/Bent - Allowable	243,10 🗸	

		2,563.00		1,499.05	
		640.75		374.76	
		******		***************************************	
		1,922.25		1,124.29 🗸	
١.	1 tube LH sliding door glass sealant 🗸 S.Nett	50.00	Necessary - Allowable	50,00 🗸	

		1,972.25		1,174.29	

	LABOUR CHARGES				
	Labour charges - R & R LH sliding door glass.	120.00	Necessary	120.00 80	
			Reason being:		
			01. To transfer LH sliding door glass to new		
			LH slifing door.		
	Labour charges - R & R LH sliding door attachments.	50.00	Necessary	50.00 🗸	
			Reason being:		
			01. To transfer LH sliding door attachment to		
			new LH sliding door.		
		**********	/	*******	
		170.00		170.00	
			/		

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

CHEE AIK THUSN (HP. 96623655) ENG TECH, CAE MIMI / AM SAE-A MSAAA/Accident Damage Appraiser

Page 1/3

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

601, Choa Chu Kang Street 62, # 04-07, Singapore 680601

Mobile Number: 96623655, Office Tel.: 67655661, E-mail Address: aasschee@singnet.com.sg

RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No:

GBK 821R

Attachment to report no. TP/0027/09/2021

REPAIRER'S ESTIMATE			OUR RECOMMENDATIONS		
Replacement Of Damaged Panels/Parts and Labour Charges		S\$ Price	Conditions	S\$ Price	
	LABOUR CHARGES Carried forward from page 1/3	170,00		170.00	
03.	Labour charges - Panel beating	500,00	Necessary	250.00 🗸	
03.	Labout charges - Fanet beating	300,00	Recason being: 01. To remove damaged parts and attachments. repair and reshape dented panels, renew damaged panels and parts (refer to our recommendations) align and refit attachments.	230.00 🗸	
04.	Labour charges - Spray painting	800.00	Necessary Reason being: 01. To respray paint on new LH sliding door, sliding door rail and LH body panel.	700.00 500	
05.	Labour charges - Redo lettering	200.00	Necessary Reason being: 01. To redo lettering on LH sliding door and LH body panel.	200.00 🗸	
06.	Labour charges - Anti rust proofing	80.00	Necessary Reason being: 1. To apply/respray anti rust proofing.	50.00 🗸	
07.	Labour charges - Lighting system	30,00	Necessary Reason being: 01. To conduct water leak test.	30.00 🗙	
		1,610.00	/ .	1,400.00	
				1000	

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

CHEE AIK THUAN (HP. 96623655) ENG TECH, CAE MIMI / AM SAE-A MSAAA/Accident Damage Appraiser

Page 2/3

Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655, Office Tel.: 67655661, E-mail Address: aasschee@singnet.com.sg

RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No:

GBK 821R

Attachment to report no. TP/0027/09/2021

REPAIRER'S ESTIMATE		OUR RECOMMEND	DATIONS
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
CARRIED FORWARD FROM PAGE 1/3 Replacement of damaged panels/part CARRIED FORWARD FROM PAGE 2/3 Labour Charges	1,972.25 1,610.00 		1,174.29 1,400.00 2,574.29 LUMP SUM 2,050.00

NOTE:

Please refer to our recommendations of S\$ 2.574.29.

In our opinion, the vehicle can be repaired at a Lump Sum of S'pore Dollars: Two Thousand And Fifty Only

 $(S$2,574.29 \times 20\% (S$5,14.88) = S$2,059.43.$

-20%: 1850

5 days

2304.29

LUMP SUM CONTRACT

In view of the fact that the repairer has been offered a reduced budget to complete the repair. (TOTAL REVISED LESS ANOTHER 20%), the repairer should be entitled to exercise some discretion to complete the repair.

- To replace with New Parts (Genuine or Non Genuine Parts)
- b. To replace with Second Hand Parts (Imported or local Used Parts)
- To repair C.

The repairer would repair the vehicle to the entire satisfaction of the owner and in 'road worthy' condition,

The above terms and condition for the LUMP SUM REPAIR CONTRACT (Accident-Damaged Vehicle) is in line with the circular through a referendum from the Singapore Automobile Appraisers Association dated 25 May 2004.

Please find enclosed

- Letter fronm the Singapore Automobile Appraisers Association dated 25 May 2004
- Letter fronm The General Insurance Association Of Singapore dated 28 June 2004.
- Letter from the General Insurance Association Of Singapore dated 08 September 20
- The New Paper reply from NTUC Income dated 19 September 2003.

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

CHEE AIK THUAN (HP. 96623655) ENG TECH, CAE MIMI / AM SAE-A MSAAA/Accident Damage Appraiser

Page 3/3

Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS





Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS





Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS






Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

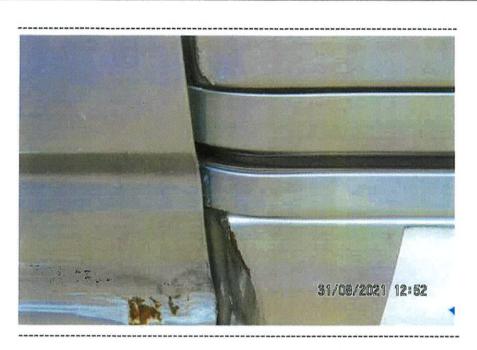



Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS






Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

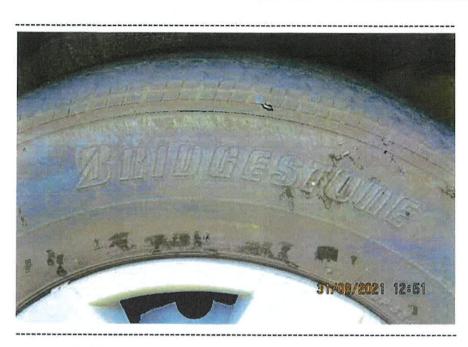




Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

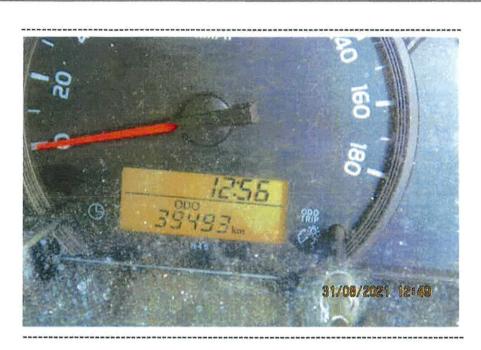



Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: FOLLOW-UP SURVEYED PHOTOGRAPHS Attachment to report no. TP/0027/09/2021

(After Repair/Spray Painting)





Qualified Automobile Accident Damage Appraisers/Loss Adjusters 601, Choa Chu Kang Street 62, # 04-07, Singapore 680601 Mobile Number: 96623655: Office Tel.: 67655661 E-mail Address: aasschee@singnet.com.sg

RCB No.: 43037800M

Photographs: FOLLOW-UP SURVEYED PHOTOGRAPHS Attachment to report no. TP/0027/09/2021

(After Repair/Spray Painting)



