

TwinCar AUTOMOTIVE PTE LTD

Kaki Bukit AutoHub

2 Kaki Bukit Ave 2

#01-17 / #01-18 / Heavy Vehicle #01-08 / Spray Painting #02-27

Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510

E-Mail : sales@n51.com.sg

Company Reg. No. : 200714616M

GST Registration No. : 200714616M

MOHD SANI BIN JUWAHIB
BLK 238 PASIR RIS ST 21 #11-25
SINGAPORE 510238

Contact : 81806744

TP A x A.
Jaslin.

ESTIMATE

Repair Code : CLM15303

Date in : 31/08/2021

Vehicle Num. : SJR2451E

Model : TOYOTA VIOS E AUTO

Chassis/Eng# : MR053HY9305116766/1NZX918800

Parts and Labour Assesment

Description of part	Qty	Unit Price	Amount
REAR BOOTLID <i>Buckled</i>	1	681.20	✓ 681.20
REAR BOOTLID 'E' EMBLEM <i>3 new</i>	1	32.50	✓ 32.50
REAR BOOTLID 'LOGO' EMBLEM	1	45.70	✓ 45.70
REAR BOOTLID HINGES L/R <i>new</i>	2	96.80	+ 193.60
REAR BOOTLID INNER RUBBER SIDE GUIDE STOPPER L/R <i>new</i>	2	43.70	+ 87.40
REAR BOOTLID LOCK STRIKER <i>new</i>	1	48.00	+ 48.00
REAR BOOTLID MECHANISM LOCK <i>Damaged</i>	1	211.70	✓ 211.70
REAR BOOTLID NUMBER PLATE LAMP L/R <i>new</i>	2	96.80	+ 193.60
REAR BOOTLID OUTER GARNISH <i>new</i>	1	241.00	+ 241.00
REAR BOOTLID WEATHER STRIP <i>at</i>	1	271.80	✓ 271.80
REAR BUMPER <i>Deformed</i>	1	561.80	✓ 561.80
REAR BUMPER REFLECTOR L/R <i>cracked</i>	2	187.75	✓ 375.50
REAR BUMPER RETAINER L/R <i>new</i>	2	191.10	95 382.20
REAR BUMPER SIDE BRACKET L/R <i>new</i>	2	171.45	90 342.90
REAR END PANEL <i>Dented</i>	1	791.35	✓ 791.35
REAR END PANEL INNER TOP GARNISH <i>Deformed</i>	1	182.00	✓ 182.00
REAR END SIDE BRACKET L/R <i>new</i>	2	89.50	+ 179.00
REAR EXHAUST GASKET <i>new</i>	1	63.70	+ 63.70

*** This is a computer-generated document which requires no signature.***

TwinCar AUTOMOTIVE PTE LTD

Kaki Bukit AutoHub

2 Kaki Bukit Ave 2

#01-17 / #01-18 / Heavy Vehicle #01-08 / Spray Painting #02-27

Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510

E-Mail : sales@n51.com.sg

Company Reg. No. : 200714616M

GST Registration No. : 200714616M

MOHD SANI BIN JUWAHIB
BLK 238 PASIR RIS ST 21 #11-25
SINGAPORE 510238

Contact : 81806744

ESTIMATE

Repair Code : CLM15303

Date in : 31/08/2021

Vehicle Num. : SJR2451E

Model : TOYOTA VIOS E AUTO

Chassis/Eng# : MR053HY9305116766/1NZX918800

REAR EXHAUST HEAT COVER	1	270.40	+	270.40
REAR EXHAUST RUBBER MOUNTING	2	63.55	+	127.10
REAR EXHAUST SILENCER BOX	1	781.10	+	781.10
REAR FENDER INNER SHIELD L/R	2	141.45	+	282.90
REAR FENDER INNER TRIM L/R	2	387.85	285 387.85	775.70
REAR FLOOR PANEL	1	981.10	+	981.10
REAR FLOOR PANEL CENTER SPONGE	1	378.20	+	378.20
REAR FLOOR PANEL TOOL SPONGE TRAY LH	1	285.30	✓	285.30
REAR FLOOR PANEL TOOL SPONGE TRAY RH	1	285.30	✓	285.30
REAR FLOOR PANEL TOP BOARD COVER	1	375.10	245	<u>375.10</u>
REAR SPARE TYRE LOCK SCREW	1	45.10	✓	45.10
REAR TAILLAMP INNER BLACK GASKET L/R	2	43.70	✓	87.40
REAR TAILLAMP INNER PANEL L/R	2	182.55	+	365.10
REAR TAILLAMP L/R	2	283.75	✓	567.50
Subtotal before discount				10,492.25
Percentage discount 25%				2,623.06
Sub-total 1				7,869.19
REAR BOOTLID NUMBER PLATE	1	25.00	X	25.00

*** This is a computer-generated document which requires no signature.***

TwinCar AUTOMOTIVE PTE LTD

Kaki Bukit AutoHub

2 Kaki Bukit Ave 2

#01-17 / #01-18 / Heavy Vehicle #01-08 / Spray Painting #02-27

Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510

E-Mail : sales@n51.com.sg

Company Reg. No. : 200714616M

GST Registration No. : 200714616M

MOHD SANI BIN JUWAHIB
BLK 238 PASIR RIS ST 21 #11-25
SINGAPORE 510238

Contact : 81806744

ESTIMATE

Repair Code : CLM15303

Date in : 31/08/2021

Vehicle Num. : SJR2451E

Model : TOYOTA VIOS E AUTO

Chassis/Eng# : MR053HY9305116766/1NZX918800

REAR BOOTLID NUMBER PLATE HOLDER	3 HP	1	50.00	X	50.00
REAR BOOTLID OUTER GARNISH CLIPS - SET	new	1	30.00	+	30.00
REAR BUMPER CLIPS - SET	new	1	50.00	30	50.00
REAR BUMPER REVERSE SENSOR - SET	Damaged	1	280.00	200	280.00
REAR END PANEL INNER TOP GARNISH CLIPS - SET	new	1	50.00	10	50.00
REAR FENDER INNER SHIELD CLIPS L/R - SET	3 HP	2	40.00	+	80.00
REAR FENDER INNER TRIM CLIPS L/R - SET	new	2	50.00	+	100.00
REAR FLOOR PANEL INSULATOR MAT	new	1	300.00	260	300.00
REAR TAILLAMP CLIPS L/R - SET	new	2	30.00	20	60.00
Subtotal before discount					1,025.00
Percentage discount 0%					0.00
Sub-total 2					1,025.00
Parts-total					8,894.19

LABOUR

To Transfer Rear Bootlid Mechanism Lock Outer Handle Reflector

To remove, reinstall electrical wiring harness, check lighting and rewire for parking sensor.

To remove, reinstall roof top trim upholstery, cushion seat, trim garnish, trim liner carpet. (to FR)

To re-spray painting on the rear bootlid, rear end panel, rear fender (L/R), spare tyre panel and rear bumper.

To remove and change exhaust silencer box with pipe, re-align where necessary consistent to the accident.

60 80.00
✓ 80.00
60 120.00
80 1,100.00
+ 100.00
80.

*** This is a computer-generated document which requires no signature.***

TwinCar AUTOMOTIVE PTE LTD

Kaki Bukit AutoHub

2 Kaki Bukit Ave 2

#01-17 / #01-18 / Heavy Vehicle #01-08 / Spray Painting #02-27

Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510

E-Mail : sales@n51.com.sg

Company Reg. No. : 200714616M

GST Registration No. : 200714616M

MOHD SANI BIN JUWAHIB

BLK 238 PASIR RIS ST 21 #11-25

SINGAPORE 510238

Contact : 81806744

ESTIMATE

Repair Code : CLM15303

Date in : 31/08/2021

Vehicle Num. : SJR2451E

Model : TOYOTA VIOS E AUTO

Chassis/Eng# : MR053HY9305116766/1NZX918800


To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.

To apply anti-rust chemical on repaired and replaced panel.

1940	800. 1,000.00
	60. 120.00
Labour Total	2,600.00
Parts & Labour Total	11,494.19

*** This is a computer-generated document which requires no signature.***

page 4

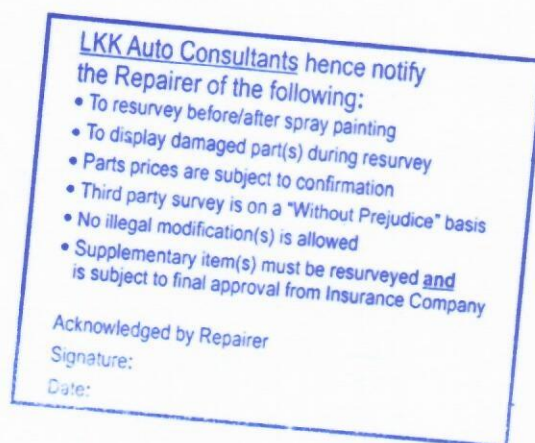

Adrian Lj
1/s 01/09/21.

01 Days.

total: 6054.36

2/s: 4.8K. ✓