

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0719/2021/JT
DATE : 1-Sep-21
WIP : 42281

VEHICLE NOT IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 2/9/21

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR TAN SZE TONG
ADDRESS : 8 ANG MO KIO AVENUE 2
#10-03
SINGAPORE 567695
TELEPHONE : HP +65 96806828
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 1800073045-03
VEHICLE NO : **SDZ 612 A**
MODEL CODE : A4 SEDAN 2.0 TFSI 8W
MODEL YEAR : 26/6/2018
ENGINE NO : CVK 058801
CHASSIS NO : WAUZZZF40JA146757
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 1-Sep-21
PLACE OF ACCIDENT : SCHOOL OF THE ARTS
ROUNDAABOUT ENTRANCE

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SDZ 612 A

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	S/N \$ 480.00	✓
2	TO REMOVE AND TRANSFER RHS HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 350.00	250 ✓
3	TO REMOVE AND REINSTALL AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM TO CARRY OUT VACUUM AND REGAS	S/N \$ 1,400.00	? ✓
4	TO RENEW FRONT WINDSCREEN.	S/N \$ 480.00	✓
5	TO INSTALL SOLAR FILM FOR FRONT WINDSCREEN.	S/N \$ 400.00	✓
6	TO RENEW FRONT WINDSCREEN SENSOR FOIL AND RESET SYSTEM.	S/N \$ 300.00	✓
SUB - TOTAL LABOUR CHARGES		: \$ 3,410.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SDZ 612 A

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO CARRY OUT WATER SEEPAGE TEST FOR FRONT WINDSCREEN.	S/N \$ 200.00	150 ✓
8	TO REMOVE AND RENEW RHS FRONT WHEEL SUSPENSION ASSY WITH SUBFRAME.	S/N \$ 2,400.00	✓
9	TO REMOVE AND TRANSFER RHS FRONT DOOR 'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES.	S/N \$ 350.00	280 ✓
10	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, RHS FRONT FENDER, RHS FRONT DOOR AND RHS HEADLIGHT. TO CUT OUT AND WELD RHS FRONT RHS FRONT DOOR AND RHS HEADLIGHT. TO CUT OUT AND WELD RHS FRONT TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 3750 8,050.00	2500 inclusive of fender top support (Repair)
11	TO RESPRAY FRONT BUMPER, BONNET, HINGES, RHS FRONT FENDER, RHS FRONT FENDER TOP SUPPORT, RHS FRONT DOOR, RHS WING MIRROR COVER AND RHS APPEAR	\$ 2475 6,000.00	4x550 = 2200 Fender Top Support : 275
12	TO RENEW RHS FRONT RIM WITH TYRE. TO CARRY OUT PRE/POST WHEEL ALIGNMENT.	\$ 520.00	2475 ✓
SUB - TOTAL LABOUR CHARGES		: \$ 17,520.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SDZ 612 A

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
13	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE.	S/N \$	280.00	X
14	TO CARRY OUT FIRST MESASUREMENT ON CAR-O-LINER.	S/N \$	✓ 800.00	✓
15	TO PLACE THE VEHICLE ON CAR-O-LINER TO FACILITATE THE REPAIR.	S/N \$	✓ 2,400.00	?
16	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK.	S/N \$	✓ 384.00	✓
TOTAL LABOUR CHARGES		:	\$	<u><u>24,794.00</u></u>

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER <i>Distorted</i>	1	\$ 1,787.00	✓ 1429.6
2	FRONT BUMPER FIXING PARTS <i>new</i>	1	TBC	✗
3	FRONT BUMPER SECURING STRIP <i>missing</i>	2	\$ 71.00	✗ 56.32
4	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>deformed</i>	1	\$ 210.00	?
5	FRONT BUMPER AIR GUIDE - RH	1	\$ 63.00	✓ 50.08
6	FRONT BUMPER AIR GUIDE GRILLE - RH	1	\$ 365.00	✓ 292
7	FRONT BUMPER GUIDE SECTION - RH <i>Distorted</i>	1	\$ 38.00	✓ 29.84
8	HORN - RH <i>gone</i>	1	\$ 126.00	✗
9	HORN BRACKET - RH	1	\$ 29.00	✗
10	FRONT FENDER - RH <i>Distorted</i>	1	\$ 767.00	✓ 613.2
11	FRONT FENDER ATTACHMENT PARTS <i>bent</i>	1	\$ 202.00	✗
12	FRONT FENDER CLOSING ELEMENT	1	\$ 72.00	✓ 57.52
13	FRONT FENDER TOP BRACKET - FRONT RH <i>Bent</i>	1	\$ 35.00	✓ 27.92
14	FRONT FENDER DEFORMATION BRACKET - RH <i>Bent</i>	1	\$ 49.00	✓ 39.2
15	RIVET <i>rh</i>	6	\$ 20.00	✓ 15.84
16	FRONT FENDER TOP BRACKET - REAR RH <i>Bent</i>	1	\$ 32.00	✓ 25.12
17	FRONT FENDER BRACE - RH <i>Bent</i>	1	\$ 118.00	✓ 94.4
18	FRONT WHEEL HOUSING LINER - RH <i>Deformed</i>	1	\$ 241.00	✓ 192.8
19	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	1	TBC	?
20	FRONT WHEEL SPOILER <i>Deformed</i>	1	\$ 73.00	✓ 58.4
SUB TOTAL SPARE PARTS		:	\$ 4,298.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT WHEEL SPOILER TRIM - RH <i>Del'd</i>	1	\$ 36.00	✓ 28.56
22	FRONT FENDER STONE CHIP GUARD - RH <i>ne</i>	1	\$ 51.00	✓ 40.32
23	FRONT FENDER TOP COVER - RH <i>Del'd</i>	1	\$ 31.00	✓ 24.64
24	FRONT HEADLIGHT CORNER COVER - RH <i>Del'd</i>	1	\$ 23.00	✓ 17.92
25	BONNET <i>Dented</i>	1	\$ 3,246.00	✓ 2596.8
26	BONNET ATTACHMENT PARTS <i>ne</i>	1	\$ 412.00	✗ 487.2
27	BONNET HINGE - LH / RH <i>ne</i>	2	\$ 610.00	+ 65.68
28	BONNET IMPACT PROTECTOR - LH / RH / CENTER <i>ne</i>	1	\$ 84.00	✓
29	BONNET STRIKER <i>free</i>	1	\$ 50.00	+
30	BONNET LOCK	1	\$ 214.00	+
31	HEADLIGHT - RH <i>cracked</i>	1	\$ 7,693.00	✓ 6154.4
32	HEADLIGHT LIFT CYLINDER - RH ?	1	\$ 210.00	?
33	HEADLIGHT LIFT CYLINDER HOSE <i>ne</i>	1	\$ 93.00	+
34	LOCK CARRIER ? <i>cracked</i>	1	\$ 812.8 1,016.00	?
35	COOLANT ? <i>nec</i>	6	\$ 212.64 266.00	?
36	FRONT FENDER CONNECTING PLATE - RH ?	2	\$ 217.00	✗ ?
37	WATER RESERVOIR ?	1	\$ 251.00	✗ ?
38	FRONT WINDSCREEN <i>cracked</i>	1	\$ 147.00	900 117.6 1,125.00 147.5
39	FRONT WINDSCREEN FOIL <i>free</i>	1	\$ 1,125.00	147.
40	FRONT WINDSCREEN RETAINING SPRING	1	\$ 137.00	✓
SUB-TOTAL SPARE PARTS		:	\$ 15,912.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	FRONT WINDSCREEN SPRING CLIP <i>new</i>	1	\$ 21.00	16.56
42	PRIMER <i>new</i>	1	\$ 20.00	15.76
43	FRONT DOOR - RH <i>Dented</i>	1	\$ 3,192.00	2553.6
44	FRONT DOOR OUTER SEAL - R <i>new</i>	1	\$ 205.00	164
45	BONDING AGENT ?	1	\$ 49.00	?
46	CLEANING SOLUTION	1	\$ 68.00	?
47	APPLICATOR ?	1	\$ 8.00	?
48	BUNGS <i>new</i>	1	\$ 4.00	+
49	FRONT DOOR ATTACHMENT PARTS <i>new</i>	1	TBC	+
50	FRONT DOOR CATCH - RH ?	1	\$ 105.00	29.84
51	TYRE PRESSURE STICKER <i>new</i>	1	\$ 38.00	
52	FRONT WINDOR REGULATOR - RH	1	\$ 282.00	+
53	FRONT WINDOR REGULATOR MOTOR - RH <i>new</i>	1	\$ 313.00	+
54	REAR VIEW MIRROR <i>new</i>	1	\$ 1,079.00	+
55	REAR VIEW MIRROR TOP COVER ?	1	\$ 32.00	?
56	FRONT MIRROR MOUNTING - RH ?	1	\$ 897.00	?
57	FRONT RIM - RH <i>ht</i>	1	\$ 1,690.00	1352
58	FRONT SUB FRAME ?	1	\$ 1,891.00	?
59	FRONT WISHBOON LINK - RH <i>Bent</i>	1	\$ 539.00	430.8
60	FRONT SUSPENTION GUIDE - RH <i>Bent</i>	1	\$ 943.00	754.4
SUB-TOTAL SPARE PARTS		:	\$ 11,376.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APROVED
SPARE PARTS ARE SPECIAL NETT.

photo {

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

			DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS	
photo 61	FRONT UPPER ARM - RH <i>Best</i>	2	\$ 1,024.00	✓	818.4
62	FRONT WHEEL BEARING HOUSING - RH ?	1	\$ 968.00	?	774
photo 63	FRONT SWIVEL JOINT - RH <i>Best</i>	1	\$ 193.00	✓	154.4
64	FRONT WHEEL HUB - RH ?	1	\$ 479.00	?	383.2
photo 65	FRONT WHEEL BEARING - RH <i>Good</i>	1	\$ 246.00	✓	196.8
66	FRONT SUSPENSION FORKS - RH <i>Best</i>	1	\$ 264.00	✓	
67	FRONT COUPLING ROD - RH <i>Best</i>	1	\$ 127.00	✓	
68	FRONT ANTI ROLL BAR ?	1	\$ 433.00	✗	?
69	FRONT DRIVE SHAFT - RH ?	1	\$ 2,650.00	✗	?
photo 70	FRONT SHOCK ABSORBER - RH <i>Best</i>	1	\$ 301.00	✓	240.40
71	FRONT STEERING RACK ?	1	\$ 6,787.00	??	
72	FRONT TRACK ROD - RH ?	1	\$ 99.00	?	78.88
73	FRONT TIE ROD END - RH ?	1	\$ 197.00	?	157.2
74	FRONT LOWER NOISE INSULATION ?	1	\$ 572.00	?	
75	FRONT DOOR WINDOW CHROME SLOT SEAL - RH <i>New</i>	1	\$ 307.00	+	
76	ACRYLIC SEALANT ?	S/N	\$ 180.00	✗	?
77	CAVITY WAX ?	S/N	\$ 140.00	✗	?
78	METAL FILER POWER ?	S/N	\$ 280.00	✗	?
79	STONE CHIPS ?	S/N	\$ 180.00	✗	?
80	FRONT WINDSCREEN SEALANT <i>New</i>	S/N	\$ 200.00	✓	200
81	SUNDRIES ?		\$ 500.00	?	362.96
TOTAL SPARE PARTS		:	\$ 47,713.00		
TOTAL LABOUR CHARGES		:	\$ 24,794.00		
GRAND TOTAL		:	\$ 72,507.00		

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME

:

Adrian Lj
02/09/21.

SURVEYED DATE

:

AUTHORISED DATE

:

EXCESS COST

:

LIABILITY

:

REMARKS

:

Not Authorised, 12 Days inclusive of Car-O-liner measurement.

PLEASE NOTE

:

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate

Denise

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0719/2021/JT

9-Sep-21

CHANG


1 of 1

SDZ 612 A

AUDI A4 SEDAN 2.0 TFSI

Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	HEADLIGHT WASHER PIPE <i>ut</i>	\$ 39.00	<u>30.80</u>
GRAND TOTAL		\$ 39.00	

For Premium Automobiles Pte Ltd

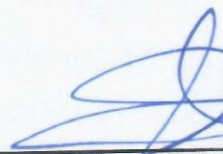
Authorised Signature

Adrian Ling
10/09/21
sls


Car - n

6/9/21 -

wip = 42281.

PREMIUM AUTOMOBILES

Kiam/Hong



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER Distorted	1	\$ 1,787.00	✓
2	FRONT BUMPER FIXING PARTS see	1	TBC	X
3	FRONT BUMPER SECURING STRIP Missing	2	\$ 71.00	✓
4	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE ?	1	\$ 210.00	?
5	FRONT BUMPER AIR GUIDE - RH Del'd	1	\$ 63.00	✓
6	FRONT BUMPER AIR GUIDE GRILLE - RH ?	1	\$ 365.00	?
7	FRONT BUMPER GUIDE SECTION - RH Dam'd	1	\$ 38.00	✓
8	HORN - RH	1	\$ 126.00	+
9	HORN BRACKET - RH	1	\$ 29.00	✓
10	FRONT FENDER - RH Distorted	1	\$ 767.00	✓
11	FRONT FENDER ATTACHMENT PARTS	1	\$ 202.00	?
12	FRONT FENDER CLOSING ELEMENT Best	1	\$ 72.00	✓
13	FRONT FENDER TOP BRACKET - FRONT RH Best	1	\$ 35.00	✓
14	FRONT FENDER DEFORMATION BRACKET - RH Best	1	\$ 49.00	✓
15	RIVET see	6	\$ 20.00	✓
16	FRONT FENDER TOP BRACKET - REAR RH Best	1	\$ 32.00	✓
17	FRONT FENDER BRACE - RH Best	1	\$ 118.00	✓
18	FRONT WHEEL HOUSING LINER - RH Del'd	1	\$ 241.00	✓
19	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS ?	1	TBC	?
20	FRONT WHEEL SPOILER Deformed	1	\$ 73.00	✓
SUB TOTAL SPARE PARTS		:	\$ 4,298.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES




55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT WHEEL SPOILER TRIM - RH <i>cracked</i>	1	\$ 36.00	✓
22	FRONT FENDER STONE CHIP GUARD - RH <i>new</i>	1	\$ 51.00	✓
23	FRONT FENDER TOP COVER - RH <i>cracked</i>	1	\$ 31.00	✓
24	FRONT HEADLIGHT CORNER COVER - RH <i>cracked</i>	1	\$ 23.00	✓
25	BONNET <i>Dented</i>	1	\$ 3,246.00	✓
26	BONNET ATTACHMENT PARTS <i>new</i>	1	\$ 412.00	✗
27	BONNET HINGE - LH / RH <i>new</i>	2	\$ 610.00	✓
28	BONNET IMPACT PROTECTOR - LH / RH / CENTER <i>new</i>	1	\$ 84.00	✓
29	BONNET STRIKER <i>new</i>	1	\$ 50.00	+
30	BONNET LOCK	1	\$ 214.00	+
31	HEADLIGHT - RH <i>cracked</i>	1	\$ 7,693.00	✓
32	HEADLIGHT LIFT CYLINDER - RH ?	1	\$ 210.00	?
33	HEADLIGHT LIFT CYLINDER HOSE <i>new</i>	1	\$ 93.00	+
34	LOCK CARRIER <i>cracked</i>	1	\$ 1,016.00	✓
35	COOLANT <i>new</i>	6	\$ 266.00	✓
36	FRONT FENDER CONNECTING PLATE - RH ?	2	\$ 217.00	?
37	WATER RESERVOIR ?	1	\$ 251.00	?
38	FRONT WINDSCREEN <i>cracked</i>	1	\$ 147.00	1125
39	FRONT WINDSCREEN FOIL <i>new</i>	1	\$ 1,125.00	147.
40	FRONT WINDSCREEN RETAINING SPRING	1	\$ 137.00	✓
SUB-TOTAL SPARE PARTS		:	\$ 15,912.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES		REMARKS
			S/NETT		
41	FRONT WINDSCREEN SPRING CLIP <i>new</i>	1	\$	21.00	✓
42	PRIMER <i>new</i>	1	\$	20.00	✓
43	FRONT DOOR - RH <i>Dented</i>	1	\$	3,192.00	✓
44	FRONT DOOR OUTER SEAL - R <i>new</i>	1	\$	205.00	✓
45	BONDING AGENT ?	1	\$	49.00	?
46	CLEANING SOLUTION	1	\$	68.00	?
47	APPLICATOR	1	\$	8.00	?
48	BUNGS <i>new</i>	1	\$	4.00	+
49	FRONT DOOR ATTACHMENT PARTS <i>new</i>	1		TBC	+
50	FRONT DOOR CATCH - RH ?	1	\$	105.00	✓ ?
51	TYRE PRESSURE STICKER <i>new</i>	1	\$	38.00	✓
52	FRONT WINDOR REGULATOR - RH	1	\$	282.00	+
53	FRONT WINDOR REGULATOR MOTOR - RH <i>new</i>	1	\$	313.00	+
54	REAR VIEW MIRROR <i>new</i>	1	\$	1,079.00	+
55	REAR VIEW MIRROR TOP COVER ?	1	\$	32.00	?
56	FRONT MIRROR MOUNTING - RH ?	1	\$	897.00	?
57	FRONT RIM - RH <i>new</i>	1	\$	1,690.00	✓
58	FRONT SUB FRAME ?	1	\$	1,891.00	?
59	FRONT WISHBOON LINK - RH <i>Best</i>	1	\$	539.00	✓
60	FRONT SUSPENSION GUIDE - RH <i>Best</i>	1	\$	943.00	✓
SUB-TOTAL SPARE PARTS			:	\$ 11,376.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SDZ 612 A

		DAMAGED PARTS & PRICES			
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS	
photo 61	FRONT UPPER ARM - RH <i>Best</i>	2	\$ 1,024.00	✓	
62	FRONT WHEEL BEARING HOUSING - RH	1	\$ 968.00	?	
photo 63	FRONT SWIVEL JOINT - RH <i>Best</i>	1	\$ 193.00	✓	
64	FRONT WHEEL HUB - RH	1	\$ 479.00	?	
photo 65	FRONT WHEEL BEARING - RH <i>Best</i>	1	\$ 246.00	✓	
66	FRONT SUSPENSION FORKS - RH <i>Best</i>	1	\$ 264.00	✓	
67	FRONT COUPLING ROD - RH <i>Best</i>	1	\$ 127.00	✓	
68	FRONT ANTI ROLL BAR	1	\$ 433.00	?	
69	FRONT DRIVE SHAFT - RH	1	\$ 2,650.00	?	
photo 70	FRONT SHOCK ABSORBER - RH <i>Best</i>	1	\$ 301.00	✓	
71	FRONT STEERING RACK	1	\$ 6,787.00	?	
72	FRONT TRACK ROD - RH	1	\$ 99.00	?	
73	FRONT TIE ROD END - RH	1	\$ 197.00	?	
74	FRONT LOWER NOISE INSULATION	1	\$ 572.00	?	
75	FRONT DOOR WINDOW CHROME SLOT SEAL - RH <i>new</i>	1	\$ 307.00	+	
76	ACRYLIC SEALANT	S/N	\$ 180.00	?	
77	CAVITY WAX	S/N	\$ 140.00	?	
78	METAL FILER POWER	S/N	\$ 280.00	?	
79	STONE CHIPS	S/N	\$ 180.00	?	
80	FRONT WINDSCREEN SEALANT <i>new</i>	S/N	\$ 200.00	✓	
81	SUNDRIES	\$	500.00	?	
TOTAL SPARE PARTS		:	\$ 47,713.00		
TOTAL LABOUR CHARGES		:	\$ 24,794.00		
GRAND TOTAL		:	\$ 72,507.00		

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate - 2

GST Reg No. 19-9902271-W

Deise.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0719/2021/JT

13-Sep-21

CHANG

1 of 1

SDZ 612 A

AUDI A4 SEDAN 2.0 TFSI

Quantity	Description	Unit Price	Amount
Parts			
1	FRONT TYRE - RHS <i>torn</i>		<i>370</i>
2	SUSPENSION STRUT DOME - RH ?	\$ 370.00	? X
3	SUSPENSION CONSOLE - RH ?	\$ 1,912.00	? X
		\$ 472.00	
GRAND TOTAL		\$ 2,754.00	

For Premium Automobiles Pte Ltd

Adrian Ling
13/09/21.
Resurveyed
R/S.



Authorised Signature