

*Kenneth*

**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OO / TP / WS / TP RES / QD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s Optima

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

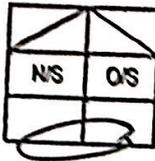

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Report: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 6-8 days Res.: Yes or No

Lum Sum: 1-B.1 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: SMN 3682J Yr Regn: 08, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or \_\_\_\_\_ : Wagon  
Make: Toy Noah c.c. 1797

Colour: Black AC: Insured / Std / NI / NA

Sp. Reading: 145368 T/Radio: Insured / Std / NI / NA

Eng No: \_\_\_\_\_  
C.No: ZWR 80 0389578

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: NI / S/Rim / STD A/Rim or

Tyre Size: F: \_\_\_\_\_

R: 195/65R15

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUNII

TOYO / YOKO or Sunwide

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Sal. 7 mm R/Sal. 7 mm

L/Sal. 7 mm L/Sal. 7 mm

D.O.A. 18/21 D.O.I. 1/9/2021

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1 GIA not ready

LMP SUM \$7650, 6DAYS  
(red: 7472, 18:49%)

Date/Time, File Pass to?

: Prell. Report  
 : Final Report

Days Of Repair: 6

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee:

Transportation:

\_\_\_\_\_ \$ - RS. \_\_\_\_\_ \$

Fuel:

Others:

TOTAL

Add Fee:  : Site Insp (\$ \_\_\_\_\_)

: Interview (\$ \_\_\_\_\_)

: Tech Invs (\$ \_\_\_\_\_)

: Weekend (\$ \_\_\_\_\_)

Report Format :

Lump Sum / I.B.I. (\$ \_\_\_\_\_)

*Not Authored  
Resurvey B4 paint*

Date: 31.08.2021  
Vehicle No: SMN3682J  
Model: TOYOTA NOAH HYBRID 1.8X CVT  
Chassis: ZWR800389578  
Reg.Year: 2019

Third Party Insurer: CHN TAIPING  
Third Party Veh No: CB692R  
Date of Accident: 31.08.2021  
Estimator: VICTOR  
Surveyor:

## ESTIMATE

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	TAILGATE	1		\$1,988.80
2	TAILGATE CHROME MOULDING	1		\$832.00
3	REAR TAILGATE "HYBRID" EMBLEM	1		\$85.80
4	REAR TAILGATE INNER TRIM	1		\$570.00
5	REAR TAILGATE INNER LOCK	1		\$495.20
6	REAR WEATHERSTRIP	1		\$280.60
7	REAR WINDSCREEN	1		\$1,290.00
8	REAR WINDSCREEN MOULDING	1		\$116.00
9	TAILLAMP LH	1		\$912.00
10	TAILLAMP RH	1		\$912.00
11	REAR BUMPER	1		\$823.00
12	REAR BUMPER SIDE BRACKET LH	1		\$156.70
13	REAR BUMPER SIDE BRACKET RH	1		\$156.70
14	REAR BUMPER REFLECTOR LH	1		\$38.40
15	REAR BUMPER REFLECTOR RH	1		\$124.80
16	REAR TAIL LAMP LOWER GARNISH PANEL LH	1		\$197.80
17	REAR TAIL LAMP LOWER GARNISH PANEL RH	1		\$197.80
18	REAR TAIL LAMP LOWER GARNISH PANEL BRACKET LH	1		\$115.20
19	REAR TAIL LAMP LOWER GARNISH PANEL BRACKET RH	1		\$115.20
20	END PANEL	1		\$914.60
21	END PANEL TOP COVER	1		\$207.30
22	REAR SPARE TYRE PANEL	1		\$698.00
23	REAR SPARE TYRE PANEL TOP BOARD	1		\$830.00
24	REAR SPARE TYRE INNER TRIM	1		\$630.00
25	REAR QUARTER PANEL INNER TRIM LH	1		\$482.00
26	REAR QUARTER PANEL INNER TRIM RH	1		\$482.00
27	REAR TOP INNER TRIM LH	1		\$342.00
28	REAR TOP INNER TRIM RH	1		\$342.00
29	REAR TOP INNER TRIM CENTER	1		\$427.00
SUB TOTAL				\$14,762.90
LESS 25%				-\$3,690.73
PARTS TOTAL				\$11,072.18

*Handwritten checkmarks and 'X' marks in the right margin of the estimate table.*

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	REAR TAILGATE INNER TRIM CLIPS	1		\$120.00

*Handwritten 'Gain' next to the special nett table.*

Head office  
6 Kung Chong Road Singapore 150143  
Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch  
9A Serangoon North Ave 5 Singapore 554500  
Tel: (+65) 6484 9919 | Fax: (+65) 6481 1003

Branch (Motor Insurance Claims)  
Blk 10 Ang Mo Kio Ind. Park 2A #01-05 Singapore 568047  
Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



Date: 31.08.2021  
Vehicle No: SMN3682J  
Model: TOYOTA NOAH HYBRID 1.8X CVT  
Chassis: ZWRS00389578  
Reg.Year: 2019

Third Party Insurer: CHN TAIPING  
Third Party Veh No: CB692R  
Date of Accident: 31.08.2021  
Estimator: VICTOR  
Surveyor:

2	REAR WINDSCREEN SEALANT	1	Me	\$100.00	4052
3	END PANEL JOINT SEALANT	1		\$80.00	7
4	REVERSE SENSOR	1	Not	\$300.00	20012
5	REAR BUMPER CLIPS	1	Me	\$50.00	✓
6	END PANEL TOP COVER CLIPS	1		\$35.00	7
7	REAR LICENSE PLATE WITH HOLDER	1	Me	\$65.00	X
				S/N TOTAL	\$750.00

**LABOUR CHARGES:**

LABOUR CHARGES TO REMOVE, REPLACE, REFIX & REPAIR REAR ACCIDENT AREA.	\$1,200.00	7
LABOUR CHARGES TO SUPPLY PAINT & FURNISHING MATERIALS AT REAR ACCIDENT AREA.	\$1,400.00	8001
LABOUR CHARGES TO REMOVE & REFIX REAR WINDSCREEN GLASS.	\$150.00	1201
LABOUR CHARGES TO REMOVE & REINSTALLED REAR TAILGATE INNER MECHANISM.	\$120.00	601
LABOUR CHARGES TO REMOVE & REPLACE REVERSE SENSOR.	\$100.00	501
TO CONDUCT DIAGNOSTIC, RESET FAULT CODE & MEMORY.	\$150.00	7
TO CHECK WIRING & CENTRAL LOCKING SYSTEM.	\$80.00	201
TO TUFF COAT AND UNDERSEAL MATERIAL.	\$100.00	?
<b>LABOUR TOTAL</b>		<b>\$3,300.00</b>

Vic	<p><b>LKK Auto Consultants hence notify the Repairer of the following:</b></p> <ul style="list-style-type: none"> <li>To resurvey before/after spray painting</li> <li>To display damaged part(s) during resurvey</li> <li>Parts prices are subject to confirmation</li> <li>Third party survey is on a "Without Prejudice" basis</li> <li>No illegal modification(s) is allowed</li> <li>Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company</li> </ul> <p>Acknowledged by Repairer Signature: Date:</p>	<b>TOTAL</b>	<b>\$15,122.18</b>
-----	--	--------------	--------------------

Head office

6 Kung Chong Road Singapore 156143  
Tel: 1-651 6472 1313 | Fax: 1-651 6472 2112

Branch

6A Serangoon North Ave 5 Singapore 554500  
Tel: 1-651 6484 0010 | Fax: 1-651 6481 1003

Branch (Motor Insurance Claims)

Blk 10 Ang Mo Kio Ind Park EA #01-05 SINGAPORE 68047  
Tel: 1-651 6481 1520 | Fax: 1-651 6481 1011

