

# AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters  
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810  
 E-mail Address: aasschee@singnet.com.sg  
 Tel: 96623655, 67655661, Fax: 67655662  
 RCB No. 43037800M

## ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
<b>LABOUR CHARGES</b>			
01. Labour charges - R & R front windscreen glass	200.00	Necessary  Reason being: 01. To remove and refit front windscreen glass to facilitate the repair.	200.00 <b>150</b>
02. Labour charges - R & R front dashboard	350.00	Necessary  Reason being: 01. To remove and refit front dashboard assy, instrumental panel and etc to facilitate the repair.	350.00 <b>150</b>
03. Labour charges - R & R air-con.	240.00	Not Necessary  Reason being: 01. Not necessary to remove and refit the air-con blower, cooling coil, piping hoses and etc to facilitate the repair.	0.00 <b>xnn</b>
04. Labour charges - Panel beating	1,250.00	Necessary  Reason being: 01. To remove damaged parts and attachments, jack and cut out damaged panels, rerpair and reshape dented panels, renew damaged panels (refer to our recommendations) align and weld into position, renew damaged parts (refer to our recommendations), align and refit attachments.	1,000.00 <b>600</b>
	----- 2,040.00		----- 1,550.00

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES **900**

  
 CHEE AIK THUAN (HP. 96623655)  
 ENG TECH, CAE MIMI / AM SAE-A  
 MSAAA/Accident Damage Appraiser

# AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters  
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810  
 E-mail Address: aasschee@singnet.com.sg  
 Tel: 96623655, 67655661, Fax: 67655662  
 RCB No. 43037800M

## ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

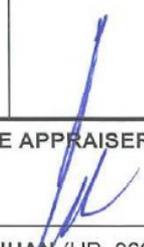
Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
<b>LABOUR CHARGES</b>			
Carried forward from page 3/5	2,040.00		1,550.00
05. Labour charges - Spray painting	1,200.00	Necessary  Reason being: 01. To respray paint on front windscreen glass LH pillar, front LH door, door pillar, LH wheel arch panel; and other affected areas.	900.00 <b>600</b>
06. Labour charges - Anti rust proofing	150.00	Necessary  Reason being: 01. To apply and respray anti-rust proofing.	100.00 <b>50</b>
07. Labour charges - Electrical system.	30.00	Necessary  Reason being: 01. To check wiring, lighting system and conduct water leak test.	30.00 <b>/</b>
	----- <b>3,420.00</b> -----		----- <b>2,580.00</b> -----

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

**680**

  
 \_\_\_\_\_  
**CHEE AIK THUAN** (HP. 96623655)  
 ENG TECH, CAE MIMI / AM SAE-A  
 MSAAA/Accident Damage Appraiser

# AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters  
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810  
 E-mail Address: aasschee@singnet.com.sg  
 Tel: 96623655, 67655661, Fax: 67655662  
 RCB No. 43037800M

## ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
<b>CARRIED FORWARD FROM PAGE 2/5</b>			
Replacement of damaged panels/parts	37,146.05		13,145.31
<b>CARRIED FORWARD FROM PAGE 4/5</b>			
Labour Charges	3,420.00		2,580.00
	-----		-----
	<b>40,566.05</b>		<b>15,725.31</b>
	-----		-----
		<b>LUMP SUM</b>	<b>12,550.00</b>
			=====

**NOTE:**

Please refer to our recommendations of **S\$ 15,725.31**

In our opinion, the vehicle can be repaired at a Lump Sum of S'pore Dollars: **Twelve Thousand, Five Hundred And Fifty Only.**

(S\$ 15,725.31 x 20% (S\$ 3,145.06) = S\$ 12,550.00

**LUMP SUM CONTRACT**

In view of the fact that the repairer has been offered a reduced budget to complete the repair. **(TOTAL REVISED LESS ANOTHER 20%)**, the repairer should be entitled to exercise some discretion to complete the repair.

- a. To replace with New Parts (Genuine or Non Genuine Parts)
- b. To replace with Second Hand Parts (Imported or local Used Parts)
- c. To repair

The repairer would repair the vehicle to the entire satisfaction of the owner and in 'road worthy' condition.

The above terms and condition for the **LUMP SUM REPAIR CONTRACT** (Accident-Damaged Vehicle) is in line with the circular through a referendum from the Singapore Automobile Appraisers Association dated 25 May 2004.

Please find enclosed

- a. Letter from the Singapore Automobile Appraisers Association dated 25 May 2004
- b. Letter from The General Insurance Association Of Singapore dated 28 June 2004.
- c. Letter from the General Insurance Association Of Singapore dated 08 September 2005
- d. The New Paper reply from NTUC Income dated 19 September 2003.

**AUTOMOTIVE APPRAISER AND SURVEYING SERVICES**

  
 CHEE AIK THUAN (HP. 96623655)  
 ENG TECH, CAE MIMI / AM SAE-A  
 MSAAA/Accident Damage Appraiser

**4458.50**  
**27.00**  
**900.00**  
**680.00**

**6065.50**

**20%**

**4852.40**

**L/S-\$4,850/5 DAYS**