

ASS. REC. BY:

TGM

REF:

CC4/LPC21009355/CS3

Asher

ASSIGNMENT

From:

Date: 7/9/2021

Veh No:

SJN 8866Z

Yr Regn: 1/2/2008

Estimated Cost:

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /☒ OD / ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or

To Inspect Vehicle No: SJN 8866Z

Make:

Mercedes Benz S350 c.c. 3498

at Workshop m/s Accident Assist Sq.

Colour

Black

N/C: Insured / Std / NI / NA

of 24 Sia Ping Lane #01-94 Midview City

Sp. Reading

80101

T/Radio: Insured / Std / NI / NA

Insured:

Eng/No:

27296530737970

Policy No.

C/No:

WDD221562A174717

Claims No.

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Sum Insured:

Excess:

Steering: ☒ In order / Jammed / Leaked / Burnt or

(Client's Record)


Brake: ☒ In order / Jammed / Leaked / Burnt or

Make of Veh:

Modi: ☒ Nil / S/Rim / STD A/Rim or

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

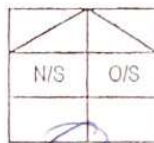

Bal. or Market Value:

64,000/-

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

5

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS WP

Vehicle: IN / OUT

Date:

Person Contacted:

Tyre Size:

F: 235/55/17

R: 235/55/17

BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MG / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

5

mm

R/Bal.

5

mm

L/Bal.

5

mm

L/Bal.

5

mm

D.O.A.

27/8/2021

D.O.I.

7/9/2021

Survey held at

Accident Assist

Des. of Damages: Frt / ☒ Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Range 6,000/- - 7,000/-

Recommended COR B\$ 6250.00

MV 64,000/-

PV 32,922/-

NV 31,078/-

Return M

13/10/2021

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS SI

Photos

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Report Format:

Lump Sum / L.B.I. (\$

Accident Assist SG

24 Sin Ming Lane #01-94 Midview City Singapore 573970

Tel: 6334 1182 Email: management@assist.com

Registration no. : SJN8866Z / Mercedes Benz S350 L A

Date : 03-Sep-21

Estimate No. : AAS006_SJN8866Z_S350

S/N	Qty	Item	Amount
-----	-----	------	--------

LIST ITEMS

1	1	Bootlid	2086.00	DD✓
2	1	Bootlid weatherstrip	420.00	NDX
3	1	Bootlid inner lock	485.00	JMV
4	1	Bootlid logo	145.00	} NEC
5	1	Bootlid emblem 'S350'	112.00	
6	1	Bootlid outer garnish chrome	220.00	NDX
7	1	Taillamp @ SGD 1186.00	723.00	BR✓
8	2	Taillamp lower bracket @ SGD 166.00	332.00	NDX
1	2set	Taillamp outer garnish @ SGD 190.00	380.00	NDX
2	1	Rear bumper	2245.00	DD✓
3	2	Rear bumper side retainer @ SGD 138.00	276.00	NECV
4	2	Rear bumper side bracket @ SGD 142.00	284.00	NNX
5	1	Rear bumper centre bracket	295.00	NNX
5	1	Rear bumper reinforcement	859.00	DD✓
7	2	Rear bumper sensor (ORI) @ SGD 460.00	450.00	SCV
8	1set	Rear bumper sensor ring	145.00	NECV
1	1	Rear bumper tow cover	78.00	NDX
2	1	Rear end panel	1208.00	DD✓
3	1	Rear end panel top garnish	417.00	BR✓
4	1	Rear spare tyre well	1486.00	NDX
5	1	Rear spare tyre top board	385.00	NNX
			7,423.90	16970.00
			Less 10%	742.39
				1697.00
				6681.51
				15273.00

SPECIAL NETT ITEMS

1	1	Sundries	80.00	NNX
2	1	Bootlid sealant	100.00	NNX
3	2set	Taillamp clips LH	20.00	NECV
4	2	Taillamp seal LH	20.00	NECV
5	1set	Rear bumper clips	30.00	NECV
6	1	Rear end panel sealant	30.00	NECV
7	1set	Rear end panel top garnish clips	30.00	NECV
8	1	Rear spare tyre well sealant	100.00	NNX
			130.00	650.00

PART TOTAL

17620.00

Accident Assist SG

24 Sin Ming Lane #01-94 Midview City Singapore 573970

Tel: 6334 1182 Email: management@assist.com

Registration no. : SJN8866Z / Mercedes Benz S350 L A
Date : 03-Sep-21 Estimate No. : AAS006 SJN8866Z S350

S/N	Qty	Item	Amount
-----	-----	------	--------

LABOUR & MISC CHARGES

1	1	Panel beating and strenghten parts on rear accident area.	600.00	1500.00	✓
2	1	Check wiring system after disconnect and connect.		80.00	NX
3	1	R&R interior upholstery.		200.00	} NX
4	1	To apply undercoating for rust roofing.		200.00	
5	1	Spray painting on rear accident area.	400.00	1000.00	✓
LABOUR TOTAL			1,000.00	2980.00	

Total Parts and Labour Cost of Repair			20600.00
---------------------------------------	--	--	----------

Survey 7/9/2021 1254 hrs TGU in Min
Resurvey 8/9/2021 1512 hrs TGU in Min
Lump Sum repair Repair days 5

Parts 6,681.51
SN 130.00
Labour 1,000.00
7,811.51
@ 20% 1,562.30
6249.21

LS 6,250/2

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: