



**Auto Insure Pte. Ltd.**  
6 Marsiling Lane  
Singapore (739145)  
E: claims01@autoinsure.com.sg  
W: www.autoinsure.com.sg  
T: 3157 2626 F: 6368 0081  
**GST No.: 201437380M**

**Page No.1**

**AUTOMOBILE ASSESSMENT REPORT**

Our Ref: **SLK9943U (SIEW)**  
Your Ref: **SLS9774Z**

Date: **7-Sep-21**

BY EMAIL ONLY  
(claims01@autoinsure.com.sg)

**ATTENTION: MOTOR CLAIMS DEPT**

**INDIA INTERNATIONAL INSURANCE PTE LTD**

64 CECIL STREET  
#04-00 IOB BUILDING  
SINGAPORE : 049711

**Assessed Vehicle No : SLK9943U**  
**Car Make and Model : TOYOTA COROLLA ALTIS 1.6 CVT**  
**Date of Accident : 5-Sep-21**  
**Date of Assessment : 7-Sep-21**

We have carried out a physical assessment of SLK9943U at our workshop Auto Insure Pte Ltd sustained damages to the FRONT & REAR portion of the vehicle.


**4. DESCRIPTION OF DAMAGE**

At the time of the inspection observed that this vehicle had sustained damages to the FRONT & REAR portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

Estimated Amount : L/S  
Adjusted Amount : \$ 17,600.00  
Est. Repair Days : 9

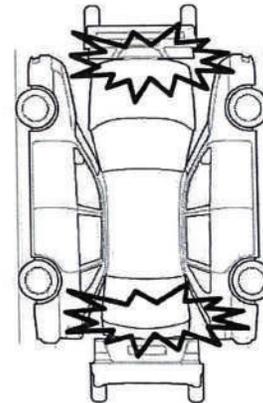

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.  
The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

**Disclaimer**

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

**AUTO INSURE PTE. LTD.** For any reliance on this report by any third party.

Our Ref: SLK9943U

Your Ref: SLS9774Z

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
<b>PARTS REPLACEMENT - LIST ITEMS</b>				
1	1	FRONT GRILLE ?		\$ 385.90
2	1	FRONT GRILLE LOGO ?		\$ 75.30
3	1	HEADLAMP RH <i>ca</i>		\$ 1,866.50
4	1	HEADLAMP LH <i>X</i>		\$ 1,866.50
5	1	FRONT BUMPER <i>repair</i>		\$ 738.10
6	1	FRONT BUMPER SPONGE ?		\$ 155.30
7	1	FRONT BUMPER REINFORCEMENT <i>X</i>		\$ 332.90
8	1	FRONT SUPPORT PANEL UPPER <i>X</i>		REPAIR
9	1	HEADLAMP PANEL RH <i>X</i>		REPAIR
10	1	FRONT SUPPORT BRACE PANEL <i>X</i>		\$ 115.30
11	1	AIR CON CONDENSER <i>X</i>		\$ 1,235.90
12	1	REAR FENDER RH <i>X</i>		REPAIR
13	1	REAR FENDER LH <i>X</i>		REPAIR
14	1	REAR BOOT LID <i>bt</i>		\$ 1,165.30
15	1	REAR BOOT LID LOGO <i>ne</i>		\$ 75.30
16	1	REAR BOOT LID CHROME ?		\$ 388.90
17	1	REAR BOOT LID REVERSE LAMP RH <i>X</i>		\$ 625.30
18	1	REAR BOOT LID REVERSE LAMP LH <i>ca</i>		\$ 625.30
19	1	REAR BOOT LID HINGE RH <i>X</i>		\$ 189.50
20	1	REAR BOOT LID HINGE LH <i>X</i>		\$ 189.50
21	1	REAR BOOT LID LOCK <i>X</i>		\$ 285.10
22	1	REAR TAIL LAMP RH <i>X</i>		\$ 838.50
23	1	REAR TAIL LAMP LH <i>X</i>		\$ 838.50
24	1	REAR TAIL LAMP PANEL RH <i>X</i>		\$ 269.10
25	1	REAR TAIL LAMP PANEL LH <i>X</i>		\$ 269.10
26	1	REAR BUMPER <i>de</i>		\$ 685.90
27	1	REAR BUMPER SIDE RETAINER RH <i>X</i>		\$ 53.10
28	1	REAR BUMPER SIDE RETAINER LH <i>X</i>		\$ 53.10
29	1	REAR BUMPER REINFORCEMENT <i>bt</i>		\$ 421.30
30	1	REAR BOOT LID WEATHERSTRIP <i>ne</i>		\$ 195.60
31	1	REAR END PANEL <i>bt</i>		\$ 1,032.50
32	1	REAR END PANEL GARNISH <i>de</i>		\$ 266.90
33	1	REAR FENDER INNER TRIM LH <i>X</i>		\$ 585.10
			SUB TOTAL	\$ 15,824.60
			LESS 25%	\$ 3,956.15
			TOTAL AMOUNT	\$ 11,868.45

Our Ref: **SLK9943U**

Your Ref: **SLS9774Z**

S/NO	QTY	SPECIAL NETT ITEMS	ASSESSED CONDITION	EST. BY WORKSHOP
1	1	FRONT BUMPER CLIPS <del>20</del> X		\$ 50.00 X
2	1	FRONT NUMBER PLATE & HOLDER <del>50</del> X		\$ 60.00 X 50
3	1	AIR CON GAS X		\$ 100.00 X
4	1	REAR NUMBER PLATE & HOLDER <del>50</del> X		\$ <del>60.00</del> 30 50
5	1	REAR REVERSE CAMERA ?		\$ 350.00 250?
6	1	REAR BUMPER CLIPS <del>30</del> X		\$ <del>50.00</del> 30
7	1 SET	REAR BUMPER REVERSE SENSORS ?		\$ 250.00 200?
8	1	REAR TAIL LAMP PANEL SEALANT RH & LH X		\$ 100.00 X
9	1	REAR END PANEL SEALANT <del>40</del> X		\$ <del>80.00</del> 40
			SUB TOTAL	\$ 1,100.00
			TOTAL PARTS COST	\$ 12,968.45

Our Ref: **SKX1582Z**

Your Ref: **SLS9774Z**

S/NO	DESCRIPTION	EST. BY WORKSHOP
<b>LABOUR &amp; PAINTWORK</b>		
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ 1,200.00 700
2	TO REMOVE & REFIT WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS	\$ 100.00 X
3	TO CONDUCT DIGNOSIS FAULT CODE & RESET	\$ <del>150.00</del> 80
4	TO REMOVE & REFIT AIR CON CONDENSER & RADIATOR	\$ 120.00 X
5	TO REMOVE & REFIT REAR BUMPER REVERSE SENSORS & CAMERA	\$ <del>100.00</del> 60
6	TO REMOVE & REFIT UPHOSTERY, GARNISH AND ATTACHMENT PARTS	\$ <del>120.00</del> 60
7	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$ 1,500.00 800
8	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	\$ <del>60.00</del> 40
9	SUNDRIES (SAND PAPER, WELDING WIRE ETC.)	\$ <del>60.00</del> 20
10	TO VACUUM, WAXING & CLEAN	\$ 60.00 X
11	TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS	\$ <del>50.00</del> 30
TOTAL BEFORE GST		\$ 16,488.45
GST 7%		\$ 1,154.19
TOTAL (PARTS & LABOUR):		\$ 17,642.64

**Adjustments / Recommendations**

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a sum of \$ 17,600.00 for lump sum with the third party insurance.

Yours Faithfully,

Jason Heng  
Claims Director

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplemental repairs must be approved and is subject to final approval by the surveyor

Acknowledged by: \_\_\_\_\_  
Signature: \_\_\_\_\_  
Date: \_\_\_\_\_

Rasul  
Hp 90010068  
7 days  
L/S  
08/09/21 @ 1230  
Resurvey after repair