



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

QBE INSURANCE (SINGAPORE) PTE LTD
1 RAFFLES QUAY #29-10 SOUTH TOWER
SINGAPORE 048583

INV No. AC2202240
INV Date 18/04/2022
Reference CC6/QBE21009457/Aga3q2
Code QBE

PROFESSIONAL SERVICE FEE

Vehicle No. SGW 4128K
Insured Veh. SLC 8683T
Claim No. VC014732
Policy No. 8-V0014956-MVA-R004
Accident Date 04/09/2021
Inspection Date 06/09/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

QBE INSURANCE (SINGAPORE) PTE LTD
1 RAFFLES QUAY #29-10 SOUTH
TOWERSINGAPORE 048583

Ref: CC6/QBE21009457/Aga3q2

Date: 18/04/2022

Code: QBE

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLC 8683T	Veh. Inspected	SGW 4128K
Policy No.	8-V0014956-MVA-R004	Coverage (\$)	0.00
Claim No.	VC014732	Excess (\$)	0.00
Assign From		Assign Date	06/09/2021

2. Vehicle Particulars & Condition

Make & Model	HONDA STREAM	c.c	1799
Engine No.	HIDDEN	Year of Reg.	2007
Chassis No.	RN61038958	Colour	BRONZE
Odometer	183017 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/65 R15	MICHELIN	6 mm
L/H Front Tyre	205/65 R15	MICHELIN	6 mm
R/H Rear Tyre	205/65 R15	MICHELIN	6 mm
L/H Rear Tyre	205/65 R15	MICHELIN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	04/09/2021	Inspection Date	06/09/2021
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGW 4128K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	TAILGATE	DENTED	1,250.30	903.00
1	TAILGATE LOGO	NOT NECESSARY	62.00	-
1	TAILGATE EMBLEM 'STREAM'	NECESSARY	55.00	55.00
1	TAILGATE INNER LOCK	DISTORTED	194.60	194.60
1	TAILGATE WEATHERSTRIP	CUT	157.80	157.80
1	TAILGATE INNER BOARD	CRACKED	211.00	211.00
1	TAILGATE WINDSCREEN MOULDING	NECESSARY	133.00	133.00
1	REAR BUMPER	DEFORMED	633.20	633.20
1	REAR BUMPER TOWING COVER	DEFORMED	50.00	50.00
2	REAR BUMPER SIDE RETAINER @\$62.40	NECESSARY	124.80	124.80
1	TAILLAMP LH	CRACKED	412.00	358.00
1	REAR FENDER INNER TRIM LH	CRACKED	466.80	285.00
1	REAR END PANEL	DENTED	580.00	580.00
1	REAR END PANEL TOP GARNISH	CRACKED	160.00	160.00
	LESS 20% DISCOUNT		-898.10	-769.08
			3,592.40	3,076.32
<u>SPECIAL NETT ITEMS</u>				
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	20.00	20.00
1	SET TAILGATE INNER BOARD CLIP (SN)	NECESSARY	20.00	20.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	100.00	60.00
1	SET REAR FENDER INNER TRIM CLIP (SN)	NECESSARY	20.00	20.00
1	SET TAILLAMP CLIP (SN)	NECESSARY	20.00	20.00
1	SET REAR END PANEL TOP GARNISH CLUPS (SN)	NECESSARY	20.00	20.00
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	80.00	60.00
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			550.00	420.00
<u>LABOUR</u>				
	TO PANEL BEAT ,REMOVE AND REPLACE PARTS.		1,400.00	800.00
	TO SPRAY PAINT AFFECTED AREA.		1,400.00	800.00

Report Ref No. CC6/QBE21009457/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TUFF COAT.		250.00	60.00
	WIRING AND BULB CHECK .		180.00	30.00
	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR.		150.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		150.00	50.00
	REMOVE AND REFIX TAILGATE WINDSCREEN.		140.00	120.00
	TRANSFER TAILGATE MECHANISM .		120.00	60.00
			3,790.00	1,980.00
	GRAND TOTAL		7,932.40	5,476.32
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,000.00

Report Ref No. CC6/QBE21009457/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGW 4128K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

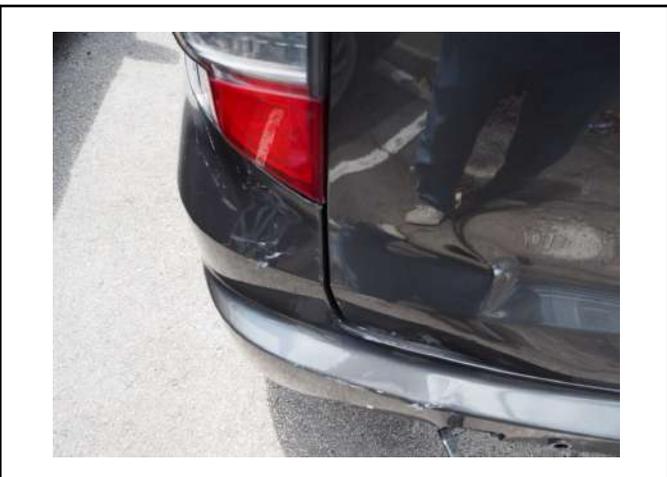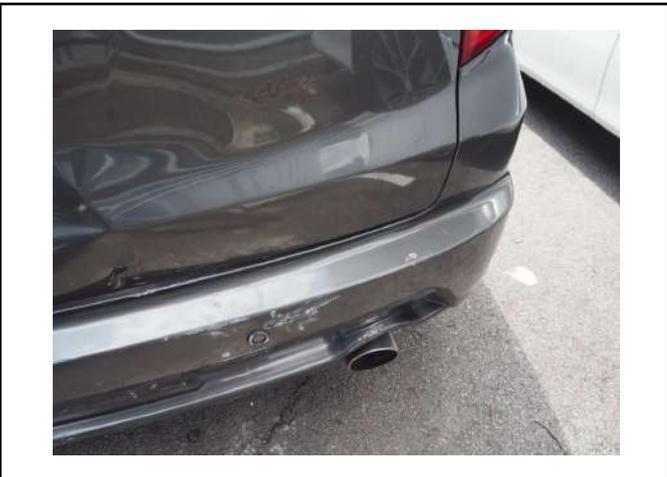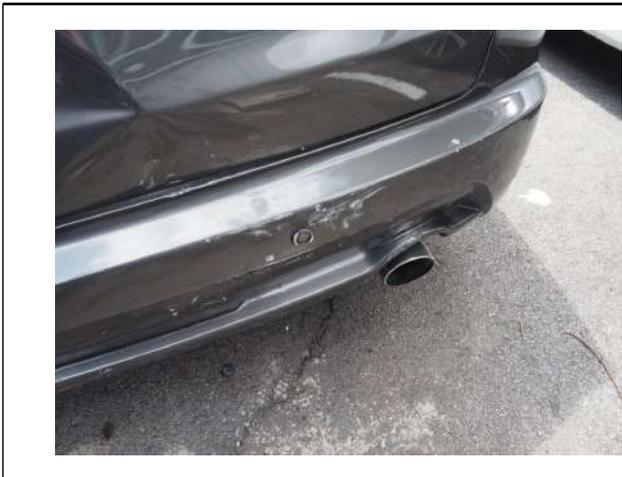



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGW 4128K

RE-INSPECTION

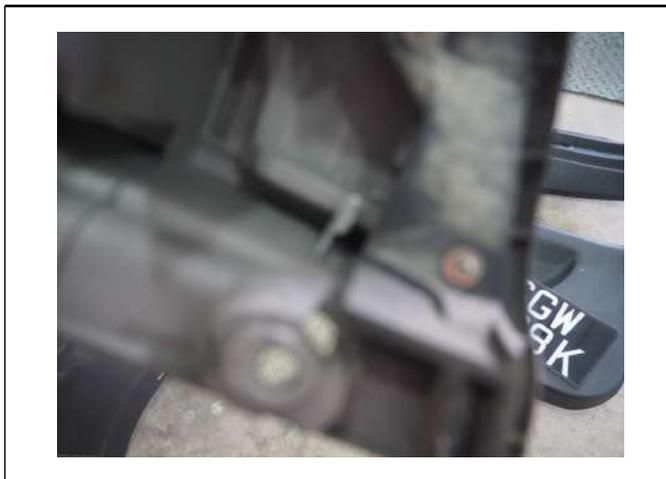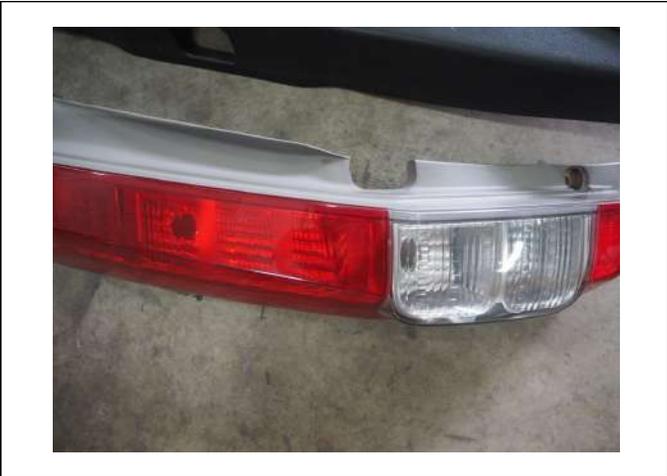



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

