



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2200557

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 27/01/2022
Reference CC6/CTI21009666/Ues3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLX 5773B
Insured Veh. GBA 850J
Claim No. SNM21D205263/C02
Policy No. DMCVSNW00073432102
Accident Date 14/09/2021
Inspection Date 15/09/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21009666/Ues3q2 Date: 27/01/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBA 850J	Veh. Inspected	SLX 5773B	
Policy No.	DMCVSNW00073432102	Coverage (\$)	0.00	
Claim No.	SNM21D205263/C02	Excess (\$)	0.00	
Assign From		Assign Date	15/09/2021	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN SYLPHY (A)	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	MNTBBAB17Z0031656	Colour	GREY	
Odometer	58166 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	BRIDGESTONE	7 mm	
L/H Front Tyre	205/60 R16	BRIDGESTONE	7 mm	
R/H Rear Tyre	205/60 R16	BRIDGESTONE	7 mm	
L/H Rear Tyre	205/60 R16	BRIDGESTONE	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	14/09/2021	Inspection Date	15/09/2021	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLX 5773B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOTLID	DENTED / BUCKLED	980.70	980.70
1	BOOTLID REAR LOGO	NECESSARY	58.00	42.50
1	BOOTLID 'SYLPHY' EMBLEM	NECESSARY	62.00	62.00
2	BOOTLID REFLECTORS @\$290.00	SCRATCHED / CRACKED	580.00	398.60
1	BOOTLID INNER TRIM	NOT NECESSARY	331.00	-
1	BOOTLID INNER LOCK	BENT	166.80	109.50
1	BOOTLID WEATHERSTRIP	TWISTED	185.50	185.50
1	BOOTLID LOWER CHROME	NOT FITTED	245.00	-
1	BOOTLID UPPER CHROME	CRACKED	311.90	311.20
1	REAR BUMPER	DENTED	845.20	679.90
1	SET REAR BUMPER SPONGE	TORN	244.50	145.00
2	REAR BUMPER SIDE RETAINERS @\$35.00	BENT	70.00	70.00
1	SET REAR BUMPER CLIPS	NECESSARY	45.00	35.00
2	REAR BUMPER DAMPERS @\$105.00	O/S DENTED	210.00	102.00
2	REAR BUMPER REFLECTORS @\$68.00	NOT NECESSARY	136.00	-
1	REAR END PANEL	DENTED	515.00	473.30
1	REAR END PANEL TOP GARNISH	TWISTED	286.90	162.30
1	REAR FENDER FLOOR PANEL	TO REPAIR SEE LABOUR	955.10	-
1	REAR FLOOR PANEL TOP BOARD	WARPED	627.20	494.30
1	REAR FLOOR PANEL TOOLS SPONGE	DEFORMED / WARPED	568.00	488.50
2	TAILLAMPS @\$380.00	CRACKED	760.00	730.00
1	REAR EXHAUST	NOT NECESSARY	668.00	-
2	REAR FENDER INNER TRIMS @\$288.00	CRACKED (1 PCS ONLY)	576.00	262.00
	LESS 10% DISCOUNT		-	-573.23
			9,427.80	5,159.07
<u>SPECIAL NETT ITEMS</u>				
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	50.00	-

Report Ref No. CC6/CTI21009666/Ues3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN INNER SEAL (SN)	NOT NECESSARY	50.00	-
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
			430.00	250.00
	LABOUR			
	TO CHECK WIRING .		50.00	30.00
	TO DISMANTLE & REPLACED REAR REVERSE SENSOR .		80.00	50.00
	TO TRANSFER BOOTLID MECHANISM .		100.00	60.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY .		120.00	80.00
	TO SPRAY RUST PROOFING.		100.00	60.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR FENDER FLOOR PANEL .		1,200.00	800.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	1,150.00
			3,150.00	2,230.00
GRAND TOTAL			13,007.80	7,639.07
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,100.00

Report Ref No. CC6/CTI21009666/Ues3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 5773B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

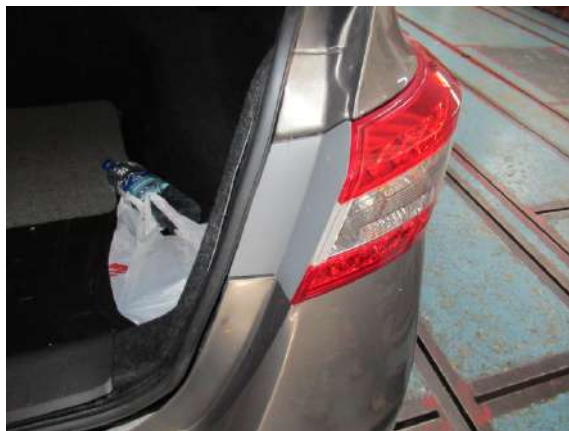



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 5773B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

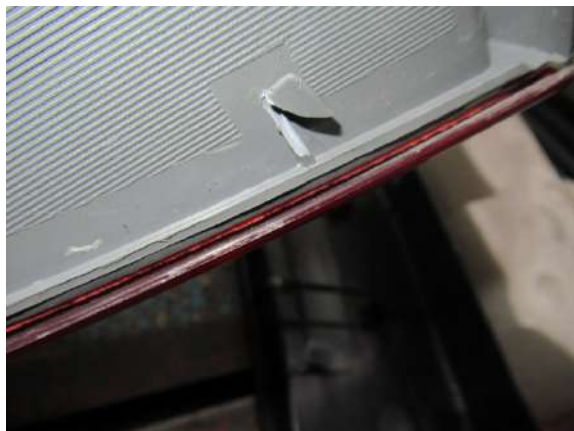



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 5773B

RE-INSPECTION

