

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

Type text here

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0780/2021/ZK
DATE : 22-Sep-21
WIP : 45399

Xiao Am.

\$155610.95.

45 Days.

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 22/9/2021

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR CHOY KAI GHIT BENJAMIN
ADDRESS : 359 CHOA CHU KANG AVE 3
#13-19
SINGAPORE 689883
TELEPHONE : HP +65 82236101
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 7210035130
VEHICLE NO : **SGN 1691 S**
MODEL CODE : Q5 S Line 2.0 TFSI
MODEL YEAR : 26/4/2021
ENGINE NO : DGK 002793
CHASSIS NO : WAUZZZFY0M2048930
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 20-Sep-21
PLACE OF ACCIDENT : NEAR 6 INTERNATIONAL BUSINESS PARK ROAD

 PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED FRONTAL LABOUR CHARGES FOR ACCIDENT VEHICLE SGN 1691 S

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO PLACE THE VEHICLE ON CAR-O-LINER TO FACILITATE THE REPAIR	S/N S	800.00	✓✓
2	TO PLACE THE VEHICLE ON CAR-O-LINER TO FACILITATE THE REPAIR	S/N S	2,400.00	✓✓
3	TO REMOVE CHECK TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS , OUTSIDE TEMPERATURE SNSOR, HEADLIGHT WASHER ASSY AND FRONT FRONT PARKING AID	S/N S	480.00	✓✓
4	TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N S	800.00 250	✓
5	TO RENEW AND REINSTALL AIRCON CONDENSER ADDITIONAL RADIATOR, RADIATOR, CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	S/N S	1,700.00	X
SUB TOTAL LABOUR CHARGES (FORNTAL)		:	\$	<u>6,180.00</u>

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED FRONTAL LABOUR CHARGES FOR ACCIDENT VEHICLE SGN 1691 S

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
6	TO DISMANTLE AND REINSTALL LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY TO FACILITATE RESPRAY OF LHS FRONT DOOR	S/N S	280.00 ✓	✓
7	TO RENEW FRONT WINDSCREEN TO FACILITATE RENEWAL OF RHS A-PILLAR.	S/N	TBC ✓	480
8	TO INSTALL SOLAR FILM FOR FRONT WINDSCREEN AND ALL THE AFFECTED DOOR WINDOW GLASS	S/N S	400.00 ✓	✓
9	TO CARRY OUT WATER SEEPAGE TEST FOR FRONT WINDSCREEN	S/N S	200.00 150 ✓	✓
10	TO REMOVE AND REPLACE FRONT WINDSCREEN SENSOR FOIL AND RESER SYSTEM	S/N S	300.00 ✓	✓
SUB TOTAL LABOUR CHARGES (FORNTAL)		:	<u><u>S 1,180.00</u></u>	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED FRONTAL LABOUR CHARGES FOR ACCIDENT VEHICLE SGN 1691 S

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
11	TO REMOVE AND RENEW LHS FRONT WHEEL SUSPENSION WITH SUBFRAME	S/N \$ 2,400.00	? ✓
12	TO REMOVE AND TRANSFER RHS FRONT DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGE	S/N \$ 400.00	280 ✓
13	TO REMOVE CENTER CONSOLE, INSTRUMENTS PANELS AND CLUSTERS. RENEW DASHBOARD SLIP RING. TRANSFER OLD FITTINGS. RENEW SEAT BELTS AND CONTROL UNIT, PILLAR TRIMS, ROOF LINING AND BOTH CURTAIN AIR BAGS.	S/N \$ 3,200.00	✓ ✓
14	TO REMOVE AND REINSTALL FRONT SEAT ASSY, BACK REST, CARPETS, ELECTRONIC COMPONENTS AND FUSE TRAYS. RENEW WHERE NECESSARY.	S/N \$ 1,800.00	✓ ✓
15	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, BOTH FRONT FENDER, RHS FRONT DOOR AND HEADLIGHT TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. TO CUT OUT AND WELD ROOFTOP PANEL, RHS A PILLAR, RHS UPPER A-PILLAR REINFORCEMENT, RHS SILL PANEL AND RHS B PILLAR. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	\$ 16,800.00	8500
SUB TOTAL LABOUR CHARGES (FORNTAL)		: \$ 24,600.00	

Hood (without replacement of roof and A pillar reinforcement)

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED FRONTAL LABOUR CHARGES FOR ACCIDENT VEHICLE SGN 1691 S

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
16	TO RESPRAY FRONT BUMPER, BOTH FRONT LOWER SPOILERS, BOTH FRONT FENDER, BONNET, HINGES, BOTH FRONT DOORS, DOOR COVER, DOOR HANDLE, RHS WING MIRROR COVER, RHS A - PILLAR, RHS SILL PANEL, RHS B - PILLAR, ROOFTOP PANEL, BOTH ROOF CHANNELS, DOOR ENTRANCES AND BOTH FRONT WHEEL ARCH TRIMS.	S 12,400.00 <i>6100</i> <i>7200</i>	Bumper 350 2 Fender = 1100 Bonnet = 550 2 Door = 1100 2 Door Cover = 400 Door Handle = 100 Mirror 100 Lower Spoiler 5150 A-pillar: 550 Roof: 825 2 Wheel Arch = 400 Rear Entrance: 275 <i>6100</i>
17	TO CARRY OUT CLEANUP FOR WINDOW GLASSES IN THE INTERIOR.	S/N S 280.00	✓
18	TO RENEW LHS FRONT RIM, RHS FRONT RIM AND RHS REAR RIM. TO CARRY OUT PRE/POST WHEEL ALIGNMENT.	S/N S 600.00	✓✓
19	TO REMOVE AND REINSTALL BOTH ROOFTOP RAIL. RENEW WHERE NECESSARY	S/N S 280.00	✓ 140
TOTAL LABOUR CHARGES (FRONTAL)		: S <u>45,520.00</u>	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED REAR LABOUR CHARGES FOR ACCIDENT VEHICLE SGN 1691 S

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID KICK SENSOR. CHECK FUNCTION	S/N S	360.00	✓
2	TO RENEW RHS 1/4 GLASS TO FACILLITATE FENDER RENEWAL	S/N S	300.00	✓✓
3	TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR LIGHT , BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT.INSPECT FOR DAMGE AND RENEW WHERE NECESSARY	S/N S	1,600.00	✓✓
4	TO REMOVE AND REINSTALL REAR SEAT , BACK REST,HAT TRAY AND LUGGAGE COMPARTMENT TRIMS .	S/N S	1,200.00	✓✓
5	TO REMOVE AND TRANSFER RHS REAR DOOR AND LHS REAR DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES.	S/N S	800.00	560 ✓
SUB LABOUR CHARGES (REAR)		:	\$	<u>4,260.00</u>

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED REAR LABOUR CHARGES FOR ACCIDENT VEHICLE SGN 1691 S

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
6	TO DISMANTLE AND RENEW REAR BUMPER AND BOTH REAR DOORS. TO CUT OUT AND WELD RHS REAR FENDER RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	S 7,200.00	A000 ✓
7	TO RESPRAY REAR UPPER BUMPER, REAR LOWER BUMPER, RHS REAR FENDER, DRAIN CHANEL, DOOR ENTRANCE, REAR END PANELLING, RHS REAR DOOR, LHS REAR DOOR, DOOR COVERS, DOOR HANDLE, FUEL FILLER CAP AND BOTH REAR WHEEL ARCH TRIMS	S 8,300.00	4575 Bumper : 550 Rear : 3.5 x 550 = 1925 2 Door : 1100 2 Door Cover : 400 Fuel Cover : 100 Wheel Arch : 400 Handle : 100 4575 ✓
8	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK	S/N S 384.00	✓
TOTAL LABOUR CHARGES (FRONTAL+REAR)		: S 65,664.00	



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAJ@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER <i>Dehd</i>	1 S	1,362.00 ✓	1089.60
2	FRONT BUMPER FIXING PARTS <i>Not in</i>	1	TBC X	
3	FRONT BUMPER SECURING STRIP - LH / RH Not in LH cracked		76.00 X	31.28 ✓
4	FRONT BUMPER CLOSING ELEMENT - LH / RH <i>Not in</i>	2 S	222.00 X	
5	FRONT BUMPER GRILLE - CENTER <i>Not in</i>	1 S	402.00 X	
6	FRONT BUMPER PARKING AID SENSOR SUPPORT <i>Not in</i>	2 S	58.00 X	
7	FRONT BUMPER SPOILER - CENTER <i>Not in</i>	1 S	866.00 X	
8	FRONT BUMPER SPOILER - LH / RH <i>LH Missing</i>	2 S	452.00 226	180.80
9	FRONT BUMPER CLOSING ELEMENT - CENTER <i>Not in</i>	1 S	421.00 X	
10	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>LH Missing</i>	2 S	534.00 267	213.60
11	FRONT BUMPER PARKING AID SENSOR SUPPORT - LH / RH <i>Not in</i>	2 S	68.00 34	28.32
12	FRONT BUMPER TRIM - LH / RH Not in LH Missing	2 S	322.00 X	135.20 ✓
13	FRONT RADIATOR GRILLE <i>Not in</i>	1 S	3,470.00 X	
14	QUATTRO EMBLEM <i>Not in</i>	1 S	106.00 X	
15	FRONT BUMPER STRIKER PLATE <i>Not in</i>	1 S	244.00 X	
16	FRONT PARKING AID SENSOR <i>Not in</i>	4	TBC X	
17	FRONT PARKING AID SENSOR SEAL <i>Not in</i>	4 S	14.00 X	
18	FRONT BUMPER REINFORCMENT FOAM PIECE <i>Cracked</i>	1 S	183.00 X	146.00 ✓
19	FRONT BUMPER REINFORCMENT BAR <i>Not in</i>	1 S	981.00 X	
20	FRONT BUMPER BRACKET - LH <i>Not in</i>	1 S	256.00 ? X	
SUB TOTAL SPARE PARTS		:	\$ 10,037.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT BUMPER GUIDE SECTION - LH / RH <i>3 new</i>	2	78.00	60.96 ✓
22	FRONT BUMPER TOP COVER <i>new</i>	1	129.00	✓
23	CAUTION STICKER <i>3 new</i>	1	14.00	✓
24	AIR CONDITIONER STICKER	1	20.00	✓
25	HORN - LH <i>3 new</i>	1	195.00	✓
26	HORN - RH	1	195.00	✓
27	BONNET <i>Distorted</i>	1	4,058.00	3246.40 ✓
28	BONNET HINGE - LH / RH <i>3 new</i>	2	322.00	✓
29	BONNET ATTACHMENT PARTS	1	141.00	✓
30	BONNET IMPACT PROTECTOR - CENTER / LH / RH <i>new</i>	3	84.00	65.68 ✓
31	FRONT FENDER - LH / RH <i>Distorted</i>	2	2,854.00	2283.20 ✓
32	FRONT FENDER ATTACHMENT PARTS <i>new</i>	1	66.00	✓
33	FRONT FENDER BRACKET - LH / RH <i>?</i>	2	36.00	27.52 ✓
34	FRONT FENDER BRACE - LH / RH <i>?</i>	2	450.00	359.20 ✓
35	FRONT FENDER CLOSING ELEMENT - RH <i>?</i>	1	105.00	83.60 ✓
36	FRONT FENDER MOUTING BRACKET - RH <i>new</i>	1	18.00	13.76 ✓
37	FRONT FENDER FILLER COVER - LH / RH <i>2 RA</i>	2	62.00	49.28
38	FRONT FENDER FILLER TOP COVER - LH / RH <i>del</i>	2	80.00	62.88
39	FRONT FENDER FILLER COVER - OUTER LH / RH <i>LH new</i>	2	156.00	124.64
40	S-LINE EMBLEM <i>new</i>	2	225.00	204.00 ✓
SUB TOTAL SPARE PARTS			\$	9,288.00

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	HEADLIGHT MOUNTING - LH / RH <i>Not nec</i>	2	\$ 236.00	X
42	FRONT RADIATOR BRACE - LH / RH <i>nec</i>	2	\$ 114.00	X
43	HEADLIGHT - LH / RH <i>2nd int</i>	2	\$ 13,978.00	6989 5608.80
44	HEADLIGHT CYLINDER - LH / RH <i>nec</i>	2	\$ 280.00	X
45	WINDSHIELD WASHER HOSE	1	\$ 125.00	X
46	HEADLIGHT WASGER HOSE	1	\$ 68.00	X
47	HEADLIGHT WASHER PUMP	1	\$ 155.00	X
48	WASHER RESERVOIR <i>Deformed</i>	1	\$ 235.00	188 ✓
49	WINDSHIELD WASHER PUMP <i>Not nec</i>	1	\$ 125.00	X
50	FRONT RADIATOR -lock carrier <i>cracked</i>	1	\$ 1,400.00	1120.00 ✓
51	FRONT RADIATOR SUPPORT - LH <i>nec</i>	1	\$ 53.00	X
52	FRONT BUMPER SENSOR BRACKET	1	\$ 16.00	X
53	COOLANT <i>nec</i>	6	\$ 266.00	212.64 ✓
54	FRONT RADIATOR AIR GUIDE - LH / RH / UPPER / LOWER <i>2nd int</i>	4	\$ 192.00	X
55	FRONT RADIATOR AIR GUIDE - CENTER	1	\$ 42.00	X
56	FRONT WHEEL HOUSING LINER - LH / RH <i>2nd int</i>	2	\$ 528.00	421.60
57	FRONT WHEEL HOUSING LINER ATTACHMENT PART <i>nec</i>	1	\$ 38.00	X
58	FRONT WHEEL SPOILER - LH / RH <i>2nd int</i>	2	\$ 320.00	128.00 ✓
59	FRONT WHEEL COVER - LH / RH <i>Distorted</i>	2	\$ 1,264.00	1011.20
60	SIDE PANEL FRAME - RH <i>Distorted</i>	1	\$ 6,944.00	5555.20
SUB TOTAL SPARE PARTS		:	\$ 26,379.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6041 1183
EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
61	FRONT WINDSCREEN	1 S	1,561.00 ✓	1248.80
62	FRONT WINDSHIELD RAIN SENSOR	1 S	137.00 ✓	109.20
63	FRONT WINDSHIELD RAIN SENSOR SPRING	1 S	21.00 ✓	16.56
64	FRONT WIPER - RH <i>new</i>	1 S	67.00 X	
65	PILLAR A REINFORCEMENT - RH OUTER <i>? Dented</i>	1 S	1,374.00 ✓	1099.20 ✓
66	FRONT SIDE WINDOW - RH <i>new</i>	1 S	832.00 ✓	665.20
67	FUEL FLAP <i>Dented</i>	1 S	323.00 ✓	258.40
68	FUEL FILLING HOUSING <i>new</i> Cracked	1 S	155.00 +	123.60 ✓
69	FRONT DOOR - RH <i>Distorted</i>	1 S	4,085.00 ✓	3268.00
70	FRONT DOOR - OUTER SEAL RH <i>new</i>	1 S	205.00 ✓	164.00
71	BONDING AGENT <i>Not ne</i>	1 S	49.00 ?	X
72	CLEANING SOLUTION <i>Not ne</i>	1 S	68.00 ?	X
73	APPLICATOR <i>Not ne</i>	1 S	8.00 ?	X
74	GROMMET <i>Not ne</i>	5 S	14.00 ?	X
75	FRONT DOOR ATTACHMENT PARTS <i>new</i>	1 S	264.00 +	X
76	FRONT DOOR CATCH - RH <i>Not ne</i>	1 S	146.00	X
77	FRONT DOOR HINGE - RH UPPER / LOWER <i>Dented</i>	4 S	184.00 ✓	145.60
78	FRONT DOOR SEAL - INNER RH <i>new</i>	1 S	205.00 ✓	
79	FRONT DOOR COVER - RH <i>let</i>	1 S	790.00 ✓	632.00
80	FRONT SILL TRIM STRIP - RH <i>new</i>	1 S	591.00 ✓	472.80
SUB TOTAL SPARE PARTS		:	\$ 11,079.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

		DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
81	DATA TAG <i>new</i>	1 S	462.00 ✓	369.60
82	TYER PRESSURE DATA TAG new nec	1 S	38.00 X	29.84 ✓
83	FRONT DOOR HANDLE TRIM - RH <i>Distorted</i>	1 S	128.00 ✓	102.40
84	LOCK CYLINDER WITH HOUSING <i>Distorted</i>	1 S	540.00 ✓	432
85	FRONT DOOR HANDLE COVER TRANSPARENT - RH <i>Distorted</i>	1 S	6.00 ✓	4.64
86	FRONT DOOR HANDLE SENSOR - RH <i>Distorted</i>	1 S	228.00 ✓	182.40
87	FRONT DOOR HANDLE EXTERIOR - RH <i>Distorted</i>	1 S	44.00 ✓	34.88
88	DOOR UNDERLAY - FRONT / REAR <i>new</i>	2 S	8.00 ✓	5.76
89	FRONT DOOR MOUNTING BAR <i>3 Damaged</i>	1 S	164.00 ✓	130.80 ✓
90	FRONT DOOR PERIPHERAL LIGHT <i>RH Distorted</i>	1 S	72.00 ✓	57.28
91	FRONT WINDOW WITHOUT REGULATOR MOTOR - RH new S dmrg	1 S	278.00 +	222.40 ✓
92	FRONT WINDOW WITH REGULATOR MOTOR - RH <i>new</i>	1 S	237.00 +	
93	FRONT DOOR CONTROL UNIT - RH <i>new</i>	1 S	751.00 +	
94	FRONT DOOR LOCK - RH new damaged	1 S	535.00 +	428.00 ✓
95	FRONT DOOR STRIKER <i>new</i>	1 S	69.00 +	
96	WING MIRROR - RH <i>Distorted</i>	1 S	1,749.00 ✓	1399.20
97	WING MIRROR CAP - RH <i>Distorted</i>	1 S	491.00 ✓	392.80
98	WING MIRROR GLASS - RH <i>Distorted</i>	1 S	1,908.00 ✓	1526.40
99	CONTACT HOUSING 16 PIN <i>new</i>	1 S	6.00 ✓	4.72
100	FRONT DOOR CONER TRIM - RH new cracked	1 S	46.00 X	36.24 ✓
SUB TOTAL SPARE PARTS		:	\$ 7,760.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
101	FRONT WINDOW TRIM STRIP - RH <i>Dented</i>	1	\$ 340.00 ✓	272.00
102	FRONT WINDOW GUIDE - RH <i>cut</i>	1	\$ 488.00 ✓	390.00
103	FRONT WINDOW INNER SEAL - RH new cut	1	\$ 113.00 ✗	90.00 ✓
104	FRONT DOOR SEAL - RH new <i>new</i>	1	\$ 15.00 ✓	11.36
105	FRONT B PILLAR TRIM - RH <i>cut</i>	1	\$ 197.00 ✓	157.20
106	FRONT WINDOW SLOT SEAL - RH <i>Dented</i>	1	\$ 616.00 ✓	492.40
107	FRONT DOOR WINDOW - RH <i>Shattered</i>	1	\$ 298.00 ✓	238.00
108	FRONT DOOR TRIM - RH <i>cut</i>	1	\$ 2,310.00 ✓	1848.00
109	FRONT DOOR WINDOW TRIM - RH new cut	1	\$ 144.00 ✗	114.80 ✓
110	FRONT DOOR ARMREST - RH <i>new</i>	1	\$ 591.00 ✗	
111	FRONT DOOR HANDLE COVER - RH <i>new</i>	1	\$ 158.00 ✗	
112	FRONT DOOR TRIM INSERT ALUMINIUM- RH OUTER new cut	1	\$ 629.00 ✗	503.20 ✓
113	FRONT DOOR WIRING SET <i>new</i>	1	\$ 577.00 ✗	
114	REAR DOOR - RH <i>Dented</i>	1	\$ 4,085.00 ✓	3268.00
115	REAR DOOR - OUTER SEAL RH <i>new</i>	1	\$ 205.00 ✓	164.00
116	BONDING AGENT <i>3</i> <i>new</i>	1	\$ 49.00 ✗	
117	CLEANING SOLUTION <i>new</i>	1	\$ 68.00 ✗	
118	APPLICATOR <i>new</i>	1	\$ 8.00 ✗	
119	REAR DOOR SEALING STRIP - RH <i>new</i>	1	\$ 17.00 ✓	12.96
120	GROMMET <i>new</i>	3	\$ 9.00 ✓	6.72
SUB TOTAL SPARE PARTS		:	\$ 10,917.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL: 6366 2323 FAX: 6841 1183
EMAIL: NORA.KHAJ@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES		REMARKS
			S/NETT		
121	RAER DOOR ATTACHMENT PART <i>see n</i>	1	S	222.00	X
122	REAR DOOR CATCH <i>Nec</i>	1	S	146.00	? 116.40 ✓
123	REAR DOOR SEAL - INNER <i>see</i>	1	S	205.00	X
124	SILL PANEL SEAL - RH see <i>nec</i>	1	S	253.00	X 202.00 ✓
125	REAR DOOR HINGE - RH UPPER / LOWER <i>Dand</i>	4	S	184.00	✓ 145.60
126	REAR DOOR COVER - RH <i>cut</i>	1	S	689.00	✓ 551.20
127	REAR DOOR HANDLE TRIM PLATE - RH <i>Disbled</i>	1	S	275.00	✓ 219.60
128	REAR DOOR HANDLE HOUSING - RH see <i>damaged</i>	1	S	18.00	✓ 14.16 ✓
129	REAR DOOR HANDLE COVER TRANSPARENT - RH <i>see n</i>	1	S	6.00	+ 4.64
130	REAR DOOR HANDLE SENSOR - RH <i>see n</i>	1	S	228.00	+
131	REAR DOOR HANDLE EXTERIOR - RH <i>Hyd</i>	1	S	44.00	+ 34.88 ✓
132	REAR DOOR MOUNTING BAR - RH <i>see n</i>	1	S	164.00	+
133	REAR WINDOW WITHOUT REGULATOR MOTOR - RH <i>green</i>	1	S	314.00	+
134	REAR WINDOW WITH REGULATOR MOTOR - RH	1	S	351.00	+
135	REAR DOOR CONTROL UNIT - RH	1	S	751.00	+
136	REAR DOOR LOCK - RH <i>see n</i>	1	S	661.00	+
137	REAR DOOR STRIKER	1	S	69.00	X
138	REAR WINDOW GUIDE - RH <i>see n</i>	1	S	488.00	X
139	REAR WINDOW TRIM STRIP - RH <i>cut</i>	1	S	297.00	✓ 236 ✓
140	REAR WINDOW INNER SEAL - RH <i>nn</i>	1	S	205.00	+

SUB TOTAL SPARE PARTS

: \$ 5,570.00

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6341 1183
EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

		DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
141	REAR WINDOW SLOT SEAL - RH new warped	1	\$ 616.00	X 516.00 ✓
142	REAR DOOR SEAL - RH new	2	\$ 30.00	X 22.72 ✓
143	REAR B PLIAR TRIM - RH Lt	1	\$ 222.00	✓ 177.60
144	REAR C PLIAR TRIM - RH new	1	\$ 149.00	X
145	REAR WINDOW GUIDE RAIL - RH new	1	\$ 72.00	+
146	REAR DOOR WINDOW - RH new	1	\$ 298.00	+
147	REAR DOOR - LH Dented	1	\$ 4,085.00	✓ 3268.00
148	REAR DOOR OUTER SEAL - LH new	1	\$ 205.00	✓ 164.00
149	BONDING AGENT	1	\$ 49.00	+
150	CLEANING SOLUTION	1	\$ 68.00	+
151	APPLICATOR	1	\$ 8.00	+
152	REAR DOOR SEALING STRIP - LH new	1	\$ 17.00	X 12.96 ✓
153	GROMMET new	3	\$ 9.00	✓ 6.72
154	REAR DOOR ATTACHMENT PART new	1	\$ 222.00	X
155	REAR DOOR CATCH - LH new	1	\$ 146.00	? 116.40 ✓
156	REAR DOOR COVER - LH new	1	\$ 689.00	✓ 551.20
157	REAR BUMPER - UPPER Dented	1	\$ 2,397.00	✓ 1917.60
158	REAR BUMPER - LOWER new	1	\$ 1,182.00	+
159	TAIL LIGHT - UPPER RH new	1	\$ 5,746.00	X
160	TAIL LIGHT - LOWER RH new	1	\$ 699.00	+
SUB TOTAL SPARE PARTS		:	\$ 16,909.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
161	REAR WHEEL ARCH COVER - LH / RH <i>new</i>	2 S	1,166.00	✓ 932.80
162	ROOF TOP PANEL <i>new</i>	1 S	4,646.00	✓ X
163	INNER ROOF RAIL <i>new</i>	1 S	1,836.00	✓
164	INNER ROOF RAIL NUT	6 S	213.00	✓
165	HEAD AIRBAG UNIT - LH / RH <i>Activated</i>	1 S	3,726.00	✓ 2980.80
166	AIRBAG CONTROL UNIT	1 S	2,112.00	✓ 1689.60
167	AIRBAG CRASH SENSOR	1	TBC	X
168	CENTRAL PROTECTION FUSE <i>new</i>	1 S	533.00	✓ 426.80
169	FRONT SEATBELT - LH / RH <i>Activated</i>	2 S	2,234.00	✓ 1787.20
170	FRONT SEATBELT ADJUSTER - LH / RH <i>dyd.</i>	2 S	342.00	✓ 273.60 ✓
171	ROOF HEADLINER <i>Coupled</i>	1 S	3,660.00	✓ 3083.20
172	FRONT ROOF HANDLE - RH / LH <i>Damaged</i>	2 S	283.00	✓ 226.40 ✓
173	REAR ROOF HANDLE - RH / LH	2 S	284.00	✓ 226.40 ✓
174	A - PILLAR TRIM - UPPER LH / RH <i>Damaged</i>	2 S	474.00	✓ 379.20 ✓
175	UPPER B-PILLAR TRIM - LH / RH <i>new</i>	2 S	602.00	✓
176	C - PILLAR TRIM - LH / RH <i>new</i>	2 S	628.00	✓
177	D - PILLAR TRIM - LH / RH <i>new</i>	2 S	408.00	✓
178	A - PILLAR TRIM - LOWER RH <i>new</i>	1 S	149.00	✓
179	B - PILLAR TRIM - LOWER RH <i>new</i>	1 S	234.00	✓
180	REAR WHEEL HOUSING TRIM - RH <i>new</i>	1 S	252.00	✓
SUB TOTAL SPARE PARTS		:	\$ 23,782.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAJ@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

			DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS	
181	REAR FENDER INNER TRIM - RH <i>new</i>	1	S 75.00	<i>x</i>	
182	DASHBOARD	1	S 6,972.00	<i>x</i>	
183	DASHBOARD CENTER AIR VENT	1	S 2,272.00	<i>x</i>	
184	DASHBOARD AIR VENT	1	S 591.00	<i>x</i>	
185	STEERING WHEEL <i>Bent</i>	1	S 2,374.00	<i>x</i>	<i>?</i> 1899.20 ✓
186	FRONT SEAT - RH <i>new</i> Cut	1	TBC 2636	<i>x</i>	2108.80 ✓
187	FRONT SEAT PADDING - RH <i>new</i>	1	TBC	<i>x</i>	
188	FRONT SEAT COVER - RH <i>new</i> cut	1	TBC 2096	<i>x</i>	1676.80 ✓
189	FRONT CENTER CONSOLE	1	S 815.00	<i>x</i>	
190	FRONT CENTER CONSOLE INSERT <i>new</i>	1	S 402.00	<i>x</i>	
191	FRONT CENTER CONSOLE TRIM Cut	1	S 741.00	<i>x</i>	592.80 ✓
192	FRONT CENTER CONSOLE INSERT STOWAGE <i>new</i>	1	S 60.00	<i>x</i>	
193	FRONT CENTER CONSOLE STOWAGE COMPARTMENT <i>new</i>	1	S 144.00	<i>x</i>	
194	ASSEMBLY CARRIER <i>Bent</i>	1	S 1,891.00	<i>x</i>	1512.80 ✓
195	FRONT WISHBONE LINK - LH <i>Bent</i>	1	S 539.00	<i>x</i>	430.80 ✓
196	FRONT SUSPENSION GUIDE - LH <i>Bent</i>	1	S 943.00	<i>x</i>	754.40 ✓
197	UPPER SUSPENSION GUIDE - FRONT / REAR LH <i>Bent</i>	2	S 720.00	<i>x</i>	576.00 ✓
198	WHEEL BEARING HOUSING - LH <i>new</i>	1	S 1,136.00	<i>x</i>	908.80 ✓
199	SWIVEL JOINT <i>new</i>	1	S 193.00	<i>x</i>	154.40 ✓
200	WHEEL HUB <i>new</i>	1	S 479.00	<i>x</i>	383.20 ✓
SUB TOTAL SPARE PARTS		:	S 20,347.00		

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

				DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS	
201	FRONT WHEEL BEARING <i>Byd</i>	1 S	246.00	196.80 ✓	
202	SUSPENSION FORKS - LH <i>Best</i>	1 S	366.00	292.40 ✓	
203	COUPLING ROD <i>Best</i>	1 S	127.00	101.20 ✓	
204	FRONT ANTI - ROLL BAR <i>Not in</i>	1 S	433.00	X	
205	AXLE ASSEMBLY Drive Shaft <i>Byd</i>	1 S	2,865.00	2292 ✓	
206	SHOCK ABSORBER <i>Best</i>	1 S	1,483.00	1186.40 ✓	
207	LEVEL SENSOR WITH POLES <i>Byd</i>	1 S	535.00	428 ✓	
208	STERRING GEAR WITH TRACK ROD JOINT Not in <i>Not in</i>	1 S	6,782.00	X	
209	TRACK ROD <i>Best</i>	1 S	134.00	106 ✓	
210	TIE ROD END - LH <i>Best</i>	1 S	197.00	157.20 ✓	
211	ROOF HEADER PANEL Not in <i>Not in</i>	1 S	262.00	X	
212	INNER ROOF REINFORCEMENT Not in <i>Not in</i>	1 S	247.00	X	
213	1 PACK ADHESIVE <i>Not in</i>	1 S	73.00	X	
214	ROOF PANEL BONDING ADHESIVE <i>Not in</i>	1 S	23.00	X	
215	PRIMER <i>Not in</i>	1 S	20.00	X	
216	FRONT DOOR COVER - LH <i>Not in</i>	1 S	790.00	✓	632.00
217	STATIC MIXER <i>Not in</i>	5 S	56.00	✓	44.40
218	BLINDER RIVET STUD <i>Not in</i>	10 S	62.00	✓	49.60
219	FRONT NO PLATE <i>Not in</i>	S/N	TBC	+	
220	FRONT 2 RIMS - LH / RH <i>Not in</i>	3	TBC	✓	981.31
SUB TOTAL SPARE PARTS		:	\$	14,701.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL : NORA.KHAJ@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SGN 1691 S

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES		REMARKS
			S/NETT		
221	REAR RIM - LH <i>wt</i>	1	TBC	✓	
222	FRONT 2 TYRES- LH / RH <i>wt for not ne</i>	2	TBC	? X	
223	REAR TYRE - LH <i>new wt.</i>	1	TBC	✓	510.00
224	ACRYLIC SEALANT	S/N	\$	180.00	✓✓
225	CAVITY WAX	S/N	\$	140.00	✓✓
226	STONE CHIP TREATMENT	S/N	\$	180.00	✓✓
227	METAL FILLER POWDER	S/N	\$	280.00	✓✓
227	REAR WINDSCREEN SEALANT <i>new</i>	S/N	\$	200.00	+
228	REAR 1/4 GLASS SEALANT <i>ne</i>	S/N	\$	100.00	✓
229	SUNDRIES <i>ne.</i>		\$	1,500.00	? 395.28 ✓
TOTAL SPARE PARTS		:	\$	159,349.00	
TOTAL LABOUR CHARGES		:	\$	65,664.00	
GRAND TOTAL		:	\$	225,013.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

 PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME
SURVEYED DATE
AUTHORISED DATE
EXCESS COST
LIABILITY
REMARKS

: Adrian King
22/09/21

: Not Authorised, 35 Days. (Without Proof and A Piller Rainbow)

PLEASE NOTE

: THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORA KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Hui Zhen

Supplementary Estimate - 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0780/2021/ZK

8-Oct-21

CHANG

1 of 1

SGN 1691 S

AUDI Q5 S-LINE TFSI

Quantity	Description	Unit Price	Amount
Parts			
1	LED LIGHT - RH FRONT <i>new</i>	\$ 67.00	✓ 55.52
2	INNER ACTUATOR - RH <i>new</i>	\$ 255.00	✓
3	TRAY - RH LOWER <i>cut</i>	\$ 548.00	✓ 438.00
4	DASHBOARD ALUMINIUM TRIM - RH <i>new</i>	\$ 447.00	✓
5	DASHBOARD ALUMINIUM TRIM - LH <i>new</i>	\$ 1,068.00	X
6	PADDING FOR SEAT DEPTH <i>new</i>	\$ 142.00	✓
7	DISPLAY AND CONTROL PANEL WITH CU (A/C) <i>new</i>	\$ 3,121.00	✓
8	DRIVE SHAFT SCREW <i>new</i> 6	\$ 46.00	✓ 37.04
9	BRAKE HOSE - LH FRONT	\$ 72.00	? 56.96 ✓
10	ENGINE MOUNTING - LH <i>new</i>	\$ 370.00	? X
11	SUBFRAME CONSOLE - LH <i>new</i>	\$ 562.00	? X
GRAND TOTAL		\$ 6,698.00	

For Premium Automobiles Pte Ltd



Authorised Signature

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate - 2

Hui Zhen.

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0780/2021/ZK

16-Nov-21

CHANG

1 of 1

SGN 1691 S

AUDI Q5 S-LINE TFSI

Quantity	Description	Unit Price	Amount
<u>Labours</u>			
1	TO REPAIR LHS FRONT LOWER A-PILLAR.	\$ 400.00	250 ✓
2	TO RESPRAY LHS FRONT LOWER A-PILLAR.	\$ 800.00	550 ✓
3	TO REMOVE AND REINSTALL AIRCON CONDENSER, RADIATOR AND ADDITIONAL RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT A/C VACUUM AND REGAS (R1234yf) S/N	\$ 2,000.00	✓ ✓
<u>Parts</u>			
1	SIGN - UNLEADED PETROL	\$ 30.00	✓ 24
GRAND TOTAL		\$ 3,230.00	

For Premium Automobiles Pte Ltd

Adrian Ling
16/11/21



Authorised Signature

10704p

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate - 3

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0780/2021/ZK

19-Nov-21

CHANG

1 of 1


SGN 1691 S

AUDI Q5 S-LINE 2.0 TFSI

Quantity	Description	Unit Price	Amount
Labours			
1	TO SUSPEND ENGINE ASSY, REMOVE AND REINSTALL CARDAN SHAFT. TO DISMANTLE AND RENEW GEARBOX ASSY. REINSTALL ALL PARTS REMOVED.	\$ 2,800.00	✓
Parts			
1	7-SPEED DUAL CLUTCH GEARBOX <i>Damaged</i>	\$ 32,056.00	✓ 26644.80
2	DUAL CLUTCH TRANSMISSION FLUID <i>Not Nec</i>	\$ 630.00	X
3	MTF TRANSMISSION FLUID <i>Not Nec</i>	\$ 546.00	X
4	GEARBOX BOLT SET <i>Nec</i>	\$ 110.00	✓ 86.40
5	ENGINE MOUNTING - RH <i>Damaged</i>	\$ 370.00	✓ 335.60
6	ENGINE MOUNTING BOLT <i>Nec</i>	\$ 114.00	✓ 90.64
GRAND TOTAL		\$ 36,626.00	

Adrian Ling.
22/11/21
[Signature]

For Premium Automobiles Pte Ltd

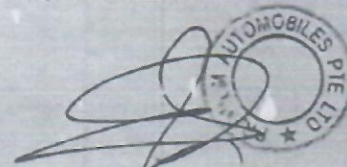

Authorised Signature