

Kennerth

ASSIGNMENT

From: _____

Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/IV

To Inspect Vehicle No: _____

at Workshop m/s S&H

of _____

Insured: _____

Policy No. _____

Claims No. _____

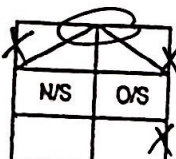
Sum Insured: _____

Excess: 350

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 840k without box & Power

IDAC Accident Rpt: _____

Consistent?: Yes or No Tailgate

GIA / PR Seen: _____

Consistent?: Yes or No

Est. Repairs: 24 days

Res.: Yes or No

Lum Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: GBE 5953Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Mitc.c. 2998Colour: White

A/C: Insured / Std / NI / NA

Sp. Reading: 147892

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: FEA01BA. 10182Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim orTyre Size: E-1ROTSTH 195R15X8 (D)BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 9 mmR/Bal. 8 8 mmL/Bal. 9 mmL/Bal. 8 8 mmD.O.A. 17/9/21D.O.I. 28/9/2021

Survey held at _____

Des. of Damages Frnt Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision. ✓

Date / Time

Action / Instruction

28/9Check Cargo box & Power Tailgate injured or not ??

submit uneconomical total loss

Pre-Accident Value: S\$ 49,000.00

COE / PARF Rebate: S\$ 20,020.00

Margin for Repair: S\$ 28,980.00

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee: _____

Transportation: _____

S + RS. \$

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

S&H Motor Pte Ltd
160 Sin Ming Drive #07-02
Sin Ming Autocity
Singapore 575722

Insurer Reference:

Repairer Reference: 043632

Date calculated: 25/09/2021 10:29 AM

Full Report

Registration: GBE5953S

Printed: 25/09/2021 10:29 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	17/09/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer: FUSO
 Model: CANTER (FB/FE/FG)
 Sub Model: BASE MODEL
 Model Sheet Number: 32 87 01
 Registration: GBE5953S

VIN number:

Odometer:

Model Specs

AIR CONDITIONING	3.0 LTR 110 KW	5 SPEED GEARBOX	REAR WHEEL DRIVE
SINGLE CAB COMFORT			

Not Authorised
11/12/21
Permy After Pain
Ex @ 350k
24 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	R + R CAB BRACKET		16.0	67.20
NO NUMBER	R + R FRAME CROSSMEMBER 1		18.0	75.60
NO NUMBER	R + R FRAME CROSSMEMBER 2		20.0	84.00
NO NUMBER	RENEW FRONT BUMPER		11.0	46.20
	INCLUDES: R + R NECESSARY ATTACHED PARTS			
NO NUMBER	RENEW FRONT PANEL CPL		75.0	315.00
NO NUMBER	R + R L/F REPEATER LAMP		4.0	16.80
NO NUMBER	R + R R/F REPEATER LAMP		4.0	16.80
NO NUMBER	R + R WINDSCREEN		25.0	105.00
	INCLUDES: COWL GRILLE, WIPER ARM AND WIPER LINKAGE REMOVE AND REFIT.			
NO NUMBER	R + R L/F STEP		6.0	25.20
NO NUMBER	R + R R/F STEP BOARD		2.0	8.40
NO NUMBER	R + R L/R SKIRT COVER		7.0	29.40
NO NUMBER	R + R R/R SKIRT COVER		7.0	29.40
NO NUMBER	R + R L/WING COVER		2.0	8.40
NO NUMBER	R + R REAR WING COVER		2.0	8.40
NO NUMBER	DETACH + REFIT HEADLINING		2.0	8.40
NO NUMBER	RENEW L/A-PILLAR		2.0	8.40
			46.0	193.20

Code	Description	Qty	Price Each
NO NUMBER	R + R LEFT FRONT SEAT BELT		
NO NUMBER	RENEW L/F DOOR	2.0	8.40
	INCLUDES: R + R DOOR,	62.0	289.20
	CONVERT ATTACHED PARTS, RENEW IF		
	NECESSARY		
NO NUMBER	RENEW R/A-PILLAR		
NO NUMBER	R + R RIGHT FRONT SEAT BELT	48.0	183.20
NO NUMBER	RENEW R/F DOOR	2.0	8.40
	INCLUDES: R + R DOOR,	18.0	75.60
	CONVERT ATTACHED PARTS, RENEW IF		
	NECESSARY		
NO NUMBER	R + R LEFT B-PILLAR TRIM	1.0	4.20
NO NUMBER	R + R RIGHT B-PILLAR TRIM	1.0	4.20
NO NUMBER	R + R L/F SEAT	2.0	8.40
NO NUMBER	R + R R/F SEAT	2.0	8.40
NO NUMBER	R + R R/INSTRUMENTS CARRIER REINF PANEL	18.0	75.60
NO NUMBER	RENEW DASHBOARD	49.0	205.80
NO NUMBER	R + R STEERING COLUMN ASSY	10.0	42.00
NO NUMBER	R + R STEERING BOX	15.0	63.00
NO NUMBER	R + R FAN BLADE	1.0	4.20
NO NUMBER	R + R HEAT EXCHANGER	6.0	25.20
NO NUMBER	R + R COMPLETE AIR FILTER INSERT	3.0	12.60
NO NUMBER	R + R ENGINE SUPPORT	16.0	67.20
NO NUMBER	RENEW RADIATOR	12.0	50.40
NO NUMBER	R + R FAN COWL	3.0	12.60
NO NUMBER	R + R LOWER RADITATOR HOSE	3.0	12.60
NO NUMBER	DETACH + REFIT RADIATOR	4.0	16.80
NO NUMBER	R + R CONDENSER	9.0	33.60
NO NUMBER	R + R PRESSURE PIPE	3.0	12.60
NO NUMBER	REMOVE AND REFIT CONDENSOR/DRYER HOSE	1.0	4.20
NO NUMBER	DRAIN + REFILL AIR CONDITIONING	5.0	21.00
NO NUMBER	RENEW FUEL TANK	11.0	46.20
NO NUMBER	R + R LEFT FRONT LOWER CONTROL ARM	6.0	25.20
NO NUMBER	R + R RIGHT FRONT LOWER CONTROL ARM	6.0	25.20
NO NUMBER	R + R L/F CONTROL ARM	12.0	50.40
NO NUMBER	R + R R/F STEERING KNUCKLE	12.0	50.40
NO NUMBER	DETACH + REFIT L/FR BRAKE CALIPER	1.0	4.20
NO NUMBER	DETACH + REFIT R/FR BRAKE CALIPER	1.0	4.20
NO NUMBER	R + R L/F WHEEL	1.0	4.20
NO NUMBER	R + R R/F WHEEL	1.0	4.20
NO NUMBER	R + R AND BALANCE L/F TYRE	6.0	25.20
NO NUMBER	R + R AND BALANCE R/F TYRE	6.0	25.20
NO NUMBER	R + R R/R AXLE SHAFT	5.0	21.00
NO NUMBER	DETACH + REFIT R/R BRAKE CALIPER	1.0	4.20
NO NUMBER	R + R RIGHT REAR BRAKE DISC	2.0	8.40
NO NUMBER	R + R L/R OUTER TYRE (WHEEL REMOVED)	6.0	25.20
NO NUMBER	R + R R/R OUTER TYRE (WHEEL REMOVED)	6.0	25.20
NO NUMBER	R + R R/R WHEEL	2.0	8.40
NO NUMBER	L/R OUT WHEEL REMOVE AND REFIT	1.0	4.20
NO NUMBER	ADJUST HEADLAMPS	2.0	8.40

Labour Cost
Panel / Mechanical Labour

Hrs **WU**
63.50 **635.0** **2,667.00**

Total of Labour

2,667.00

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h	
Code	Description		WU	Price SGD
	L/F CORNER PANEL NEW PART PAINTING		7.0	
	R/F CORNER PANEL NEW PART PAINTING		7.0	
	FRONT PANEL CPL NEW PART PAINTING		27.0	
	LEFT FRONT DOOR NEW PART PAINTING		14.0	
	RIGHT FRONT DOOR NEW PART PAINTING		14.0	
	LEFT A-PILLAR NEW PART PAINTING		8.0	
	RIGHT A-PILLAR NEW PART PAINTING		8.0	
	LEFT B-PILLAR NEW PART PAINTING		15.0	
	RIGHT B-PILLAR NEW PART PAINTING		15.0	
	ROOF NEW PART PAINTING		50.0	
	CAB SUPPORT SURFACE PAINT		5.0	
	REAR CABIN PANEL NEW PART PAINTING		47.0	
	FRONT GRILLE NEW PART PAINT K1R		7.0	
	FRONT PANEL TRIM NEW PART PAINT K1G/P		10.0	

Paint Material Per Part

Code	Description	Price SGD
0887	L/F CORNER PANEL NEW PART PAINTING	7.25
0888	R/F CORNER PANEL NEW PART PAINTING	7.25
0900	FRONT PANEL CPL NEW PART PAINTING	33.21
1481	LEFT FRONT DOOR NEW PART PAINTING	30.63
1482	RIGHT FRONT DOOR NEW PART PAINTING	30.63
2227	LEFT A-PILLAR NEW PART PAINTING	1.75
2228	RIGHT A-PILLAR NEW PART PAINTING	1.75
2279	LEFT B-PILLAR NEW PART PAINTING	13.11
2280	RIGHT B-PILLAR NEW PART PAINTING	13.11
2351	ROOF NEW PART PAINTING	70.79
2810	CAB SUPPORT SURFACE PAINT	6.69
3081	REAR CABIN PANEL NEW PART PAINTING	65.55
0410	FRONT GRILLE NEW PART PAINT K1R	23.73
1392	FRONT PANEL TRIM NEW PART PAINT K1G/P	28.05

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		234.0	
Preparation Main Work Metal	1.70	17.0	71.40
Preparation Comp. Work Plastic	0.60	6.0	25.20
Total	10 WU/h	25.70	257.0
			1,079.40

Material Cost - Paint

New Part Painting	Price SGD
New Part Painting - Plastic K1R	275.03
New Part Painting - Plastic K1G/PUR	23.73
Surface-/Blend Paint	28.05
Material-constant Metal	6.69
Material-constant Plastic	18.10
Total	12.70
	364.30

Spare Parts

				prices as at 2015-06-01	
Code	Description	Part Number	Part Source	Price SGD	
0281	FRONT BUMPER	MC978516	Original	R ₁ 580.00	✓
0283	L/F BUMPER BRACKET	MK618510	Original	R ₁ 220.00	✓
0284	R/F BUMPER BRACKET	MK618511	Original	R ₁ 220.00	✓
0289	L/F BUMPER CORNER	MK618522	Original	hi 210.00	✓
0290	R/F BUMPER CORNER	MK618528	Original	hi 210.00	✓
0410	FRONT GRILLE	MC976542	Original	hi 550.00	✓
0431	FRONT MANUFACT	MK546616	Original	hi 95.00	✓
	BADGE				
0432	BADGE	MK546617	Original	hi 120.00	✓
0433	BADGE	MK675497		hi 0.00	
0435	L/BADGE	MK676977		0.00	
0436	R/BADGE	MK676978		0.00	
0561	LEFT HEADLAMP ASSY	MK580525	Original	My CM 350.00	✓
0562	RIGHT HEADLAMP ASSY	MK580526	Original	350.00	✓
0677	L/F INDICATOR	MK581219	Original	CM 210.00	✓
0678	R/F INDICATOR	MK581220	Original	hi 210.00	✓
0717	L/POSITION LAMP	MK580529	Original	CM 130.00	✓
0718	R/POSITION LAMP	MK580530	Original	CM 130.00	✓
0829	L/F MUD PANEL	MK456202	Original	hi 70.00	X
0830	R/F MUD PANEL	ML215450	Original	R ₁ 70.00	✓
0887	L/F CORNER PANEL	MC976410	Original	280.00	?
0888	R/F CORNER PANEL	MC976411	Original	280.00	?
0900	FRONT PANEL CPL	ML230272	Original	R ₁ 1,100.00	✓
1392	FRONT PANEL TRIM	MC976369	Original	320.00	?
1401	WINDSCREEN	MK403591	Original	hi 700.00	✓
1410	WINDSCREEN SEAL	MK435030	Original	hi 190.00	✓
1411	WINDSCREEN BOND KIT	Z2156507		0.00	
1481	LEFT FRONT DOOR	MK702225	Original	R ₁ 850.00	✓
1482	RIGHT FRONT DOOR	MK702226	Original	R ₁ 850.00	✓
1505	L/F DOOR CHECK	MK403138	Original	hi 65.00	✓
1506	R/F DOOR CHECK	MK403138	Original	hi 65.00	X
1509	L/F DOOR FRAME SEAL	MK403141	Original	hi 130.00	✓
1510	R/F DOOR FRAME SEAL	MX917491	Original	hi 130.00	✓
1519	L/F DOOR WINDOW	MK580871	Original	hi 350.00	✓
1520	R/F DOOR WINDOW	MK580872	Original	350.00	?
1547	L/F WINDOW	MK581271	Original	R ₁ 580.00	✓
	REGULATOR				
1548	R/F WINDOW	MK581272	Original	R ₁ 580.00	✓
	REGULATOR				
1565	L/DOOR OUTER HANDLE	MK403650	Original	hi 110.00	X
1566	R/DOOR OUTER HANDLE	MK403651	Original	hi 110.00	X
1577	L/INN DOOR LOCK	MK434983	Original	hi 320.00	✓
1578	R/INN DOOR LOCK	MK434990	Original	hi 320.00	✓
1597	L/F WINDOW CHANNEL	MK580532	Original	hi 170.00	X

Code	Description	Part Number	Part Source	Price SGD	
1598	R/F WINDOW CHANNEL	MK580533	Original	170.00	X
1711	L/F DOOR TRIM	MK580889	Original	420.00	—
1712	R/F DOOR TRIM	MK580890	Original	420.00	—
1715	L/UPP DOOR PNL EDGE	ML231889	Original	120.00	X
1716	R/UPP DOOR PNL EDGE	ML231890	Original	120.00	X
1739	L/DOOR MIRROR ARM	MK547646	Original	380.00	—
1740	R/DOOR MIRROR ARM	MK547647	Original	380.00	—
2205	L/F STEP	MK677508	Original	220.00	—
2206	R/F STEP	MK677509	Original	220.00	—
2227	LEFT A-PILLAR	MK704923	Original	350.00	—
2228	RIGHT A-PILLAR	MK704924	Original	350.00	—
2445	L/WING TRIM	MK403151	Original	180.00	?
2446	R/WING TRIM	MK403152	Original	180.00	?
2810	CAB SUPPORT	MK622583	Original	650.00	—
4057	FUEL TANK	ML280148	Original	900.00	—
4059	FRT TANK STRAP	MK473712	Original	160.00	—
4060	REAR TANK STRAP	MK473712	Original	160.00	2
4069	FRONT TANK CARRIER	MK473711	Original	150.00	?
4070	REAR TANK CARRIER	MK473711	Original	150.00	?
4330	R/IN INSTR PNL REINF	MK569091	Original	420.00	?
4331	INSTRUMENT PANEL	MK569705	Original	1,400.00	?
4344	R/INSTR PANEL COVER	MK569168	Original	1,100.00	?
4352	GLOVEBOX	MK569186	Original	380.00	?
4381	COMBI-INSTRUMENT	MK645652	Original	450.00	?
4445	HEATER BLOWER	MK583368	Original	1,800.00	?
4446	HEATER CPL	MK583360	Original	1,200.00	?
4466	CONDENSER CPL	ML272230	Original	750.00	—
4497	REAR PRESSURE HOSE	MK629045	Original	420.00	?
4498	CONDENSER/TANK HOSE	MK574799	Original	380.00	?
4661	LEFT SEAT BELT	MK568848	Original	350.00	X
4662	RIGHT SEAT BELT	MK620642	Original	350.00	X
4941	L/UPP A-PILLAR TRIM	MK405507	Original	240.00	?
4942	R/UPP A-PILLAR TRIM	MK405508	Original	240.00	X
5990	FRAME CROSSMEMBER 1	MK587360	Original	380.00	—
5991	FRAME CROSSMEMBER 2	MK587365	Original	480.00	—
6775	EXPANSION TANK	ME402056	Original	180.00	—
7010	ENGINE CARRIER	MK633800	Original	1,800.00	?
7053	L/F LWR CONTROL ARM	MK527850	Original	650.00	—
7054	R/F LWR CONTROL ARM	MK527855	Original	650.00	?
7081	L/F STEERING KNUCKLE	MK527620	Original	580.00	—
7082	R/F STEERING KNUCKLE	MK527621	Original	580.00	?
7123	L/F INN WHEEL BRG	MH043168	Original	280.00	—
7124	R/F INN WHEEL BRG	MH043168	Original	280.00	?
7201	L/FR WHEEL	ML106452	Original	280.00	—
7202	R/FR WHEEL	ML106452	Original	280.00	?
7300	STEERING GEAR	MK590224	Original	1,400.00	—
7359	STEERING COLUMN CPL	MK569670	Original	1,300.00	2
7701	INTERCOOLER	ME418616	Original	3,200.00	?
7761	RADIATOR	ME418717	Original	1,100.00	?
7767	RADIATOR SHROUD	ML241486	Original	280.00	?
7773	LWR RADIATOR HOSE	ME417966	Original	70.00	?
7776	UPPER RADIATOR HOSE	ME418848	Original	75.00	?
7793	COOLING FAN	ML242320	Original	135.00	?
8391	AIR FILTER ASSY	ME422881	Original	480.00	—
8407	AIR INTAKE HOUSING	ME423356	Original	320.00	?
9266	R/R DRIVE SHAFT	MK610434	Original	800.00	?

Code	Description	Part Number	Part Source		Price SGD
9549	L/R OUTER WHEEL	ML106452	Original	Pu X	280.00
9550	R/R OUTER WHEEL	ML106452	Original	Pu ✓	280.00
1000	RH DOOR SPEAKER	RH FRONT DOOR	Original	Pu ✓	220.00
1001	LH DOOR SPEAKER	LH FRONT DOOR	Original	?	0.00
1002	RH DR ARCH RUB SEAL	RH FRONT DOOR	Original	GA ✓	45.00
1003	LH DR ARCH RUB SEAL	LH FRONT DOOR	Original	✓	45.00
1004	RH DOOR VENT GRILLE	RH FRONT DOOR	Original	Pu X	65.00
1005	LH DOOR VENT GRILLE	LH FRONT DOOR	Original	Pu ✓	65.00
1006	RH DR ENTER GARNISH	CABIN	Original	Pu ✓	140.00
1007	LH DR ENTER GARNISH	CABIN	Original	Pu ✓	140.00
1008	RH DOOR WIND SWITCH	RH FRONT DOOR	Original	?	260.00
1009	LH DOOR WIND SWITCH	LH FRONT DOOR	Original	?	260.00
1010	GEAR SHIFT STICK	CABIN	Original	?	150.00
1011	DASHBOARD FUSEBOX	DASHBOARD	Original		750.00 ?
1012	HEATER HOSE INLET	HEATER	Original	Pu	240.00 ✓
1013	HEATER HOSE OUTLET	HEATER	Original	Pu	220.00 ✓
1014	AIR COND FAN ASSY	AIR CON	Original	Pu	1,200.00 ✓
1015	LH FRONT BRAKE LINE	BRAKE	Original	Pu	140.00 ✓
1016	RH FRONT BRAKE LINE	BRAKE	Original	Pu	140.00 ✓
1017	CLUTCH LINE	GEARBOX	Original	Pu	180.00 ✓
f: OEM Parts					0.00
n: Non-OEM Parts					47,135.00
u: Used parts					
Savings					0.00
Subtotal					47,135.00
Total					47,135.00

Extras

Code	Description	Price SGD
1019	RH FRONT TYRE TYRE	120.00*
1020	LH FRONT TYRE TYRE	120.00*
1023	RH REAR OUTER TYRE TYRE	120.00*
1024	LH REAR OUTER TYRE TYRE	120.00*
1025	ECU diagnostic ECU diagnostic	150.00*
1026	Electrical work Electrical work	45.00*
1027	Engine coolant Engine coolant	30.00*
1028	Air con coolant Air con	50.00*
1029	Front number plate Number Plate	35.00*
1030	Wheel alignment Wheel alignment	60.00*
1031	Rear number plate Rear No Plate	35.00*
1032	REAR CARGO BOX REAR	4,800.00*
1033	REAR POWER TAILGATE REAR	8,500.00*
1034	RH COMPANY STICKER RH DOOR	25.00*
1035	LH COMPANY STICKER LH FRONT DOOR	25.00*
Total Extras		14,235.00

Final Calculation

	SGD	SGD
Parts	47,135.00	
Total Parts		47,135.00
Labour Time Base 10 WU/h		
Total 635.0 WU X 42.00 SGD/h	2,667.00	
Total of Labour		2,667.00
Total Of Extras		14,235.00
Paint Work Time Base 10 WU/h		
Labour Cost 257.0 WU X 42.00 SGD/h	1,079.40	
Material Cost	364.30	
Total Paint Including Material		1,443.70
Repair Cost Excludes GST		65,480.70
GST (+7.0%)		4,583.65
Repair Cost Included GST		70,064.35

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Business

Owner ID:

196M

Vehicle Details

Vehicle No.:

GBE5953S

Vehicle to be Exported:

Yes

Intended Deregistration Date:

20 Sep 2021

Vehicle Make:

MITSUBISHI

Vehicle Model:

CANTER FEA01BR2SDEB (CBU)

Primary Colour:

White

Manufacturing Year:

2015

Engine No.:

4P10B88065

Chassis No.:

FEA01BA10182

Maximum Power Output:

-

Open Market Value:

\$25,359.00

Original Registration Date:

28 Jan 2016

First Registration Date:

28 Jan 2016

Transfer Count:

1

Actual ARF Paid:

\$1,268.00

Intended PARF Rebate Details

PARF Eligibility:

No

PARF Eligibility Expiry Date:

-

PARF Rebate Amount:

\$0.00

Intended COE Rebate Details

COE Expiry Date:

27 Jan 2026

COE Category:

C - Goods Vehicle & Bus

COE Period(Years):

10

QP Paid:

\$46,001.00

COE Rebate Amount:

\$20,020.00

Total Rebate Amount:

\$20,020.00

The information contained herein is correct as at 20 Sep 2021

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 20/09/2021 17:33 (SGT)
Date of Accident 17/09/2021 06:00 (SGT)
Exact Location of Accident Jurong West Ave 2, Singapore
Additional Location Information Jurong West Ave 2 towards Corporation Road
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBE5953S

INSURED/POLICYHOLDER

Is company? Yes
Name Of Registered Owner On The Fly
Company Reg No 5XXXX196M
Email Address ontheflycourierservice@gmail.com
Mobile Phone No (Phone) +65-96906587
Alternative Phone No (Home) +65-96906587

VEHICLE PARTICULARS

Manufacturer Mitsubishi
Model CANTER FEA01BR2SDEB (CBU)
Variant -
Exact purpose for which vehicle was being used at time of accident Employment
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Commercial vehicle
Transmission Manual
CC 2998

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMCVSNW00010372100
Cover Note Number -

DRIVER

Name of Driver Muhammad Shafirul Bin Zainun
NRIC No SXXXX448H