

ASS. REC. BY: TGUM

REF: -

CS/CT/21010104/B+CDemarc

ASSIGNMENT

From: _____ Date: 4/10/2021

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SKJ 5093RAt Workshop n/s: Bifrost Autoof 8 Kaki St Ave H Premier # 01-49

Insured: _____

Policy No: _____

Claims No: _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: A2,000/-

IDAC Accident Report: _____ Consistent? Yes or No

CIA / PR Seen: _____ Consistent? Yes or No

Est. Repair: 7 days Res: Yes or No

Turn Sum: _____ % 3 Vals: Yes or No

CA / REV / REP. / 24 HRS W/

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SKJ 5093R Yr Regn: 12/A/2013Type: ☒ Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /☐ Truck / ☐ Trailer or _____Make: BMW 316i cc: 1598Colour: Blue AC: ☐ Insured / ☐ Std / ☐ NI / ☐ NASp. Reading: 130602 T/Radio: ☐ Insured / ☐ Std / ☐ NI / ☐ NAEng/No: A470J424N13B16AC/No: WBA3A12060171953Gen. Cond: Good / Fair / ☒ Poor / BurntSteering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orBrake: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orModi: ☒ Nil / ☐ STD Rim / ☐ STD A/Rim orTyre Size: F: 225/40/19R: 255/40/19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or ACTENZO

Front: _____ Rear: _____

R/Bal: 6 mm R/Bal: 6 mmL/Bal: 6 mm L/Bal: 6 mmD.O.A: 26/9/2021 D.O.I: 4/10/2021Survey field at BifrostDes. of Damages: ☒ Front / ☐ Rear / ☐ O/S / ☐ N/S / ☐ U/C / ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Range 18,000/- - 12,000/-Recommended CoR is LS 14,000.00 TGUM MM 19/3/202216/9/22 lump Sum \$ 14000 and 7 days
(Red, 8006.10, 36%)WV 42,000/-RV 25,651/-N 16,349/-TGUM MM22/10/2021

Date/Time, File Pass by?

☐ Preli. Report16/9/22☐ Final Report

Date/Time, File Return to?

Days Of Repair: 7

Resurvey No. of Trip: _____

Add Fee:

☐ Site Insp (\$ _____)☐ Interview (\$ _____)☐ Tech. Invs (\$ _____)☐ Weekend (\$ _____)

Survey Fee

Transportation

S. + RS. \$ _____

Photos

Films

TOTAL

Pay ☒ Sumat:Lump Sum / G/L: 14000

Take note.

le-send

ASS. REC. BY: TGumREF: CS/CT/21010104/B/C

ASSIGNMENT

From: _____

Date: 4/10/2021

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKJ5093Rat Workshop m/s Bifrost Autoof 8 Kaki Pt Ave 4 Premier # 01-49

Insured: _____

Policy No. _____

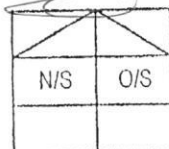
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 42,000/-

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 7 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS WP

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SKJ5093RYr Regn: 12/A/2013Type: ☒ Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or _____

Make: BMW 316i c.c. 1598Colour: Blue A/C: ☐ Insured / ☐ Std / ☐ NI / ☐ NASp. Reading: 130602 T/Radio: ☐ Insured / ☐ Std / ☐ NI / ☐ NAEng/No: A4701424N13B16AC/No: WBA3A12060719953Gen. Cond: Good / Fair / Poor / BurntSteering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orBrake: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orModi: Nil / ☒ STD / ☐ STD A/Rim orTyre Size: F: 225/40/19R: 225/40/19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or ALTEZZO

Front

Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 26/9/2021 D.O.I. 4/10/2021Survey held at BifrostDes. of Damages: ☒ Fr / ☐ Rear / ☐ O/S / ☐ N/S / ☐ U/C / ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	Range <u>18,000/-</u> - <u>19,000/-</u> Confirm check with Bryan
	Recommended COR is NV <u>16,300.00</u> COR LS \$ <u>18,200.00</u> is higher than NV confirm <u>16300/-</u>
	MV <u>42,000/-</u> PV <u>25,651/-</u> NV <u>16,349/-</u> 18/03/22 - to submit. <u>Tekin</u> 22/10/2021

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Report Format: _____

Lump Sum / L.B.I. / _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS. \$ _____

Photos

Others

TOTAL

BIFROST AUTO PTE LTD

8 KAKI BUKIT AVE 4, PREMIER @ KAKI BUKIT #01-49 SINGAPORE 415875

Tel: +65 64524457

Fax: +65 64524584

Company Reg No: 201929175W

D

Vehicle No: SKJ5093R
Make and model: BMW 316i
Chassis: WBA3A12060J719953

Qty	Spare parts		List price
1	Bonnet	\$	✓ 1,281.00 BTU
1	Bonnet RH hinge	\$	-81.00 } NDX
1	Bonnet LH hinge	\$	-81.00 }
1	Bonnet RH lock	\$	-89.00 } NDX
1	Bonnet RH lock catch	\$	-29.00 }
1	Bonnet LH lock	\$	-89.00 } NDX
1	Bonnet LH lock catch	\$	-32.00 }
1	Bonnet inner insulator	\$	189.00 NDX
1	Front bumper emblem	\$	-89.00 NDX
1	Front bumper towing cover	\$	-39.00 NDX
1	Front bumper RH side retainer	\$	✓ 32.00 } NECV
1	Front bumper LH side retainer	\$	✓ 32.00 }
1	Front bumper RH side bracket	\$	25.00 } NSX
1	Front bumper LH side bracket	\$	-25.00 }
1	Front bumper reinforcement	\$	✓ 452.00 ? DDV
1	Front bumper reinforcement LH bracket	\$	✓ 56.00 } ? DDV
1	Front bumper reinforcement RH bracket	\$	✓ 56.00 }
1	Front bumper inner sponge	\$	✓ 75.00 ? BRV
1	Front bumper inner upper rubber	\$	✓ 152.00 } NDX
1	Front bumper LH lower duct cover	\$	✓ 164.00 } BRV
1	Front bumper lower beam	\$	✓ 136.00 } ? BRV
1	Front bumper lower beam RH bracket	\$	70.00 95.00 } DDV
1	Front bumper lower beam LH bracket	\$	70.00 95.00 }
1	Front bumper inner support garnish	\$	48.00 NSX
1	Front engine lower cover	\$	234.00 NDX
1	Front washer tank	\$	156.00 ? NDX
1	LH headlamp assy	\$	✓ 2,131.00 BRV
1	LH headlamp nozzle washer cover	\$	✓ 38.00 CUTV
1	LH headlamp nozzle washer	\$	✓ 178.00 ? BR
1	LH headlamp top panel	\$	✓ 85.00 ? BTU
1	LH headlamp top bracket	\$	✓ 22.00 ? BTU
1	LH headlamp HID bulb	\$	220.00 376.00 } BRV
1	LH headlamp HID control unit	\$	666.00 835.00 } SCV
1	RH headlamp assy	\$	✓ 2,131.00 ? BRV
1	Front top panel	\$	202.00 } ? NSX
1	Front top panel centre bracket	\$	28.00 }

1	Front support panel	\$	593.50	780.00	BT ✓
1	Aircon condenser	\$		✓ 983.00	DDV ✓
1	Radiator assy	\$		✓ 1,010.00	DDV ✓
1	Radiator fan asst	\$	1085.50	1,120.00	BR ✓

\$	13,751.00
-5% \$	687.55
\$	13,063.45

Qty Spare parts

Special Nett price

1 set	Bonnet inner insulator clips	\$		80.00	NNX
1	Front bumper (M series sport)	\$		✓ 1,800.00	BR ✓
1	Front bumper lower spoiler	\$	800.00	1,200.00	BR ✓
1	Front RH grille (M series sport)	\$		✓ 320.00	BR ✓
1	Front RH grille surround moulding (M series sport)	\$		✓ 220.00	BR ✓
1	Front LH grille (M series sport)	\$		✓ 320.00	BR ✓
1	Front LH grille surround moulding (M series sport)	\$		✓ 220.00	BR ✓
1	Front bumper centre lower grille (M series sport)	\$		✓ 285.00	BR ✓
1 set	Front bumper clips	\$	30.00	80.00	NECV ✓
1	Front number plate	\$	20.00	80.00	NECV ✓
			4015.00		

Labour and painting

Labour charges to remove, check, replace and reinstall damages bodyparts. To panel beating, cut / weld and re-align all affected panels	\$	600.00	1,200.00	✓
Spray painting on affected panels	\$	600.00	1,200.00	✓
Check wiring and lighting system	\$		100.00	NNX
Apply rust coating chemical on affected panels	\$		80.00	NNX
Remove and replace aircon condenser and pipes to assist repair. To refill aircon gas	\$	120.00	220.00	✓
Remove and replace radiator assy, hoses and fan assy to assist repair. To refill coolant	\$	100.00	200.00	✓
Refocus and adjust headlamps assy	\$		50.00	NNX
Reset and diagnose fault code after repair	\$	120.00	350.00	NECV

Lump sum repair
Repair days 7

Total: \$ 21,068.45

1540.00

22006.1

Surrey
4/10/2021
1300 hrs

Requrey
7/10/2021
1507 hrs

Twin

Twin

BIFROST AUTO PTE LTD

8 KAKI BUKIT AVE 4, PREMIER @ KAKI BUKIT #01-49 SINGAPORE 415875

Tel: +65 64524457

Fax: +65 64524584

Company Reg No: 201929175W

Supplementary

Vehicle No: SKJ5093R
Model and make: BMW 316i
Chassis WBA3A12060J719953

Qty	Parts	List price
1	Intercooler	\$ 987.00 DDV
		\$ 987.00
		-5% \$ 49.35
		\$ 937.65

Final amount: \$ 937.65

Parts 17,193.00
SN 4,015.00
Labour 1,540.00
22,748.00
@ 20% 4,543.60
18,198.40

OR 45 18,200/2

TG Lim
22/10/2021

NV 16300/2 recommended

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	444W
Vehicle Details	
Vehicle No.:	SKJ5093R
Vehicle to be Exported:	Yes
Intended Deregistration Date:	27 Sep 2021
Vehicle Make:	B.M.W.
Vehicle Model:	316i 1.6 AT D/AB-4DR ABS-HID
Primary Colour:	Black
Manufacturing Year:	2013
Engine No.:	A470J424N13B16A
Chassis No.:	WBA3A12060J719953
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$33,318.00
Original Registration Date:	12 Apr 2013
First Registration Date:	12 Apr 2013
Transfer Count:	0
Actual ARF Paid:	\$28,646.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	11 Apr 2023
PARF Rebate Amount:	\$15,755.00
Intended COE Rebate Details	
COE Expiry Date:	11 Apr 2023
COE Category:	A - Car (1600cc & below)
COE Period(Years):	10
QP Paid:	\$64,209.00
COE Rebate Amount:	\$9,896.00
Total Rebate Amount:	\$25,651.00

The information contained herein is correct as at 27 Sep 2021

OK

MV 42,000/2

PV 25,651/2

NV 16,349/2

Tim Min
27/9/2021

Best Condition. 100% Accident-Free. Wear And Tear All Done Up. Buy With A Peace Of Mind. STA/Workshop Evaluation Welcome. Bank/L...

Posted: 03-Aug-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i Sport****\$41,800****\$17,600 /yr****20-May-2013****1,598 cc****136,000 km****Luxury****Available**

100% Loan Available, Good Condition And Well Taken Care Of, Unique Red Exterior With Sporty Black Interior, Great On Fuel Efficiency And Reliability. Optional Warranty Available. Consignment Unit! Trade In And Loan Welcome! Call Now

Prem Roy Motoring

Posted: 25-Aug-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i (New 10-yr COE)****\$98,800****\$9,870 /yr****17-May-2013****1,598 cc****108,794 km****Luxury****Available**

Newly Installed M3 Full Kit Bodykit (Wide Rear), New 19"inch Rims, New Tires, New Carbon Lip/Skirt/Diffuser/Spoiler. Head Turner. Our In-House Workshop Have Done Up Most Of The Wear And Tear. Hassle Free! Guaranteed No Wasted Trips To Our Showroom. We Provide Q...

United Motoring Pte Ltd

Posted: 13-Oct-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i Sport****-****N.A****09-May-2013****1,598 cc****-****Luxury****SOLD**

Reserved.

Posted: 01-Aug-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i



Save \$600 on your car insurance

Get cheapest car insurance quotes from Top 10 Insurers, only until 31 Oct. Free excess waiver if you visit an appointed workshop under your insurer. All with flexible payment methods to best suit your needs.

Get a Cheaper Quote Now!

**BMW 3 Series 316i Sport****-****N.A****19-Apr-2013****1,598 cc****-****Luxury****SOLD**

Consignment Unit, Low Mileage, Well Maintained Full Loan Arrangeable Must View Dont Miss It!

Posted: 24-Aug-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i Sport (New 10-yr COE)****\$89,800****\$8,980 /yr****17-Apr-2013****1,598 cc****87,000 km****Luxury****Available**

Available! Price Is Based On Loan Amount, High Trade In Value! Low Interest! Hurry, 100% Loan Available At Attractive Rates! Call In To Enquire For More!

Posted: 20-Oct-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i (New 10-yr COE)****\$98,800****\$9,870 /yr****12-Apr-2013****1,598 cc****131,000 km****Luxury****Available**

Newly Installed M3 Full Kit Bodykit (Wide Rear), New 19"inch Rims, New Tires, New Carbon Lip/Skirt/Diffuser/Spoiler. Head Turner. Our In-House Workshop Have Done Up Most Of The Wear And Tear. Hassle Free! Guaranteed No Wasted Trips To Our Showroom. We Provide Q...

United Motoring Pte Ltd

Posted: 13-Oct-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i Sport (New 10-yr COE)****\$92,888****\$9,280 /yr****29-Mar-2013****1,598 cc****119,800 km****Luxury****Available**

Don't Miss! New Battery Replaced, Well Maintained, Stock Condition, Accident Free, Flexible Loan Up To 100% Tailor To Suit Your Budget, Must View To Appreciate!

Posted: 20-Oct-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i Sport****-****N.A****29-Mar-2013****1,598 cc****-****Luxury****SOLD**

Authentic Mileage Verifiable From PML, 100% No Oil Leak As Owner Just Spent Thousands To Overhaul Engine Months Ago With Receipts To Prove. Able To Go 800km Per Tank, Super Fuel Efficient! Viewing By Appointment Only! View To Believe The Condition!

Posted: 14-Sep-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i Sport****\$42,888****\$19,970 /yr****28-Mar-2013****1,598 cc****116,000 km****Luxury****Available**

Don't Miss! Low Mileage Done, Very Well Maintained, Smooth Engine And Gearbox, Stock Condition, Accident Free, Flexible Loan Up To 100% Tailor To Suit Your Budget, Must View To Appreciate!

Posted: 20-Oct-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i

**BMW 3 Series 316i Sport****-****N.A****28-Mar-2013****1,598 cc****-****Luxury****SOLD**

Drive With Assurance! Genuine And Transparent Deal! Flexible Bank/In House 100% Loan/Trade-in Available! All Our Consignment Cars Are Selling At The Most Reasonable Price With A Peace Of Mind! STA Inspection Welcome! Best Deal Assured! Visit Our Website For Best...

CarQuota Singapore

Posted: 20-Aug-2021 Tags: 2013 BMW 316i, BMW 316i, BMW, 316i



Date of Accident : 26/9/21 Accident Time: 450pm (24-HR-FORMAT)
Accident Place : WEGA plaza 3rd floor
Vehicle Reg. No (Car plate No.) : SKJ5043R Vehicle Make/Model: BMW 316
Insurance Company : NTUC Policy No. 5115340134-01
Name of Registered Owner : Company / Individual UNITED MOTORING PTE LTD
ID of Registered Owner : Co Reg No: 2016347594 Owner's NRIC No: 1
: Co Contact No: 1 Owner's Contact No: 93258888
DRIVER'S Name : 1 **DRIVER'S NRIC No:** 1
DRIVER'S Date of Birth : 1 **DRIVER'S License Pass Date** 1
Relationship bet. Owner & Driver : Spouse \ Parents \ Children \ Sibling \ Employee \ Others: 1
DRIVER'S Address : 1
DRIVER'S Contact No./ Alt No. : 1) 1 2) 1
DRIVER'S Occupation : INDOOR \ OUTDOOR (eg. working inside or outside of an ofc)
Email Address : 1
Weather & Road Surface : CLEAR & DRY \ RAINING & WET \ AFTER RAIN & WET
Reporting Type : Reporting Only \ Claim Other Party \ Claim Own Insurance
Number of Passengers (including Driver): 0 Name & Gender; 1
Was the accident reported to the police? YES \ NO
Was there any video Captured by car camera: YES \ NO
Exact purpose for which vehicle was being used at the time of accident: Private use \ Work purpose
Any injuries, if yes(name of the injured person) 1

Other Party Driver's Particulars (if any)

Vehicle Reg No: <u>SMV 868T</u>	Vehicle Reg No: <u>SKH 9641T</u>
Vehicle Make/Model: <u>1</u>	Vehicle Make/Model: <u>1</u>
Name DRIVER: <u>1</u>	Name DRIVER: <u>1</u>
IC No. DRIVER: <u>1</u>	IC No. DRIVER: <u>1</u>
DRIVER'S Contact & add: <u>1</u>	DRIVER'S Contact & add: <u>1</u>

Describe Circumstances of the Accident

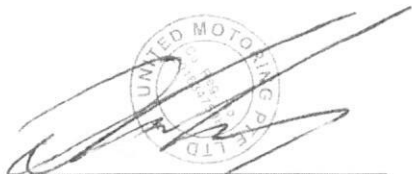
ON THE STATED TIME & DATE, MY CAR WAS PARKED AT

MY SEASON PARKING LOT. I CAME BACK TO FIND DAMAGE ON

MY VEHICLES.

Declaration

We declare the foregoing particulars are true in every respect.

A circular stamp with the text "UNITED MOTOR PACIFIC LTD." around the perimeter. Overlaid on the stamp is a handwritten signature in dark ink.

BIFROST AUTO PTE LTD

8 KAKI BUKIT AVE 4, PREMIER @ KAKI BUKIT #01-49 SINGAPORE 415875

Tel: +65 64524457

Fax: +65 64524584

Company Reg No: 201929175W

D

Vehicle No: SKJ5093R
Make and model: BMW 316i
Chassis: WBA3A12060J719953

Qty	Spare parts		List price
1	Bonnet	S	✓ 1,281.00 BTU
1	Bonnet RH hinge	S	81.00 } NDX
1	Bonnet LH hinge	S	81.00 }
1	Bonnet RH lock	S	89.00 } NDX
1	Bonnet RH lock catch	S	29.00 }
1	Bonnet LH lock	S	89.00 } NDX
1	Bonnet LH lock catch	S	32.00 }
1	Bonnet inner insulator	S	189.00 NDX
1	Front bumper emblem	S	89.00 NDX
1	Front bumper towing cover	S	39.00 NDX
1	Front bumper RH side retainer	S	✓ 32.00 } NZC
1	Front bumper LH side retainer	S	✓ 32.00 }
1	Front bumper RH side bracket	S	25.00 } NSX
1	Front bumper LH side bracket	S	25.00 }
1	Front bumper reinforcement	S	✓ 452.00 ? DP
1	Front bumper reinforcement LH bracket	S	✓ 56.00 } ? DP
1	Front bumper reinforcement RH bracket	S	✓ 56.00 }
1	Front bumper inner sponge	S	✓ 75.00 ? BRV
1	Front bumper inner upper rubber	S	✓ 152.00 } NDA
1	Front bumper LH lower duct cover	S	✓ 164.00 } BRV
1	Front bumper lower beam	S	✓ 136.00 } ? BRV
1	Front bumper lower beam RH bracket	S	70.00 95.00 } DP
1	Front bumper lower beam LH bracket	S	70.00 95.00 } DDV
1	Front bumper inner support garnish	S	48.00 } NSX
1	Front engine lower cover	S	234.00 } NDX
1	Front washer tank	S	156.00 } ? NDX
1	LH headlamp assy	S	✓ 2,131.00 BRV
1	LH headlamp nozzle washer cover	S	✓ 38.00 } CTV
1	LH headlamp nozzle washer	S	✓ 178.00 } ? BR
1	LH headlamp top panel	S	✓ 85.00 } ? BTU
1	LH headlamp top bracket	S	✓ 22.00 } ? BTU
1	LH headlamp HID bulb	S	220.00 376.00 } ? BRV
1	LH headlamp HID control unit	S	666.00 835.00 } ? SCV
1	RH headlamp assy	S	✓ 2,131.00 ? BRV
1	Front top panel	S	202.00 } ? NSX
1	Front top panel centre bracket	S	28.00 }

- 1 Front support panel
- 1 Aircon condenser
- 1 Radiator assy
- 1 Radiator fan asst

\$	593.50	780.00	} BT ✓ } DD ✓ } DD ✓ } BR ✓
\$		✓ 983.00	
\$		✓ 1,010.00	
\$	1085.50	1,120.00	

\$	13,751.00
-5% \$	687.55
\$	13,063.45

Qty Spare parts

Special Nett price

- 1set Bonnet inner insulator clips
- 1 Front bumper (M series sport)
- 1 Front bumper lower spoiler
- 1 Front RH grille (M series sport)
- 1 Front RH grille surround moulding (M series sport)
- 1 Front LH grille (M series sport)
- 1 Front LH grille surround moulding (M series sport)
- 1 Front bumper centre lower grille (M series sport)
- 1set Front bumper clips
- 1 Front number plate

\$		80.00	NNX
\$		✓ 1,800.00	BR ✓
\$	801.00	1,200.00	BR ✓
\$		✓ 320.00	BR ✓
\$		✓ 220.00	BR ✓
\$		✓ 320.00	BR ✓
\$		✓ 220.00	BR ✓
\$		✓ 285.00	BR ✓
\$	30.00	80.00	NECV ✓
\$	20.00	80.00	NECV ✓
		<u>4015.00</u>	

Labour and painting

Labour charges to remove, check, replace and reinstall damages bodyparts.
To panel beating, cut / weld and re-align all affected panels

\$	600.00	1,200.00
----	--------	---------------------

Spray painting on affected panels

\$	600.00	1,200.00
----	--------	---------------------

Check wiring and lighting system

\$		100.00	NNX
----	--	-------------------	-----

Apply rust coating chemical on affected panels

\$		80.00	NNX
----	--	------------------	-----

Remove and replace aircon condenser and pipes to assist repair. To refill aircon gas

\$	120.00	220.00	✓
----	--------	-------------------	---

Remove and replace radiator assy, hoses and fan assy to assist repair. To refill coolant

\$	160.00	200.00	✓
----	--------	-------------------	---

Refocus and adjust headlamps assy

\$		50.00	NNX
----	--	------------------	-----

Reset and diagnose fault code after repair

\$	120.00	350.00	NECV
----	--------	-------------------	------

Total: \$ 21,068.45

1540.00

Survey
A/10/5021
1300 hrs
Razvaney
7/10/2021
1507 hrs
1000 hrs

BIFROST AUTO PTE LTD

8 KAKI BUKIT AVE 4, PREMIER @ KAKI BUKIT #01-49 SINGAPORE 415875

Tel: +65 64524457

Fax: +65 64524584

Company Reg No: 201929175W

Supplementary

Vehicle No: SKJ5093R
Model and make: BMW 316i
Chassis: WBA3A12060J719953

Qty Parts

List price

1 Intercooler

S

✓ 987.00

DDV

S

987.00

-5%

S

49.35

S

937.65

Final amount: S

937.65

Part B

11,926.30

SN

4,015.00

Labour

1,540.00

17,481.30

@ 20%
13985.04

3,496.26

13985.04

LS

14,000/2

TGlim kin

19/3/2022

NV 16340/2

LKK Auto Consultants hereby notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: