

ASS. REC. BY: Marcus

REF:

CS/11121010152/49f3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

SMA5637X

at Workshop m/s

Sun

of

Insured:

Policy No.

Claims No.

MPC2021D0004209

Sum Insured:

Excess:

600


(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its

repair at the time of inspection.

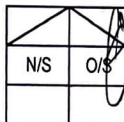

Bal. or Market Value:

\$60k.

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

14

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

305E

Vehicle: IN / OUT

Date:

Person Contacted:

0278

Veh No:

SMA5637X

Yr Regn:

13/10/18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA/ GLS

Make:

Hyundai Elentra

c.c

1591

Colour:

Red

A/C:

Insured / Std / NI / NA

Sp. Reading

83414

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

KMHD841CMJU684258

Gen. Cond: Good (Fair) / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

affected

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

habilead

Front

R/Bal.

6

mm

Rear

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

26/9/21

D.O.I.

1/10/21

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

015 PH, 015 B042

The U/C + Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

LYA \$33289 Bal by 8th
net \$26741

15/11/21 L/S \$15,000 confirmed with Kerry (Red \$17077.64, 53%)

Date/Time, File Pass to?

☐

Preli. Report

1) 15/11 Typist

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair:

14

Resurvey No. of Trip:

2

Survey Fee:

Transportation:

Add Fee:

☐

Site Insp (\$

) ___ S + RS, ___ SI

☐

Interview (\$

) Photos

☐

Tech. Invs (\$

) Others

☐

Weekend (\$

)

Report Format :

MER-OD

Lump Sum: \$15000

15000

TOTAL



BLUWEL AUTOMOTIVE SERVICE PTE LTD

1 Kaki Bukit Ave 6 Blk C #01-28/53/55/56 Singapore 417883

Tel: 67452088 Fax: 68412088

E-mail: bluwel2088@yahoo.com.sg

GST Reg No.: 200704951N

Co Reg No.: 200704951N

Not Authorised

Date: 30-09-2021

India International Insurance Pte Ltd

64 Cecil Street

#04/06 IOB Building

Singapore 049711

Policy No.: D19MPC0002723-02

Vehicle No.: SMA5637X

Model: HYUNDAI ELANTRA

D.O.A 26/09/2021

11/10/21
1/5 \$15,000
take the other reg.
14 days
Excess \$600

Estimate Repair Cost For SMA5637X

NO.	DESCRIPTIONS	AMOUNT
1	1 PC FRONT RH HEADLAMP <i>one</i>	\$ 1,198.00 ✓
2	1 PC FRONT RH HEADLAMP LOWER BRACKET <i>one</i>	\$ 28.00 ✓
3	1 PC FRONT BUMPER <i>D.S</i>	\$ 474.40 ✓
4	1 PC FRONT RH BUMPER FOG LAMP <i>1.1</i>	\$ 266.00 ✓
5	1 PC FRONT RH BUMPER FOG LAMP COVER <i>1.1</i>	\$ 115.40 ✓
6	1 PC FRONT RH BUMPER RETAINER <i>one</i>	\$ 27.40 ✓
7	1 PC FRONT RH FENDER <i>D.S</i>	\$ 1,227.70 ✓
8	1 PC FRONT RH FENDER INNER SHIELD <i>70.1</i>	\$ 92.50 ✓
9	1 PC FRONT RH FENDER MUDFLAP <i>D.S</i>	\$ 38.75 ✓
10	1 PC FRONT RH FENDER INNER GARNISH <i>D.S</i>	\$ 68.80 ✓
11	<i>1 set</i> 2 PCS FRONT RH FENDER INNER SHIELD CLIPS <i>one 40</i>	\$ 117.60 ✓
12	1 PC FRONT RH QUARTER FENDER COVER <i>one</i>	\$ 40.50 ✓
13	1 PC FRONT RH FRONT DOOR <i>D.S</i>	\$ 1,831.10 ✓
14	1 PC FRONT RH DOOR ROCKER PANEL <i>body 1545</i>	\$ 249.75 ✓
15	1 PC FRONT RH SIDE MIRROR ASSY <i>D.S</i>	\$ 639 1,054.60 ✓
16	2 PCS FRONT RH DOOR HINGES (UPPER & LOWER) <i>body/one</i>	\$ 97.40 ✓
17	1 PC FRONT RH DOOR CENTRE CATCH <i>1.1</i>	\$ 66.20 ✓
18	1 PC FRONT RH DOOR OUTER HANDLE <i>1.1</i>	\$ 179.10 ✓
19	1 PC FRONT RH DOOR OUTER CHROME MOULDING <i>one</i>	\$ 74.60 ✓
20	<i>1 set</i> 2 PCS FRONT RH DOOR STICKERS <i>one</i>	\$ 62.40 ✓
21	1 PC FRONT RH DOOR GLASS <i>1.1</i>	\$ 240.50 ✓
22	1 PC FRONT RH DOOR GLASS INNER RUBBER SEAL <i>1.5</i>	\$ 77.70 ✓
23	1 PC FRONT RH DOOR WEATHERSTRIP <i>one/one</i>	\$ 72.30 ✓
24	1 PC FRONT RH DOOR INNER BOARD ASSY <i>one/one</i>	\$ 487.95 ✓
25	1 PC FRONT RH DOOR REGULATOR GEAR <i>one</i>	\$ 240.50 ✓
26	1 PC FRONT RH DOOR REGULATOR GEAR MOTOR <i>one</i>	\$ 231.00 ✓
27	1 PC FRONT RH DOOR CONTROL UNIT SWITCH <i>1.1</i>	\$ 185.40 ✓
28	1 PC FRONT RH DOOR PILLAR INNER RUBBER <i>one</i>	\$ 118.70 ✓
29	1 PC FRONT RH ROCKER PANEL STEP GARNISH <i>D.S</i>	\$ 40.21 ✓



BLUWEL AUTOMOTIVE SERVICE PTE LTD

1 Kaki Bukit Ave 6 Blk C #01-28/53/55/56 Singapore 417883

Tel: 67452088 Fax: 68412088

E-mail: bluwel2088@yahoo.com.sg

GST Reg No.: 200704951N

Co Reg No.: 200704951N

NO.	DESCRIPTIONS	AMOUNT
30	1 PC FRONT RH DOOR INNER LOCK ASSY <i>twi/jm</i>	\$ 194.20 ✓
31	1 PC FRONT RH DOOR PILLAR INNER GARNISH <i>ns</i>	\$ 78.80 ✗
32	1 PC REAR RH ROCKER PANEL STICKER <i>11</i>	\$ 18.50 ✗
33	1 PC REAR RH DOOR STICKER <i>nel</i>	\$ 24.60 ✓
34	1 PC REAR RH DOOR PILLAR INNER RUBBER <i>11</i>	\$ 118.70 ✗
35	1 PC REAR RH DOOR CENTRE CATCH <i>11</i>	\$ 64.20 ✗
36	1 PC REAR RH DOOR <i>Bent/maged</i>	\$ 1,775.20 ✓
37	2 PCS REAR RH DOOR STICKERS <i>nel</i>	\$ 51.20 ✓
38	2 PCS REAR RH DOOR HINGES (UPPER & LOWER) <i>sel</i>	\$ 97.40 ✗
39	3 PCS REAR SEAT BELTS <i>11</i>	\$ 1,889.94 ✗
40	3 PCS REAR SEAT BELTS CATCH <i>11</i>	\$ 508.11 ✗
41	1 PC ROOF TOP INNER BOARD ASSY <i>twi/jm</i>	\$ 847.90 ✓
42	1 PC ROOF TOP RH INNER BOARD AIR BAG <i>Actual</i>	\$ 635.35 ✓
43	1 PC ROOF TOP LH INNER BOARD AIR BAG <i>11</i>	\$ 635.35 ✗
44	2 PCS L&R SEAT BELTS ASSY <i>ols Actual 115X 600</i>	\$ 1,461.40 <i>12c</i>
45	2 PCS L&R SEAT BELTS CATCH <i>11</i>	\$ 498.74 ✗
46	1 PC FRONT RH SEAT ASSY WITH AIR BAG <i>Bus/Actual 2100</i>	\$ 2,336.56 ✓
47	1 PC SRS UNIT ASSY <i>11</i>	\$ 148.48 ✗
48	1 PC ECU UNIT ASSY <i>Actual</i>	\$ 478.70 ✓
49	1 PC FRONT RH SHOCK ABSORBER <i>Bent 355.00</i>	\$ 372.50 ✓
50	1 PC FRONT RH SHOCK MOUNTING <i>twi 125.20</i>	\$ 126.90 ✓
51	1 PC FRONT RH SHOCK ABSORBER BEARING <i>11</i>	\$ 81.90 ✗
52	1 PC FRONT RH SHOCK ABSORBER RUBBER <i>11</i>	\$ 35.30 ✗
53	1 PC FRONT RH SHOCK ABSORBER STOPPER <i>11</i>	\$ 31.40 ✗
54	4 PCS FRONT RH ENGINE MOUNTINGS <i>11</i>	\$ 224.25 ✗
55	1 PC FRONT RH LOWER ARM <i>sel</i>	\$ 296.80 ✓
56	1 PC FRONT RH KNUCKLE ARM <i>Bent</i>	\$ 363.60 ✓
57	1 PC FRONT RH KNUCKLE ARM BEARING <i>nel 335.00</i>	\$ 452.80 ✓
58	1 PC FRONT Engine cross member <i>twi/jm 1018.00</i>	\$ 1,214.70 ✓
59	1 PC FRONT Driveshaft RH <i>twi/Bent 950</i>	\$ 1,214.70 ✓
60	1 PC FRONT STAY BAR <i>sel</i>	\$ 209.10 ✗
61	1 PC FRONT RH Linkage <i>twi</i>	\$ 60.45 ✓
62	1 PC FRONT RH DISC ROTOR <i>11</i>	\$ 194.25 ✗
63	1 PC FRONT RH BRAKE CALIPER PIPE HOSE <i>11</i>	\$ 101.70 ✗
64	1 PC FRONT RH SPORT RIM <i>Bent</i>	\$ 600.00 <i>380 s/n</i>
65	1 PC FRONT RH TYRE <i>cut 200 802</i>	\$ 300.00 <i>100 s/n</i>
66	1 PC FRONT WIPER TANK ASSY <i>11</i>	\$ 66.30 ✗
67	1 PC FRONT SUPPORT PANEL <i>11</i>	\$ 949.30 ✗



BLUWEL AUTOMOTIVE SERVICE PTE LTD

1 Kaki Bukit Ave 6 Blk C #01-28/53/55/56 Singapore 417883

Tel: 67452088 Fax: 68412088

E-mail: bluwel2088@yahoo.com.sg

GST Reg No.: 200704951N

Co Reg No.: 200704951N

NO.	DESCRIPTIONS	AMOUNT
68	1 PC FRONT ENGINE COVER UNDERCARRIAGE 1 1	\$ 133.30 X
		\$ 27,897.04
	LESS 20%	\$ (5,579.40)
		\$ 22,317.64
	<u>MISC & LABOUR CHARGES</u>	
69	TOWING	\$ 211 150.00 50
70	REMOVE & REFIX FRONT W/SCREEN	\$ 11 150.00 X
71	REMOVE & REFIX FRONT ENGINE ASSY	\$ 11 500.00 X
72	REMOVE & REFIX FRONT UNDERCARRIAGE	\$ 700.00 300
73	REMOVE & REFIX FRONT DASHBOARD	\$ 11 500.00 X
74	REMOVE & REFIX FRONT & REAR SEAT BELTS, SRS UNIT, ECU UNIT, ROOF BOARD & AIR BAG	\$ 800.00 300
75	REMOVE & REFIX PARTS, WELDING, CUT, JACK CHASSIS FRAME & ALIGNMENT	\$ 3,000.00 2000
76	REMOVE AIR CON & REFILL AIR CON GAS	\$ 11 120.00 X
77	RESPRAY WHOLE RH SIDE (INSIDE & OUTSIDE). TOUCH-UP.	\$ 2,800.00 300
78	ELECTRICAL & FOCUS WIRING	\$ 120.00 30
79	SRS & ECU COMPUTER RESETTNG	\$ 800.00 100
80	COMPUTERISE & WHEELS ALIGNMENT	\$ 120.00 60
		\$ 9,760.00
	TOTAL:	\$ 32,077.64

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

18887.41
200
9-1510992
5. N-480
L-4140
19728.92