



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2202516

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 05/05/2022
Reference CC6/CTI21010351/Aga3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SGD 6410G
Insured Veh. SMU 5373B
Claim No. SNM21D205728
Policy No. DMPCSNW00159582101
Accident Date 06/10/2021
Inspection Date 11/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21010351/Aga3q2 Date: 05/05/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMU 5373B	Veh. Inspected	SGD 6410G	
Policy No.	DMPCSNW00159582101	Coverage (\$)	0.00	
Claim No.	SNM21D205728	Excess (\$)	0.00	
Assign From		Assign Date	11/10/2021	
2. Vehicle Particulars & Condition				
Make & Model	HONDA STREAM	c.c	1668	
Engine No.	HIDDEN	Year of Reg.	2006	
Chassis No.	JHMRN18505S200751	Colour	GREY	
Odometer	246328 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/55 R16	CONTINENTAL	6 mm	
L/H Front Tyre	195/55 R16	CONTINENTAL	6 mm	
R/H Rear Tyre	195/55 R16	CONTINENTAL	6 mm	
L/H Rear Tyre	195/55 R16	CONTINENTAL	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/10/2021	Inspection Date	11/10/2021	
Survey held at	PREMIUM CARZ SERVICES PTE LTD 1 KAKI BUKIT AVE 6 # 01-90 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGD 6410G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	760.90	689.00
1	REAR BUMPER SIDE RETAINER RH	NOT NECESSARY	38.70	-
1	REAR BUMPER SIDE RETAINER LH	NECESSARY	38.70	38.70
1	REAR FENDER LH	TO REPAIR SEE LABOUR	965.20	-
1	REAR FENDER QUARTER GLASS MOULDING LH	NOT NECESSARY	110.90	-
1	REAR KNUCKLE ARM LH	DAMAGED	360.80	360.80
1	REAR KNUCKLE ARM BEARING LH	DAMAGED	405.90	405.90
1	REAR LOWER ARM LH	BENT	458.30	458.30
	LESS 20% DISCOUNT		-627.88	-390.54
			2,511.52	1,562.16
<u>SPECIAL NETT ITEMS</u>				
1	SET REVERSE SENSOR (SN)	NOT NECESSARY	220.00	-
10	REAR BUMPER CLIP @\$5.00 (SN)	NECESSARY	50.00	30.00
1	REAR TYRE LH (SN)	NOT NECESSARY	450.00	-
1	REAR SPORTS RIM LH (SN)	CUT	550.00	400.00
1	SEALANT (SN)	NOT NECESSARY	60.00	-
			1,330.00	430.00
<u>LABOUR</u>				
	TO CHECK WIRING .		40.00	30.00
	PANEL BEATING CHARGES TO REMOVE AND REPLACE ,TO CUT AND WELD ,TO KNOCK AND RESHAPE DAMAGED PARTS & AREAS.INCLUSIVE OF THE REPAIR OF REAR FENDER LH .		600.00	400.00
	SPRAY PAINTING ALL AFFECTED PARTS & AREAS .		600.00	400.00
	TO SPRAY ANTI-RUST UNDERCOAT.		30.00	30.00
	TO REMOVE AND REFIT REAR FENDER QUARTER GLASS .	NOT NECESSARY	100.00	-
	TO REMOVE AND REPLACE UNDERCARRIAGE LH.		250.00	180.00
	TO CHECK WHEELS WITH COMPUTERIZED WHEELS ALIGNMENT.		120.00	80.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIT REAR SEATS ,REAR WHEELHOUSE INNER GARNISH ,FLOOR CARPET & UPHOLSTERY TO FACILITATE REPAIRS.		250.00	60.00
			1,990.00	1,180.00
GRAND TOTAL			5,831.52	3,172.16
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,500.00

Report Ref No. CC6/CTI21010351/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGD 6410G

INSPECTION

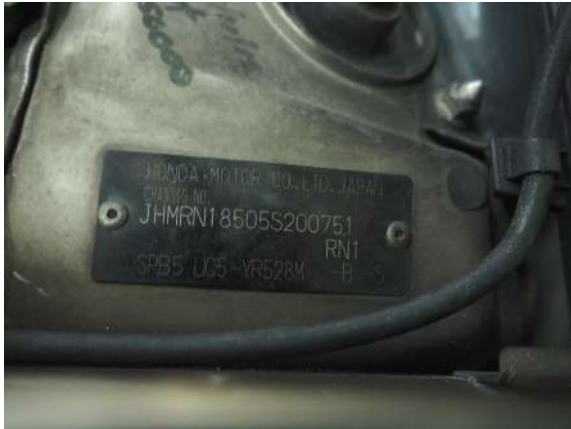



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGD 6410G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGD 6410G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

