

ST Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 60 Arab Street Singapore 199757

Tel: 66523352 / 98586761; Fax: 6297 0270

E mail - ttrajan@singnet.com.sg

Mailing Address: 161 Alexandra Post Office Singapore 911506

Invoice No : **06221**

ORIGINAL

INVOICE

Date : 15 Oct 2021

Our Ref : TP / YKA SJA5824H/ 10.06/21

Your Ref :

CUSTOMER PARTICULARS

Name	:	M/s Yeow Koon Auto Care Pte Ltd
Address	:	C/o 1 Kaki Bukit Avenue 6
		#01-11 AutoBay@KakiBukit
		Singapore 417883

ASSIGNMENT

TP Motor Claims by SJA 5824 H

DESCRIPTION

A set of Survey Report, correspondence & consultation. Other disbursements incurred. Transport charges.

TOTAL

Terms of payment: 7 days from date of invoice

All Payments please make payment to "ST Appraisal Services"

AMOUNT CHARGEABLE

\$600.00

\$600.00



Authorised Signature

Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 60 Arab Street Singapore 199757

Tel: 66523352 / 98586761; Fax: 62970270

Mailing Address : 161 Alexandra Post Office Singapore 911506

Date : 15th Oct 2021

Our Ref : TP / YKA SJA5824H/ 10.06/21

Your Ref :

M/s Yeow Koon Auto Care Pte Ltd

C/o 1 Kaki Bukit Avenue 6

#01-11 AutoBay@KakiBukit

Singapore 417883

DAMAGED VEHICLE (SJA 5824 H) INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows:

(A) Reference

Name of Claimant	: M/s Yeow Koon Auto Care Pte Ltd	Date of Request	: 7 th Oct 2021
		Referred By	: Person in charge
Policy No.	: Please Advice	Date of Inspection	: 7 th Oct 2021
Claim No.	: Please Advice	Date of Re-inspection	:
Accident Date	: 6 th Oct 2021	Sum Insured	: NA
Repairer	: M/s YK Supreme Autowerkz Pte Ltd	Excess Amount	: NA
	1 Kaki Bukit Avenue 6, AutoBay	3 rd Party Vehicle	: Please Advice
	#01-11 Singapore 417883	3 rd Party Insurer	: Please Advice

(B) Particulars of Vehicle

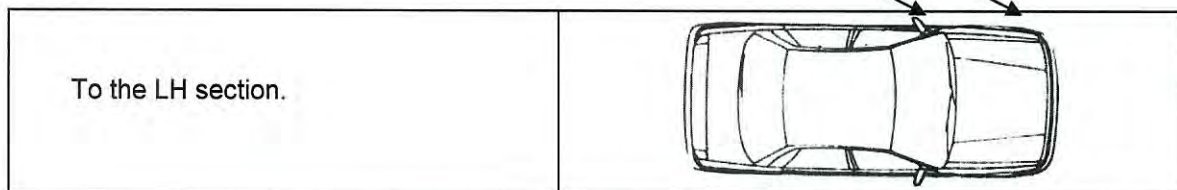
Registration No	: SJA 5824 H	Mileage	: 268525 km
Make & Model	: TOYOTA VIOS E AUTO	Engine No	: 1NZX660329
Year of Registration	: 14 th Dec 2007	Chassis No.	: MR053HY9305039670
Colour	: Silver	Engine Capacity.	: 1,497 cc

(C) Pre-Accident Condition (Static Test Only)

Steering	: Serviceable	Paint Work	: Good
Foot-brake	: Serviceable	Modification	: NIL
Hand-brake	: Serviceable	General Condition	: Good

(D) Tyre Condition

	Tread Depth	Make	Size
Front Left	60 %	WESTLAKE	195/60 R15
Front Right	60 %	WESTLAKE	195/60 R15
Rear Left	70 %	YOKOHAMA	195/60 R15
Rear Right	70 %	YOKOHAMA	195/60 R15

(E) Point of Impact**(F) General Description of Damages**

The impact of the collision has damaged/affected the LH side view mirror, front bumper, front fender, headlamp and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken.

(G) Recommendation

We have inspected thoroughly the actual damages found on the vehicle, before we arrived at our recommendation as to whether the parts needed replacement or repairs.

Our adjusted cost of lump sum repair is **\$6,250.00** and an estimated **7** days is required to repair the vehicle. Please refer to the Annex for a detailed account of the cost estimates.

(H) Remarks

We have not authorised the repairs. However for information, under normal circumstances, the repairs should not exceed **7** days.

This inspection was conducted on a **“without prejudice”** basis.

We are pleased to advice that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

ST Appraisal Services




T T RAJAN
MVI, ITC (Mechanical), NTC (Motor Vehicle)
ASIET, MSAAA, Assessor/Appraiser
AD041-2007532D

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS FOR VEHICLE NO: SJA 5824 H**Adjustment of Spare Parts Costs for Repairs**

Item	Qty	Vehicle parts description	Condition / Remark	Estimated by workshop	Disc. (%)	Adjusted cost (\$S)
1	1	Front bumper	cut/torn	423.13	25	317.35
2	1 set	Front bumper clip	necessary	28.90	25	21.68
3	2	Front bumper side retainer	necessary	76.80	25	57.60
4	1	Front bumper reinforcement	dented	322.60	25	241.95
5	1	Front bumper logo	necessary	48.20	25	36.15
6	1	Front bumper fog lamp	damaged	221.60	25	166.20
7	1	Front bumper fog lamp garnish	serviceable	98.70	100	0.00
8	1	Bonnet	dented	696.90	25	522.68
9	2	Bonnet hinge	serviceable	119.00	100	0.00
10	1	Headlamp LH	cracked/split	1015.60	25	761.70
11	1	Front fender	dented	597.40	25	448.05
12	1	Front fender innershield	folded/torn	154.20	25	115.65
13	1 set	Front fender innershield clips	necessary	26.40	25	19.80
14	1	Front fender badge	necessary	35.50	25	26.63
15	1	Side view mirror	damaged	977.60	25	733.20
16	1	Front door panel	dented	1045.00	25	783.75
17	1	Front door weatherstrip	necessary	148.00	25	111.00
18	2	Front door hinge	serviceable	148.00	100	0.00
19	1 set	Front door trim board clip	necessary	26.80	25	20.10
20	1	Front shock absorber	to replace	349.25	25	261.94
21	1	Front lower arm	to replace	364.00	25	273.00
22	1	Front wheel bearing	to replace	117.60	25	88.20
<u>Special Nett Item</u>						
1	1	Front wheel rim	damaged	380.00		320.00
2	1	Front tyre	damaged	190.00		175.00
Total parts				7611.18		5501.61



Adjustment of Labour Costs for Repairs

To provide towing service	80.00	60.00
To check wiring system for proper functions.	100.00	50.00
To remove and replace front suspension components. To realign replacement parts.	250.00	180.00
To remove and replaced damaged parts including straightening and repositioning replacement parts.	1000.00	900.00
Supply paint material and necessary items. To respray replaced and other affected panels.	1100.00	1000.00
To carry out all wheel alignment and to reset settings where necessary to specifications.	120.00	80.00
To remove and transfer door door fittings and attachments. To check for proper functions.	100.00	0.00
To carry out anti rust treatment.	150.00	80.00
Total labour	2900.00	2350.00

Adjustment Parts and Labour Costs of Repairs

	Estimated by workshop	Adjusted cost (\$\$)
TOTAL PARTS COSTS	7611.18	5501.61
TOTAL LABOUR COSTS	2900.00	2350.00
TOTAL REPAIR COSTS	10511.18	7851.61

ADJUSTED REPAIR COST**6250.00**





















