

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

at

Insured:

Policy No.

Claim No.


Sum Insured:

(Client's Record)

Make of Veh:

(Policy Condition)

Remarks: The veh had commenced its repair at the time of inspection.

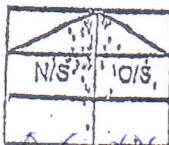

Real. or Market Value:

IDAC Accident Report

PIA / PR Seen:

Est. Repairs:

days

Res.: Yes or No

Sum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

MV-65R

Veh No:

SLL 9044J

Yr Regn:

15/3/17

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda

C.C.

15.97

Colour:

Silver

A/C: Insured / Std / NI / N

Sp. Reading

80645

T/Radio: Insured / Std / NI / N

Eng/No:

C/No:

MRHECS65 DET 99/932

Gen. Cond: Good / Fair / Poor / Bught

Steering: In order / Jammed / Leaked / Burnt or

Brakes: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/50R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

4

mm

R/Bal.

4

mm

L/Bal.

4

mm

L/Bal.

4

mm

D.O.A.

8/12/21

D.O.A.

13/10/21

Survey held at

Koh Motor

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date/Time, File, Photo:



Prell. Report

Days Of Repair:

Date/Time, File, Photo:



Final Report

Resurvey No. of Trips:

Survey Fee:

Transportation:

Add Fee:



Site Insp (\$



Interview (\$



Tech. Insp (\$



Witness (\$

\$ 0.00

Police

Others

TOTAL

**KAH MOTOR CO. SDN. BHD.**

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer	: LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555	Document No.	: SQT21003103	Page	1
Registration No	: SLL9044J	Date	: 9. Oct 2021	Customer No.	: WZL009
Chassis No	: MRHFC5650GT001032	Svc Advisor	: IVAN TEO BOON KIAT	Engine No	: R16B21601331
Model	: CIVIC 1.6 VTI YM2016	Date Time	: 9. Oct 2021 12:12:42 PM	Surveyor Name	:
Owner's Name	: TEH GEK WAH	Survey Date	:	Authorisation Date	:
Ins Policy No.	:				
Date of Accident	: 8/10/2021				

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount incld GST
	TP DIRECT SETTLEMENT (J/NO:) OWNER: TEH GEK WAH OWNER INSURER: LIBERTY ACC DATE: 08/10/2021 SURVEYED BY: DATE: REF NO: TP INSURER: LONPAC TP VEH: XD7971X						
68500-TEA-N00ZZ	LID COMP TRUNK ✓ <i>nn</i>	1	554.90	25	416.17 ✓	29.13	445.30
68610-TEA-T10ZZ	HINGE COMPR.TRUNK ? <i>x nn</i>	1	51.10	25	38.32	2.68	41.00
68660-TEA-T10ZZ	HINGE COMPL.TRUNK ? <i>x nn</i>	1	51.10	25	38.32	2.68	41.00
74829-S84-A00	STOPPER TRUNK LID ? <i>x nn</i>	2	5.20	25	7.80	0.55	8.35
74862-TEA-003	STRIKERTRUNK LID ? <i>x nn</i>	1	8.10	25	6.07	0.42	6.49
74851-TEA-003	LOCK ASSYTRUNK ? <i>x nn</i>	1	84.90	25	63.67	4.46	68.13
74865-TEA-T01	WEATHERSTRIPTRUNK LID ? <i>TV</i>	1	70.00	25	52.50 ✓	3.68	56.18
74890-TEA-T11ZB	GARNISH ASSYRR.LICENSE ✓ <i>BR</i>	1	114.80	25	86.10 ✓	6.03	92.13
75722-TBA-A00	EMBLEM SETRR. ✓ <i>MC</i>	1	13.40	25	10.05 ✓	0.70	10.75
75725-TEA-T01	EMBLEMRR. ✓ <i>MC</i>	1	12.50	25	9.37 ✓	0.66	10.03
34150-TEX-Y01	LIGHT ASSYR.LID ✓ <i>BR</i>	1	139.60	25	104.70 ✓	7.33	112.03
34155-TEX-Y01	LIGHT ASSYL.LID ✓ <i>BR</i>	1	139.60	25	104.70 ✓	7.33	112.03
33500-TEA-T01	TAILLIGHT ASSYR. ✓ <i>BR</i>	1	298.40	25	223.80 ✓	15.67	239.47
33550-TEA-T01	TAILLIGHT ASSYL. ✓ <i>BR</i>	1	321.10	25	240.82 ✓	16.86	257.68
39530-TBA-A01	CAMERA ASSYRR.VIEW ? <i>x nn</i>	1	360.20	25	270.15	18.91	289.06
71500-TEC-Q00ZZ	FACE ASSY,RR.BUMPER ✓ <i>nn</i>	1	617.20	25	462.90 ✓	32.40	495.30
71502-TEX-Y00	GARNISH,RR.BUMPER LOWER <i>x nn</i>	1	41.60	25	31.20	2.18	33.38
71503-TEA-T00	GARNISH,R.RR.BUMPER SIDE <i>x nn</i>	1	8.90	25	6.67	0.47	7.14
71508-TEA-T00	GARNISH,L.RR.BUMPER SIDE <i>x nn</i>	1	8.90	25	6.67	0.47	7.14

Printed on 9/10/2021 12:30:58 PM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s).

An amount of \$53.50 (incl GST) will be applicable for the request of the above quotation for estimates above \$2,000.00.

However, if the repairs are subsequently done at Kah Motor Co. Sdn. Bhd, it will be refunded.



KAH MOTOR CO. SDN. BHD.

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer : LONPAC INSURANCE BHD
300 BEACH ROAD #17-04/07
THE CONCOURSE
SINGAPORE 199555

Registration No : SLL9044J

Chassis No : MRHFC5650GT001032

Model : CIVIC 1.6 VTI YM2016

Owner's Name : TEH GEK WAH

Ins Policy No. :

Date of Accident : 8/10/2021

Document No. : SQT21003103

Page 2

Date : 9. Oct 2021

Customer No. : WZL009

Svc Advisor : IVAN TEO BOON KIAT

Engine No : R16B21601331

Date | Time : 9. Oct 2021 12:12:42 PM

Surveyor Name :

Survey Date :

Authorisation Date :

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount incld GST
71530-TEA-T00ZZ	BEAM COMPRR.BUMPER	1	188.00	25	141.00	9.87	150.87
71593-TEA-T01	SPACERR.RR.BUMPER SIDE	1	11.50	25	8.62	0.60	9.22
71598-TEA-T01	SPACERL.RR.BUMPER SIDE	1	11.50	25	8.62	0.60	9.22
91505-TM8-003	CLIP,BUMPER	7	2.30	25	12.07	0.84	12.91
04636-TEA-T00ZZ	PANEL SETR.RR.OUTSIDE	1	812.30	25	609.22	42.65	651.87
04646-TEA-T00ZZ	PANEL SETL.RR.OUTSIDE	1	812.30	25	609.22	42.65	651.87
BO-NUM-COMP-L	NUMBER PLATE WITH CASING-L(N)	1	45.00		45.00	3.15	48.15
Sum Item					3613.73	252.97	3,866.70

BOSUN	SUNDRIES	1	100.00		100.00	7.00	107.00
BML02I	INSPECT RR LIGHTING MECHANISMS. PERFORM WATER	1	280.00		280.00	19.60	299.60
BA02R	REMOVE & RENEW REVERSE SENSORS-4 PCS (N)	1	280.00		280.00	19.60	299.60
BC011R	REMOVE INSTALL & CALIBRATE REAR VIEW CAMERA	1	560.00		560.00	39.20	599.20
BC012R	RESET VEHICLE SMART ENTRY SYSTEM	1	560.00		560.00	39.20	599.20
BKTRR	REMOVE & TRANSFER ITEMS TO NEW TRUNK LID	1	560.00		560.00	39.20	599.20
BOBC	BODY UNDERSIDE COATING (N)	1	380.00		380.00	26.60	406.60
BOJSE	BODY JOINT SEALANT TRUNK LID	1	120.00		120.00	8.40	128.40
BMI03D	REMOVE & INSTALL REAR COMPARTMENT LININGS	1	650.00		650.00	45.50	695.50
BKRP21S	STRAIGHTEN ALIGN RR PANEL RR FENDER	1	5200.00		5200.00	364.00	5564.00
BP05R	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS. (5P)	1	4160.00		4160.00	291.20	4451.20
Sum Labor					12850.00	899.50	13,749.50

Survey By

Date & Time

Excess

Status

Signature

Total Amount 16,463.73 1,152.47 17,616.20

Total (Inclusive of GST) 17,616.20

Printed on 9/10/2021 12:30:58 PM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s).

An amount of \$53.50 (incl GST) will be applicable for the request of the above quotation for estimates above \$2,000.00

However, if the repairs are subsequently done at Kah Motor Co. Sdn. Bhd, it will be refunded.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed

Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



KAH MOTOR CO. SDN. BHD.

Supplementary

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

(A Member of the Oriental Holdings Berhad)

370 Ubi Road 3 Singapore 408651. Tel: +65 6841 3883 Fax: +65 6741 5022

255 Alexandra Road Singapore 159937. Tel: +65 6471 5458 Fax: +65 6471 5460

Customer: CU0035832 / LONPAC
Chassis No: MRHFC5650GT001032
License No: SLL9044J
Mileage: 80645
Engine No: R16B21601331

Document No: SVO21052448
Printed By: IVANTEO
Order Date: 13. October 2021
Order Time: 10:44:15 AM
Service Advisor: IVAN TEO BOON KIAT

ITEM	DESCRIPTION	QTY	UNIT	DISC %	AMOUNT	7% GST Amount	Amount incld GST
	TP DIRECT SETTLEMENT (J/NO:) OWNER: TEH GEK WAH OWNER INSURER: LIBERTY ACC DATE: 08/10/2021 SURVEYED BY: DATE: REF NO: TP INSURER: LONPAC TP VEH: XD7971X SUPPLEMENTARY PART						
84640-TEA-Z01ZA	LINING ASSYRR.PANEL / CRU	1.	50.30	25.	37.72	2.64	40.36

GST Amount is calculated from individual line(s)