



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2206699

INV Date 31/10/2022

Reference CC4/LPC21010467/Apa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. YN 7998E
Insured Veh. YN 9931J
Claim No. 20/21/21/VC00/025026
Policy No. Z/20/VC00/108878
Accident Date 11/10/2021
Inspection Date 12/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21010467/Apa3q2 Date: 31/10/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 9931J	Veh. Inspected	YN 7998E	
Policy No.	Z/20/VC00/108878	Coverage (\$)	0.00	
Claim No.	20/21/21/VC00/025026	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	12/10/2021	
2. Vehicle Particulars & Condition				
Make & Model	MITSUBISHI CANTER	c.c	2998	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	FEB71GA10001	Colour	WHITE	
Odometer	271472 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17.50	BRIDGESTONE	6 mm	
L/H Front Tyre	215/55 R17.50	BRIDGESTONE	6 mm	
R/H Rear Tyre	215/55 R17.50	BRIDGESTONE	6 mm	
L/H Rear Tyre	215/55 R17.50	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	11/10/2021	Inspection Date	12/10/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YN 7998E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
2	TAILAMPS @\$240.00	O/S CRACKED	480.00	240.00
2	TAILAMPS PANEL @\$180.00	NOT NECESSARY	360.00	-
1	CARGO LIFT PLATFORM	TO REPAIR SEE LABOUR	8,000.00	-
1	CARGO LIFT PLATFORM STICKERS	NECESSARY	350.00	180.00
1	CARGO LIFT PLATFORM 60KM/H	NECESSARY	20.00	15.00
1	CARGO LIFT WONG FONG STICKER	NECESSARY	50.00	50.00
1	CARGO LIFT PLATFORM DHOLLANDIA	NECESSARY	60.00	60.00
2	CARGO BED LIFTING CYLINDER BRACKET @\$3000.00	BENT	6,000.00	1,800.00
2	CARGO BED LIFTING CYLINDER @\$5000.00	O/S BENT	10,000.00	2,800.00
2	CARGO BED TILTING CYLINDER @\$5000.00	O/S BENT	10,000.00	2,600.00
2	CARGO BED SAFETY REINFORCEMENT (CTR) @\$650.00	DENTED	1,300.00	650.00
1	CARGO BED REINFORCEMENT (CTR) STICKER	NECESSARY	250.00	50.00
2	SAFETY REINFORCEMENT SIDE @\$650.00	O/S DENTED	1,300.00	650.00
1	SAFETY REINFORCEMENT SIDE NERTA STICKER	NOT NECESSARY	60.00	-
2	SAFETY REINFORCEMENT SIDE REFLECTIVE @\$85.00	O/S NECESSARY	170.00	50.00
1	SAFETY REINFORCEMENT LOWER	DENTED	850.00	850.00
1	SAFETY REINFORCEMENT LOWER REFLECTIVE	NECESSARY	150.00	80.00
1	CARGO BED CHASSIS MEMBER	NOT NECESSARY	3,500.00	-
2	CARGO BED LIFT PLATFORM SAFETY CHAIN @\$120.00	NOT NECESSARY	240.00	-
1	REAR LIFTING PLATFORM COMPANY STICKER	NOT NECESSARY	450.00	-
1	REAR SIDE SLIDING DOOR RH	TO REPAIR SEE LABOUR	3,800.00	-
1	REAR SIDE SLIDING DOOR COMPANY STICKER RH	NECESSARY	450.00	300.00
1	REAR SIDE SLIDING DOOR WOODEN BOARD	NOT NECESSARY	650.00	-
2	REAR SIDE SLIDING DOOR LOCK @\$180.00	NOT NECESSARY	360.00	-
2	REAR SIDE PILLAR SUPPORT FRAME @\$2500.00	O/S BENT	5,000.00	1,000.00
1	REAR NUMBER PLATE	DENTED	50.00	30.00
1	REAR NUMBER PLATE LAMP	CRACKED	85.00	85.00
1	REAR NUMBER PLATE BASE BRACKET	BENT	250.00	150.00

Report Ref No. CC4/LPC21010467/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TAILGATE '60KM/H' STICKER	REPEATED	30.00	-
			54,265.00	11,640.00
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF CARGO LIFT PLATFORM AND REAR SIDE SLIDING DOOR RH .		2,000.00	1,000.00
	SPRAY PAINTING.		2,000.00	800.00
	ANTI RUST.		120.00	60.00
	CHECK WIRING ON TAILAMP .		120.00	30.00
			4,240.00	1,890.00
GRAND TOTAL			58,505.00	13,530.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				10,800.00

Report Ref No. CC4/LPC21010467/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YN 7998E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

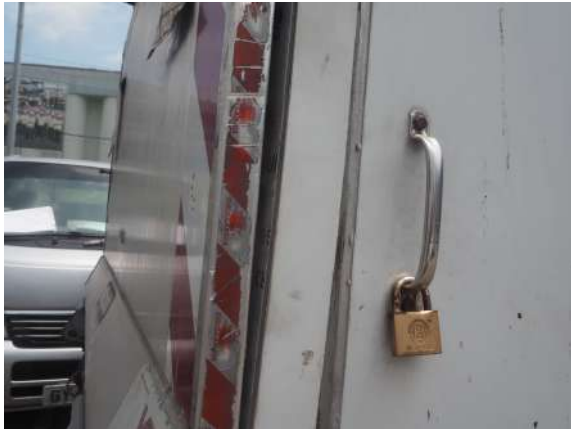



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YN 7998E

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

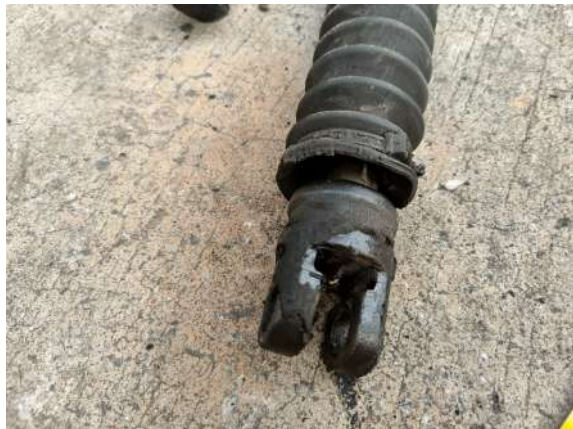



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YN 7998E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YN 7998E

RE-INSPECTION

