



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2201048

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 25/02/2022
Reference CC6/CTI21010595/Aea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMQ 9442E
Insured Veh. SGW 3055T
Claim No. SNM21D205798/C02
Policy No. DMPCSNA00134132101
Accident Date 09/10/2021
Inspection Date 12/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21010595/Aea3q2	
			Date: 25/02/2022	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SGW 3055T	Veh. Inspected	SMQ 9442E	
Policy No.	DMPCNA00134132101	Coverage (\$)	0.00	
Claim No.	SNM21D205798/C02	Excess (\$)	0.00	
Assign From		Assign Date	12/10/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALPHARD	c.c	2362	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	ANH100203599	Colour	BLACK	
Odometer	192792 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/55 R17	KUMHO	6 mm	
L/H Front Tyre	225/55 R17	KUMHO	6 mm	
R/H Rear Tyre	225/55 R17	KUMHO	6 mm	
L/H Rear Tyre	225/55 R17	KUMHO	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	09/10/2021	Inspection Date	12/10/2021	
Survey held at	SIN FATT DIESEL MOTOR BLK 3020A UBI ROAD 1 #01-38 . SINGAPORE 408714			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMQ 9442E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT LID	DENTED	1,692.20	1,692.20
1	REAR BOOT LID INNER LOCK	DAMAGED	525.30	361.00
1	REAR BOOT LID INNER RUBBER	CUT	299.10	299.10
1	REAR BOOT LID NUMBER PLATE	NOT NECESSARY	50.00	-
2	REAR BOOT LID NUMBER PLATE LAMP @\$83.10	NOT NECESSARY	166.20	-
1	REAR BOOT LID TOYOTA LOGO	NECESSARY	80.00	80.00
1	REAR BOOT LID ALPHARD LOGO	NECESSARY	50.00	50.00
1	REAR BOOT LID M LOGO	NECESSARY	30.00	30.00
2	REAR BOOT LID SIDE REFLECTOR @\$295.20	CRACKED	590.40	590.40
1	REAR BOOT LID INNER TRIM BOARD	CRACKED	758.20	619.00
2	REAR TAIL LAMP @\$548.20	O/S CRACKED	1,096.40	548.20
4	REAR TAIL LAMP CLIPS @\$12.90	NOT NECESSARY	51.60	-
1	SET REAR BUMPER REINFORCEMENT	NOT NECESSARY	658.00	-
2	REAR BUMPER SIDE BRACKET @\$125.00	DENTED	250.00	250.00
2	REAR BUMPER SIDE RETAINER @\$115.00	NECESSARY	230.00	230.00
2	REAR BUMPER REVERSE SENSOR -SMALL @\$200.00	NOT NECESSARY	400.00	-
2	REAR BUMPER REVERSE SENSOR -BIG @\$250.00	DAMAGED	500.00	500.00
2	REAR BUMPER REVERSE SENSOR COVER -SMALL	NECESSARY	190.40	40.00
2	REAR BUMPER REVERSE SENSOR COVER-BIG @\$115.20	NECESSARY	230.40	40.00
1	REAR SIDE BUMPER	TO REPAIR SEE LABOUR	725.00	-
1	REAR BUMPER	DISTORTED	1,170.70	1,170.70
2	REAR BUMPER SIDE REFLECTOR @\$98.20	CRACKED	196.40	196.40
1	REAR FLOOR PANEL TOP SEALANT	NOT NECESSARY	300.00	-
1	REAR FLOOR PANEL TOP COVER	NOT NECESSARY	985.00	-
1	REAR END PANEL TOP GARNISH	DEFORMED	325.00	288.00
1	REAR END PANEL	DENTED	628.00	628.00
1	REAR SWIFT	NOT NECESSARY	258.00	-
1	REAR EXHAUST	BENT	1,723.00	855.00
1	REAR EXHAUST CHROME PIPE	NOT NECESSARY	196.10	-

Report Ref No. CC6/CTI21010595/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR EXHAUST -CENTER	BENT	1,852.00	1,218.00
1	REAR END PANEL ANTENNA SENSOR	CRACKED	169.00	169.00
2	TAILLAMP LOWER COVER @\$158.00	DEFORMED	316.00	316.00
	LESS 25% DISCOUNT		-	-2,542.75
			16,692.40	7,628.25
	LABOUR			
	REMOVE AND REFIX REAR & CENTER EXHAUST .		280.00	160.00
	TO REMOVE & REFIX REAR WINDSCREEN.		120.00	120.00
	GUM .		50.00	50.00
	TO CHECK WIRING SYSTEM.		60.00	30.00
	TO REMOVE & REFIX REAR CUSHION.		120.00	60.00
	REMOVE AND REFIX REAR REVERSE SENSOR .		150.00	60.00
	TUFF KOTE.		120.00	60.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR SIDE BUMPER .		1,200.00	1,100.00
	SPRAY PAINTING CHARGES.		1,200.00	1,000.00
	TO REMOVE AND REFIX REAR CAMERA.		100.00	50.00
			3,400.00	2,690.00
GRAND TOTAL			20,092.40	10,318.25
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,200.00

Report Ref No. CC6/CTI21010595/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 9442E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

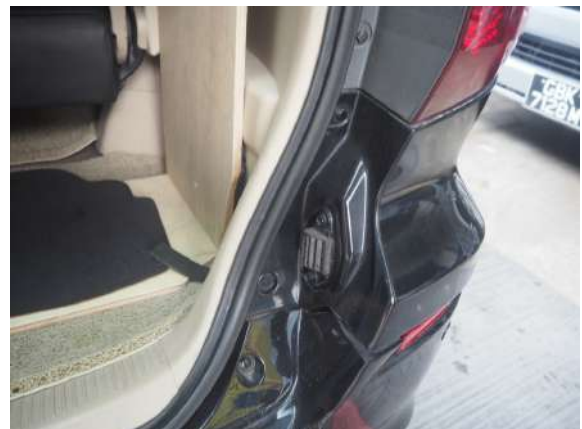



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 9442E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

