

AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
 TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
 GST:M9-0009639-E RCB NO:06470300B

SURVEYOR COPY

M/S : TAN CHENG KIAT
 43 CHUAN GARDEN
 SINGAPORE 558560

Estimate No: MC1902224
 Date: 19 Oct 2021
 Policy No: MT/00642749/02
 Veh Reg No: SKT3686R
 Make/Model: HONDA CITY 1.5 SV
 CVT

ATTN:

Your Ref No: SKT3686R
 Claim Type: Third Party → *wage*
 Accident Date: 17/10/2021
 TP Veh Reg No: YP8371X

Estimate Repair Cost to Vehicle No : SKT3686R

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed

Damage to vehicle must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

*Not Authorized
 11 By B
 Refusing After Paid
 10 days*

Description	Quantity	List Price	Amount
		S\$	S\$
SPARE PARTS			
1 REAR BOOT	1 PC	By 502.90	✓
2 REAR BOOT HINGE LH & RH	2 PC	R 159.60	✓
3 REAR BOOT EMBLEM	1 PC	na 21.90	✓
4 REAR BOOT CITY LOGO	1 PC	na 21.50	✓
5 REAR BOOT IVTEC	1 PC	na 21.90	✓
6 REAR BOOT CHROME MOULDING	1 PC	CM 98.50	✓
7 REAR BOOT NO PLATE LAMP LH & RH	2 PC	Sn 76.80	X
8 REAR BOOT REVERSE CAMERA	1 PC	Sn 625.90	X
9 REAR BOOT OUTER SWITCH - CHECK PRICE	1 PC	Sn 0.00	X
10 REAR BOOT INNER LOCK	1 PC	D/I 105.70	✓
11 REAR BOOT INNER LOCK STRIKER	1 PC	R 25.40	✓
12 REAR BOOT RUBBER	1 PC	D/I 84.20	506.12
13 REAR BOOT INNER TRIM	1 PC	Deform 99.70	✓
14 REAR BOOT INNER TRIM CLIPS	10 PC	na 55.00	✓
15 REAR BOOT STOPPER ROUND	2 PC	Sn 19.40	X
16 REAR BOOT STOPPER RECTANGLE - CHECK PRICE	2 PC	DL 0.00	X
17 REAR BOOT LAMP LH & RH	2 PC	CM 194.40	✓
18 TAILAMP LH & RH	2 PC	CM 450.80	✓
19 TAILAMP PANEL LH & RH	2 PC	R 196.40	✓
20 REAR BUMPER	1 PC	R 463.70	✓
21 REAR BUMPER SIDE RETAINER LH & RH	2 PC	D/I 27.80	✓
22 REAR BUMPER CLIPS	15 PC	na 82.50	✓
23 REAR END PANEL	1 PC	R 380.20	✓
24 REAR END PANEL TOP GARNISH	1 PC	D/I 66.60	✓
25 SPARE TYRE PANEL	1 PC	R 460.80	X
26 SPARE TYRE PANEL TOP TRIMBOARD	1 PC	CM 89.20	✓
27 REAR WINDSCREEN MOULDING (COMPLETE)	1 PC	na 149.20	✓
28 REAR FENDER RH	1 PC	Bu 1,134.20	✓
29 REAR FENDER COWLNG RH	1 PC	Sn 85.20	X
30 REAR FENDER COWLING CLIPS	8 PC	na 28.00	X
31 REAR FENDER AIR VENT RH	1 PC	Sn 35.70	X
32 REAR FENDER INNER TRIM LH & RH	2 PC	136.60	✓
33 SPARE TYRE SCREW	1 PC	CM 15.30	✓
34 REAR CHASSIS RH	1 PC	R 555.40	X
35 REAR EXHAUST PIPE	1 PC	R 320.40	X
36 REAR EXHAUST PIPE MOUNTING	3 PC	Sn 46.20	X

Ah Lim Motor Company

cl's Return

AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

SURVEYOR COPY

M/S : TAN CHENG KIAT
43 CHUAN GARDEN

SINGAPORE 558560

ATTN:

Your Ref No: SKT3686R
Claim Type: Third Party
Accident Date: 17/10/2021
TP Veh Reg No: YP8371X

Estimate No: MC1902224
Date: 19 Oct 2021
Policy No: MT/00642749/02
Veh Reg No: SKT3686R
Make/Model: HONDA CITY 1.5 SV
CVT

Estimate Repair Cost to Vehicle No :SKT3686R

Description	Quantity	List Price	Amount
		<u>S\$</u>	<u>S\$</u>
		6,837.00	
	Less 20%	1,367.40	5,469.60
Special Nett			
37 REVERSE SENSOR	1 SET	400.00	200.00
38 NUMBER PLATE	1 PC	35.00	—
39 INNER SEAL	1 PC	20.00	—
40 WINDSCREEN SEALANT	1 PC	40.00	—
		495.00	495.00
LABOUR			
41 TO DISCONNECT AND CHECK ELECTRICAL WIRING, WIRE SOCKETS AND ETC. TO REMOVE AND REINSTALL DAMAGED ELECTRICAL UNITS, TEST AND RECTIFY FOR PROPER FUNCTIONING.	1 PC	40.00	20.00
42 TO CHECK AND RE-ADJUST WHEEL ALIGNMENT.	1 PC	80.00	X
43 TO REMOVE AND REINSTALL/REPLACE FRONT/REAR WINDSCREEN.	1 PC	120.00	✓
44 TO REMOVE AND REINSTALL CUSHIONS, SEATS, BACKREST, INNER TRIM, GARNISH, ROOF LINING OR UPHOLSTERY TO FACILITATE REPAIRS.	1 PC	120.00	100.00
45 TO DISMANTLE, REPLACE AND REINSTALL UNDERCARRIAGE.	1 PC	280.00	X
46 TO REMOVE AND REINSTALL/REPLACE FRONT/REAR BUMPER SENSORS.	1 PC	80.00	50.00
47 TO SPRAY ANTI-RUST COATING ON AFFECTED AREAS.	1 PC	90.00	✓
48 TO REALIGN, DISMANTLE AND REINSTALL/REPLACE EXHAUST PIPE.	1 PC	80.00	60.00
49 TO DISMANTLE ALL DAMAGED PARTS TO CUT & WELD END PANEL, SPARE TYRE PANEL, REAR FENDER RH, REAR CHASSIS RH, TAILAMP PANEL LH & RH. TO KNOCK & REPAIR REAR FENDER LH, REAR CHASSIS LH INNER PANELS AND AFFECTED AREAS. TO REFIT LISTED PARTS BACK SAME.	1 PC	1,600.00	1400.00
50 TO SPRAY REAR BOOT, REAR BUMPER, END PANEL, SPARE TYRE PANEL, REAR FENDER LH & RH, REAR CHASSIS LH & RH	1 PC	1,400.00	1200.00
		3,890.00	3,890.00

Ah Lim Motor Company

AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

SURVEYOR COPY

M/S : TAN CHENG KIAT
43 CHUAN GARDEN

SINGAPORE 558560

ATTN:

Your Ref No: SKT3686R
Claim Type: Third Party
Accident Date: 17/10/2021
TP Veh Reg No: YP8371X

Estimate No: MC1902224
Date: 19 Oct 2021
Policy No: MT/00642749/02
Veh Reg No: SKT3686R
Make/Model: HONDA CITY 1.5 SV
CVT

Estimate Repair Cost to Vehicle No :SKT3686R

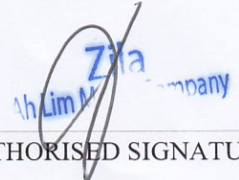
Description	Quantity	List Price	Amount
		<u>S\$</u>	<u>S\$</u>
		Total	S\$ 9,854.60
		Add GST @ 7%	689.82
		Total Amount Payable	S\$ 10,544.42

TOTAL: SINGAPORE DOLLAR TEN THOUSAND FIVE HUNDRED FORTY FOUR AND CENTS FORTY TWO ONLY

Please arrange this vehicle to be surveyed soonest possible.

Thank You

For AH LIM MOTOR COMPANY


AUTHORISED SIGNATURE