



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2200348

INV Date 17/01/2022

Reference CC4/LPC21010828/Uea3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKZ 9091K
Insured Veh. YP 6484S
Claim No. 21/21/21/VC05/025065
Policy No. Z21VC05007421
Accident Date 20/10/2021
Inspection Date 21/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21010828/Uea3q2 Date: 17/01/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YP 6484S	Veh. Inspected	SKZ 9091K	
Policy No.	Z21VC05007421	Coverage (\$)	0.00	
Claim No.	21/21/21/VC05/025065	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	21/10/2021	
2. Vehicle Particulars & Condition				
Make & Model	SUZUKI SWIFT (A)	c.c	1372	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	JSAFZC82S00326860	Colour	RED	
Odometer	97285 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/55 R16	YOKOHAMA	7 mm	
L/H Front Tyre	185/55 R16	YOKOHAMA	7 mm	
R/H Rear Tyre	185/55 R16	BRIDGESTONE	7 mm	
L/H Rear Tyre	185/55 R16	BRIDGESTONE	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	20/10/2021	Inspection Date	21/10/2021	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKZ 9091K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN	NOT NECESSARY	850.00	-
1	REAR WINDSCREEN MOULDING	NECESSARY	125.00	90.00
1	TAILGATE	BADLY DENTED	945.15	855.15
1	TAILGATE REAR LOGO	NECESSARY	66.00	58.00
1	TAILGATE 'SWIFT' EMBLEM	NECESSARY	62.00	35.00
1	TAILGATE 'SUZUKI' EMBLEM	NECESSARY	58.00	35.00
1	TAILGATE INNER TRIM	DEFORMED / CRACKED	450.15	282.15
1	SET TAILGATE INNER TRIM CLIPS	NECESSARY	48.00	35.00
1	TAILGATE INNER HANDLE GARNISH	TWISTED	288.15	168.50
1	TAILGATE INNER LOCK	BENT / TWISTED	165.00	165.00
1	TAILGATE WEATHERSTRIP	TWISTED	180.00	180.00
1	TAILGATE REAR WIPER MOTOR	SHORTED / JAMMED	660.15	485.00
2	TAILGATE DAMPERS @\$105.00	NOT NECESSARY	210.00	-
1	REAR BUMPER	DISTORTED	750.15	600.15
2	REAR BUMPER SIDE RETAINERS @\$45.90	O/S CRACKED	91.80	32.50
1	SET REAR BUMPER CLIPS	NECESSARY	48.00	48.00
1	REAR BUMPER SPLASH SHIELD O/S	DISTORTED	242.15	188.15
1	SET REAR BUMPER SPLASH SHIELD CLIPS O/S	NECESSARY	30.00	30.00
1	REAR END PANEL	BADLY DENTED	599.15	450.15
1	REAR END PANEL TOP GARNISH	TWISTED	242.00	148.20
1	REAR END PANEL AIR VENT	DISTORTED	85.00	68.00
2	TAILLAMPS @\$488.15	N/S CRACKED / O/S BROKEN	976.30	738.30
1	REAR FENDER O/S	BENT / CRACKED	971.15	699.15
1	REAR FENDER INNER TRIM O/S	DISTORTED	366.00	244.10
1	SET REAR FENDER INNER TRIM CLIPS O/S	NECESSARY	38.00	38.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	940.15	-
1	REAR FLOOR PANEL TOP BOARD	WARPED	588.20	388.10
1	REAR FLOOR PANEL TOP CARPET BOARD	TORN	515.35	309.15

Report Ref No. CC4/LPC21010828/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR EXHAUST	TO REPAIR SEE LABOUR	622.00	-
2	REAR EXHAUST MOUNTING @\$30.00	NOT NECESSARY	60.00	-
	LESS 15% DISCOUNT		-	-955.61
			11,273.00	5,415.14
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	50.00	40.00
1	REAR LICENCE PLATE (SN)	SCRATCHED	50.00	40.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NECESSARY	200.00	120.00
1	REAR FENDER GLASS SEALANT O/S (SN)	NOT NECESSARY	50.00	-
			730.00	490.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		50.00	30.00
	TO DISMANTLE & REPLACED REAR REVERSE SENSOR .		80.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.		150.00	120.00
	TO DISMANTLE & REFIX TAILGATE MECHANISM .		100.00	60.00
	TO DISMANTLE & REFIX REAR CUSHION UPHOLSTERY .		120.00	80.00
	TO DISMANTLE & REFIX REAR EXHAUST .		100.00	60.00
	TO DISMANTLE & REFIX REAR FENDER GLASS O/S .	NOT NECESSARY	100.00	-
	TO DISMANTLE & REFIX FUEL TANK.	NOT NECESSARY	100.00	-
	TO SPRAY RUST PROOFING.		180.00	100.00
	TO MOUNT VEHICLE ON CAR O-LINER.	NOT NECESSARY	380.00	-
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL AND REAR EXHAUST .		2,500.00	1,400.00
	TO PUTTY & SPRAY PAINTING.		2,000.00	1,200.00
			5,860.00	3,100.00
	GRAND TOTAL		17,863.00	9,005.14

Report Ref No. CC4/LPC21010828/Uea3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,200.00
---	--	--	----------

Report Ref No. CC4/LPC21010828/Uea3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 9091K

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

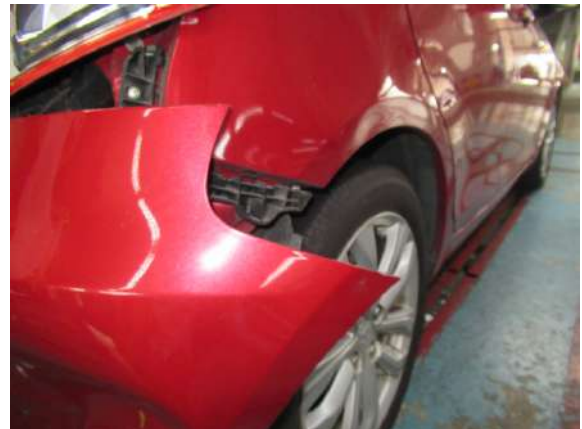



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

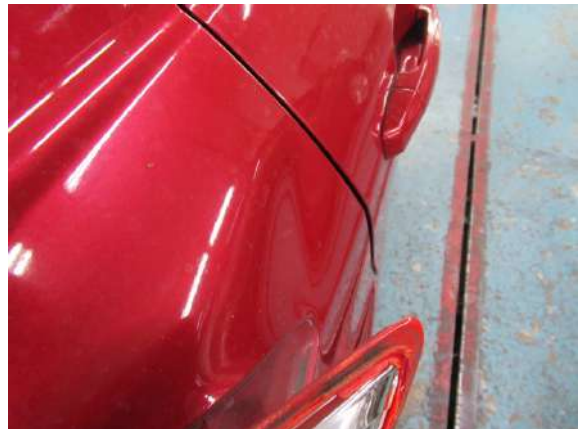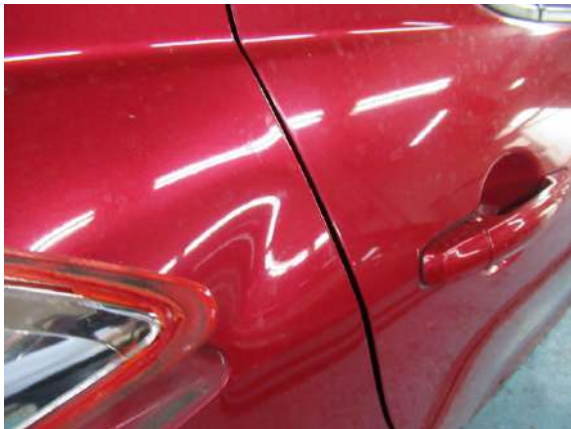





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

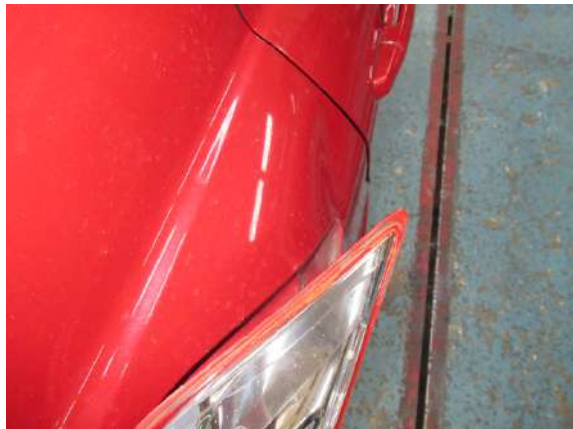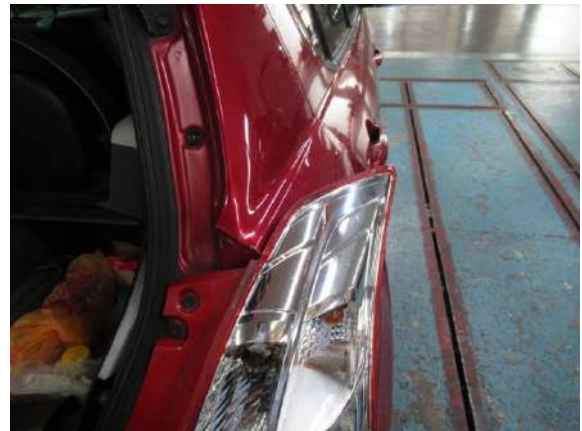



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

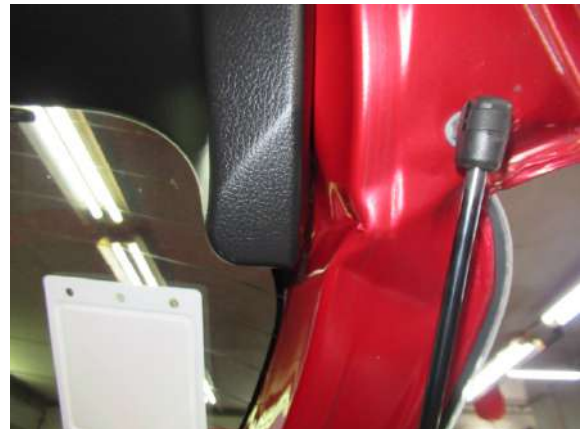



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

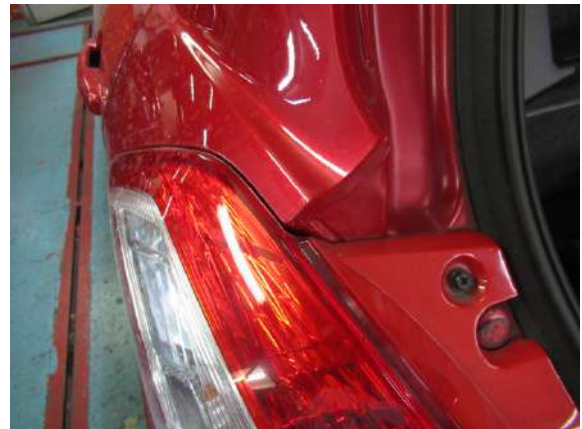



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 9091K

RE-INSPECTION

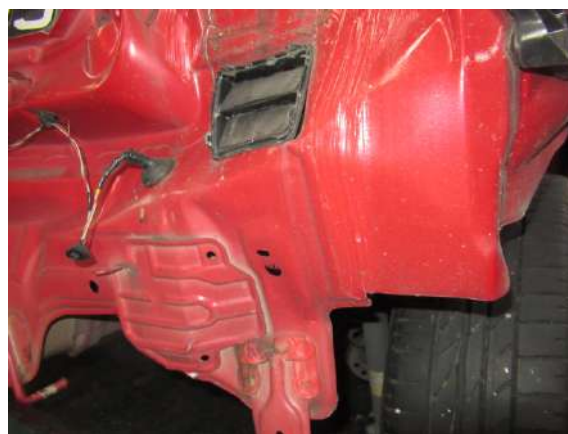



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

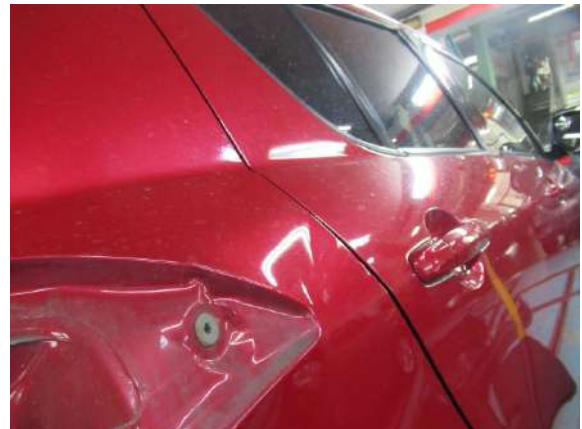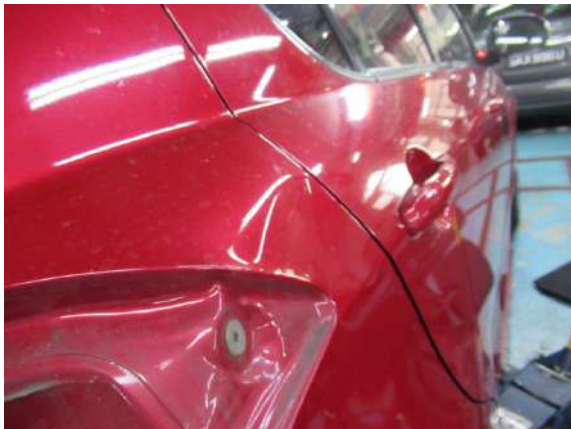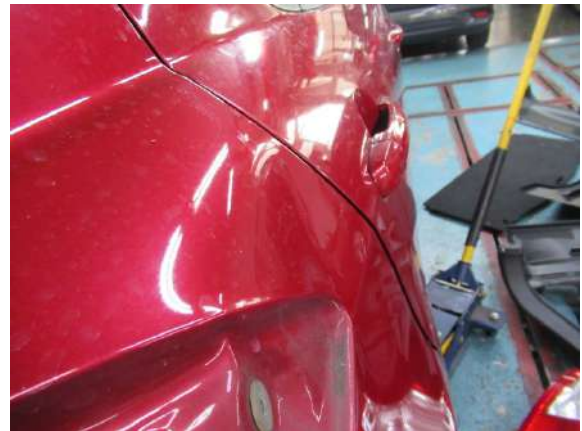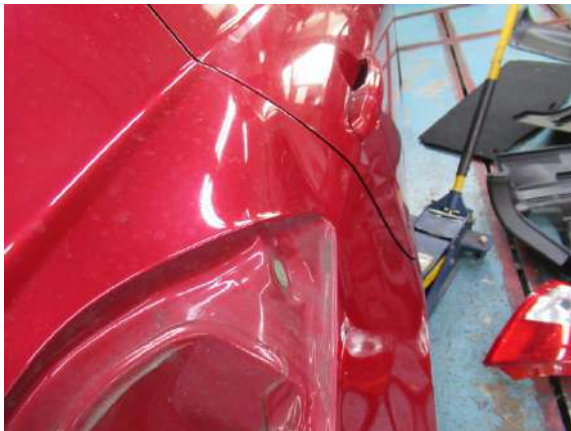



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 9091K

RE-INSPECTION

