



## INVOICE

TO : AUTOGRAND PTE LTD  
C/O: ALPHA PERFORMANCE SINGAPORE PTE. LTD.  
48 TOH GUAN ROAD EAST,  
#04-126 ENTERPRISE HUB,  
SINGAPORE 608586

Invoice No.: 0621/AP990  
Date: 15-Jul-2021

### PARTICULARS

Vehicle Registration No.: SJR 4474 B  
Date of Loss: 24-Jun-2021  
Date of Assessment: 29-Jun-2021

### SERVICES

### FEES

1. Assessment with report Photographs -  
Including films, developing, storage and Transport.

\$400.00

**TOTAL** \$400.00

**SINGAPORE DOLLARS FOUR HUNDRED ONLY**

We would appreciate your cheque crossed and made payable to:  
"AEON AUTO CONSULTANTS LLP" with our invoice no. written on the back of the cheque.

**AEON AUTO CONSULTANTS LLP**



**AEON AUTO CONSULTANTS LLP**

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874  
Tel: +65 97687958 Fax +65 68264112 Email [amas@aeonac.com.sg](mailto:amas@aeonac.com.sg)/[amasopm@gmail.com](mailto:amasopm@gmail.com)  
Reg. No. T07LL1273E (registered with limited liability)

## AUTOMOBILE ASSESSMENT REPORT

TO: AUTOGRAND PTE LTD  
C/O: ALPHA PERFORMANCE SINGAPORE PTE. LTD.  
48 TOH GUAN ROAD EAST,  
#04-126 ENTERPRISE HUB,  
SINGAPORE 608586

Our Reference: 0621/AP990  
Date: 15-Jul-2021

### ASSESSMENT OF VEHICLE NO. SJR 4474 B

DATE OF LOSS: 24-Jun-2021

We have carried out a physical assessment at ALPHA PERFORMANCE SINGAPORE PTE. LTD. ,  
48 Toh Guan Road East, #04-126 Enterprise Hub, Singapore 608586, according to your instruction  
on 29-Jun-2021 and are pleased to submit our report herewith.

### 1. VEHICLE PARTICULARS

Registration No.: SJR 4474 B  
Make & Model: MITSUBISHI LANCER 1.5 MIVEC GLX AT ABS D/AB 2WD 4DR  
Year of Registration: 2009  
Engine Capacity: 1499  
Chassis No.: JMYSRCY2A9U004318  
Engine No.: A4910126309  
Colour: SILVER  
Mileage (km): 158195

### 2. VEHICLE CONDITION

Exterior Paint: GOOD  
Steering: SERVICEABLE  
Foot Brake: SERVICEABLE  
Parking Brake: SERVICEABLE  
Modification: NIL

### 3. TYRE PARTICULARS & CONDITION

Front  
RH Make/Size/Thread: FIRENZA 205/60R16 – 70%  
LH Make/Size/Thread: FIRENZA 205/60R16 – 70%

Rear  
RH Make/Size/Thread: YOKOHAMA 205/60R16 – 70%  
LH Make/Size/Thread: YOKOHAMA 205/60R16 – 70%


#### 4. DESCRIPTION OF DAMAGE

At the time of the inspection, the vehicle sustained damages to the REAR portion.

#### 5. REMARKS

Market Value: Na  
Salvage Value: Na  
Repair Limit: Na

Estimated Amount: \$5,708.50  
Adjusted Amount: \$3,543.00  
Loss Sum: \$3,000.00  
Estimated Repair Days: 5 days

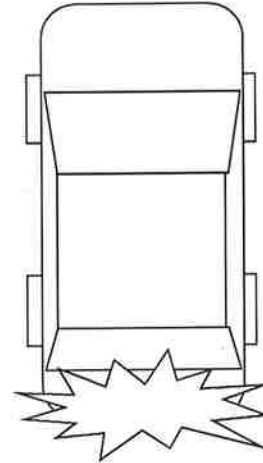

Pursuant to your instruction, we have **NOT AUTHORISED** repair.

The assessment was conducted on a **"Without Prejudice"** basis.

If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

#### Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by Aeon Auto Consultants LLP for any reliance on this report by any third party.

**ASSESSMENT REPORT FOR VEHICLE NO. SJR 4474 B**

**PARTS (LIST ITEMS)**

| Qty               | Description                            | Condition | Workshop's Estimate | Our Assessment  |
|-------------------|----------------------------------------|-----------|---------------------|-----------------|
| 1                 | REAR BOOTLID                           | Repair    | 557.00              | -               |
| 1                 | REAR BOOTLID LOCK STRIKER              | Bent      | 28.00               | 28.00           |
| 1                 | REAR BOOTLID MECHANISM LOCK            | Bent      | 58.00               | 58.00           |
| 2                 | REAR TAILLAMP L/R                      | Repair    | 508.00              | -               |
| 2                 | REAR FENDER INNER SHIELD L/R           | Reuse     | 64.00               | -               |
| 1                 | REAR BUMPER                            | Cracked   | 731.00              | 731.00          |
| 1                 | REAR BUMPER CENTER BEAM                | Bent      | 68.00               | 68.00           |
| 2                 | REAR BUMPER REFLECTOR L/R              | Necessary | 40.00               | 40.00           |
| 1                 | REAR BUMPER REINFORCEMENT              | Bent      | 169.00              | 169.00          |
| 1                 | REAR BUMPER SIDE RETAINER L/R          | Bent      | 40.00               | 40.00           |
| 1                 | REAR BUMPER TOW COVER                  | Necessary | 20.00               | 20.00           |
| 1                 | REAR END PANEL INNER TOP GARNISH       | Cracked   | 140.00              | 140.00          |
| 4                 | REAR END PANEL INNER TOP GARNISH CLIPS | Necessary | 26.00               | 26.00           |
| 1                 | REAR END PANEL                         | Repair    | 407.00              | -               |
| 1                 | REAR EXHAUST SILENCER BOX              | Repair    | 359.00              | -               |
|                   |                                        |           | <u>3,215.00</u>     | <u>1,320.00</u> |
| Less 10% discount |                                        |           | <u>321.50</u>       | <u>132.00</u>   |
| Parts Total:      |                                        |           | <u>2,893.50</u>     | <u>1,188.00</u> |

### ASSESSMENT REPORT FOR VEHICLE NO. SJR 4474 B

#### SPECIAL NETT ITEMS

|                      |                                          |           |        |        |
|----------------------|------------------------------------------|-----------|--------|--------|
| 2                    | REAR FENDER INNER SHIELD CLIPS L/R - SET | Necessary | 60.00  | 60.00  |
| 1                    | REAR BUMPER CLIPS - SET                  | Necessary | 30.00  | 30.00  |
| 1                    | REAR BUMPER REVERSE SENSOR - SET         | Cracked   | 350.00 | 350.00 |
| 1                    | REAR BUMPER NUMBER PLATE                 | Bent      | 25.00  | 25.00  |
| 1                    | REAR BUMPER NUMBER PLATE HOLDER          | Cracked   | 50.00  | 50.00  |
| Special Nett Total : |                                          |           | 515.00 | 515.00 |

#### LABOUR

| S/N                                  | Description                                                                                                                                                                     | Workshop's Estimate | Our Assessment  |
|--------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|-----------------|
| 1                                    | To remove, reinstall electrical wiring harness, check lighting and rewire for parking sensor.                                                                                   | 120.00              | 100.00          |
| 2                                    | To remove, reinstall top trim upholstery, cushion seat, trim garnish, trim liner carpet.                                                                                        | 80.00               | 60.00           |
| 3                                    | To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.                                                                             | 1,000.00            | 800.00          |
| 4                                    | To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident. | 1,000.00            | 800.00          |
| 5                                    | To apply anti-rust chemical on repaired and replaced panel.                                                                                                                     | 100.00              | 80.00           |
| Labour Total :                       |                                                                                                                                                                                 | 2,300.00            | 1,840.00        |
| <b>TOTAL (PARTS &amp; LABOUR) \$</b> |                                                                                                                                                                                 | <b>5,708.50</b>     | <b>3,543.00</b> |

The workshop has agreed to undertake the repair on a Lump Sum basis.

The final adjusted Lump Sum contract amount is  
**\$3,000.00 (SINGAPORE DOLLARS THREE THOUSAND ONLY)**



Amas Ong  
Automobile Assessor

## ALPHA PERFORMANCE SINGAPORE PTE. LTD.

CO.REF: 202035804E  
NO 48 TOH GUAN ROAD EAST  
#04-130 ENTERPRISE HUB  
SINGAPORE 608586  
DIRECT LINE: 96472568  
TEL: 64683096  
FAX: 65155434

Attn: Motor Claims Department  
First Capital Insurance Ltd  
#10-01 / 02 Robinson Tower  
Singapore 048546

Final Bill: APS-14-4474  
Date: 03/09/2021  
Vehicle No: SJR4474B  
Make & Model: Mitsubishi Lancer 1.5  
Accident Date: 24/06/2021  
Third Party Vehicle: SHC4559T

| S/N | DESCRIPTION           | AMOUNT     |
|-----|-----------------------|------------|
| 1   | REPAIR COST (LUMPSUM) | \$3,000.00 |

GRAND TOTAL \$3,000.00

Kindly make payment to : ALPHA PERFORMANCE SINGAPORE PTE. LTD.



\_\_\_\_\_  
ALPHA PERFORMANCE SINGAPORE PTE. LTD.