



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2108965
3 ANSON ROAD #16-00	INV Date	30/12/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21011033/Aea3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMG 2541B
Insured Veh.	SMW 4676Z
Claim No.	SNM21D206174/C02
Policy No.	DMPCSNW00191392000
Accident Date	23/10/2021
Inspection Date	26/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21011033/Aea3q2 Date: 30/12/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SMW 4676Z	Veh. Inspected	SMG 2541B
Policy No.	DMPCSNW00191392000	Coverage (\$)	0.00
Claim No.	SNM21D206174/C02	Excess (\$)	0.00
Assign From		Assign Date	26/10/2021
2. Vehicle Particulars & Condition			
Make & Model	HONDA VEZEL	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	RU11304631	Colour	BLUE
Odometer	33904 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	DUNLOP	6 mm
L/H Front Tyre	215/60 R16	DUNLOP	6 mm
R/H Rear Tyre	215/60 R16	DUNLOP	6 mm
L/H Rear Tyre	215/60 R16	DUNLOP	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	23/10/2021	Inspection Date	26/10/2021
Survey held at	MIRAGE MOTORWERKZ PTE LTD 10 KAKI BUKIT ROAD 2 #01-29 FIRST EAST CENTRE SINGAPORE 417868		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMG 2541B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	588.20	588.20
2	REAR BUMPER SIDE HOLDER @\$32.00	NOT NECESSARY	64.00	-
2	REAR BUMPER REFLECTOR @\$141.10	NOT NECESSARY	282.20	-
2	REAR BUMPER SIDE COVER @\$195.00	NOT NECESSARY	390.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	517.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	175.90	-
1	TAILGATE	DENTED	1,100.00	1,100.00
1	TAILGATE LOCK	DAMAGED	184.60	184.60
1	TAILGATE WEATHERSTRIPE	NOT NECESSARY	182.40	-
1	TAILGATE INNER TRIM BOARD	NOT NECESSARY	285.20	-
1	TAILGATE GLASS MOULDING	NECESSARY	111.20	111.20
1	VEZEL WORDING	NECESSARY	56.20	56.20
	LESS 20% DISCOUNT		-	-408.04
			3,936.90	1,632.16
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	REAR BUMPER SIDE COVER CLIPS (SN)	NOT NECESSARY	30.00	-
1	REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
1	REAR END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	20.00	-
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	60.00	-
1	TAILGATE INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	30.00	-
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR NUMBER PLATE (SN)	NECESSARY	30.00	30.00
1	REAR NUMBER PLATE HOLDER (SN)	NECESSARY	30.00	30.00
			570.00	350.00
<u>LABOUR</u>				
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL .		1,000.00	400.00
	SPRAY PAINTING.		1,000.00	400.00
	WIRING.		50.00	30.00

Report Ref No. CC6/CTI21011033/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE REVERSE SENSOR .	NOT NECESSARY	100.00	50.00
	TO REMOVE REAR CAMERA.		100.00	50.00
	TO REMOVE UPHOLSTERY .		150.00	-
	TO SPRAY TUFF COAT.		150.00	30.00
	TO REMOVE TAILGATE GLASS .		180.00	120.00
	TO TRANSFER TAILGATE FITTINGS.		150.00	80.00
	TO RESET VEHICLE AT LTA AUTHORISED CENTRE TO RESET WEEKEND CAR PLATE .		100.00	80.00
			2,980.00	1,240.00
	GRAND TOTAL		7,486.90	3,222.16
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,550.00

Report Ref No. CC6/CTI21011033/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 2541B

INSPECTION

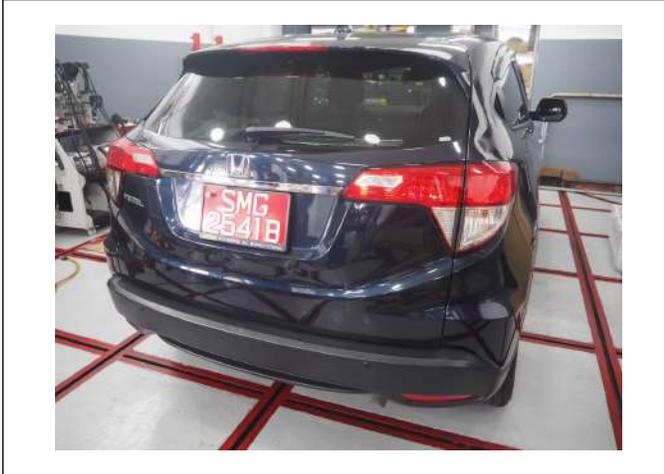




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

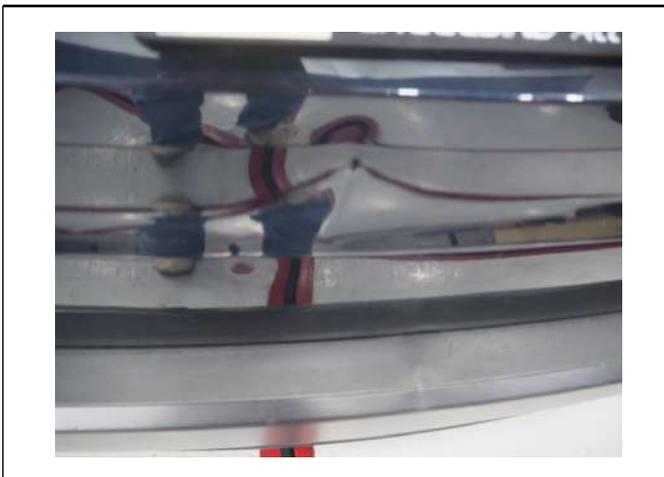



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 2541B

RE-INSPECTION

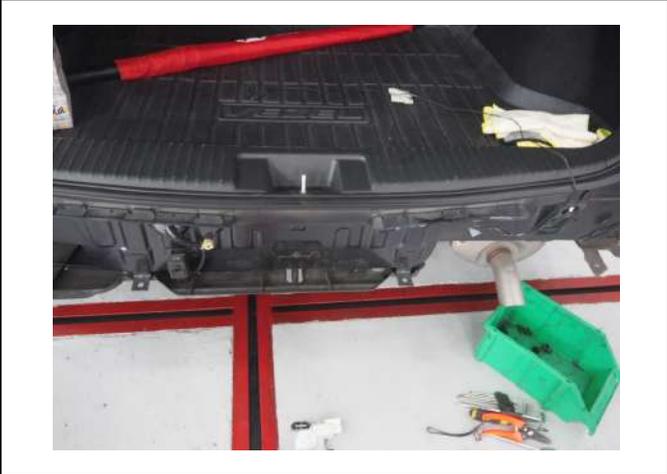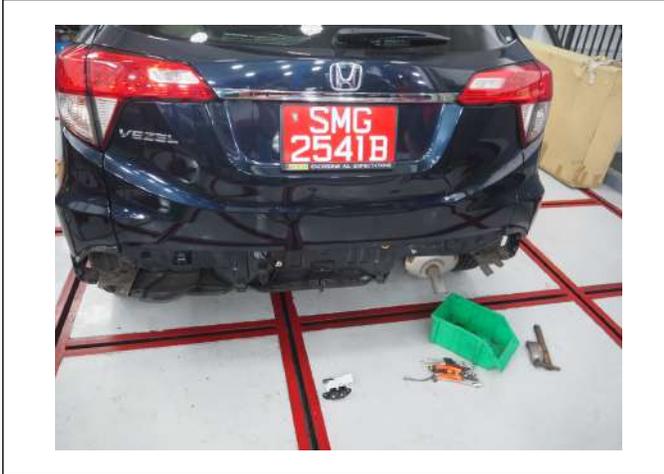



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

