



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2204423

300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV Date 20/07/2022  
Reference CC4/LPC21011061/Aea3q2  
Code LPC2

### PROFESSIONAL SERVICE FEE

Vehicle No. SMK 3629E  
Insured Veh. SMX 9185K  
Claim No. 21/21/21/VP05/025089  
Policy No. Z21VP05028601  
Accident Date 27/10/2021  
Inspection Date 28/10/2021

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (7%)</b>                | <b>28.00</b>  |
| <b>Grand Total</b>             | <b>428.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                      |                                                                                         |                 |                                                               |  |
|----------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------|-----------------|---------------------------------------------------------------|--|
| LONPAC INSURANCE BHD<br>300 BEACH ROAD<br>#17-04/07 THE CONCOURSESINGAPORE 199555                                                      |                                                                                         |                 | Ref: CC4/LPC21011061/Aea3q2<br>Date: 20/07/2022<br>Code: LPC2 |  |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                      |                                                                                         |                 |                                                               |  |
| Insured Veh.                                                                                                                           | SMX 9185K                                                                               | Veh. Inspected  | SMK 3629E                                                     |  |
| Policy No.                                                                                                                             | Z21VP05028601                                                                           | Coverage (\$)   | 0.00                                                          |  |
| Claim No.                                                                                                                              | 21/21/21/VP05/025089                                                                    | Excess (\$)     | 0.00                                                          |  |
| Assign From                                                                                                                            | GERALD                                                                                  | Assign Date     | 28/10/2021                                                    |  |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                          |                                                                                         |                 |                                                               |  |
| Make & Model                                                                                                                           | HYUNDAI AVANTE                                                                          | c.c             | 1591                                                          |  |
| Engine No.                                                                                                                             | HIDDEN                                                                                  | Year of Reg.    | 2019                                                          |  |
| Chassis No.                                                                                                                            | KMHD841CMKU890125                                                                       | Colour          | GREY                                                          |  |
| Odometer                                                                                                                               | 41859 KM                                                                                | Steering        | IN ORDER                                                      |  |
| Brakes                                                                                                                                 | IN ORDER                                                                                | Modification    | SPORTS RIM                                                    |  |
| General                                                                                                                                | GOOD                                                                                    |                 |                                                               |  |
| <b>3. Conditions of Tyres</b>                                                                                                          |                                                                                         |                 |                                                               |  |
|                                                                                                                                        | Size                                                                                    | Make            | Balance                                                       |  |
| R/H Front Tyre                                                                                                                         | 205/55 R16                                                                              | KUMHO           | 6 mm                                                          |  |
| L/H Front Tyre                                                                                                                         | 205/55 R16                                                                              | KUMHO           | 6 mm                                                          |  |
| R/H Rear Tyre                                                                                                                          | 205/55 R16                                                                              | KUMHO           | 6 mm                                                          |  |
| L/H Rear Tyre                                                                                                                          | 205/55 R16                                                                              | KUMHO           | 6 mm                                                          |  |
| <b>4. Description of Damages</b>                                                                                                       |                                                                                         |                 |                                                               |  |
| THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION.<br>DAMAGES SEE DETAILS.                                                        |                                                                                         |                 |                                                               |  |
| <b>5. General Information</b>                                                                                                          |                                                                                         |                 |                                                               |  |
| Accident Date                                                                                                                          | 27/10/2021                                                                              | Inspection Date | 28/10/2021                                                    |  |
| Survey held at                                                                                                                         | XIN HUA WORKSHOP PTE LTD<br>23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933 |                 |                                                               |  |
| <b>5a. Remarks</b>                                                                                                                     |                                                                                         |                 |                                                               |  |
| A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                         |                 |                                                               |  |
| <b>5b. Estimate Days of Repair</b>                                                                                                     |                                                                                         |                 |                                                               |  |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                         |                 | <b>3 Working Days</b>                                         |  |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMK 3629E

| Qty                                | Description of Parts                                                     | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|------------------------------------|--------------------------------------------------------------------------|---------------|---------------------------|-------------------|
|                                    | <b><u>REPLACEMENT OF PARTS</u></b>                                       |               |                           |                   |
| 1                                  | FRONT BUMPER                                                             | DEFORMED      | 474.40                    | 474.40            |
| 1                                  | FRONT BUMPER SIDE COVER                                                  | CRACKED       | 98.60                     | 98.60             |
| 1                                  | FRONT BUMPER SIGNAL LAMP RH                                              | NOT NECESSARY | 165.80                    | -                 |
| 1                                  | FRONT BUMPER RETAINER RH                                                 | NOT NECESSARY | 86.90                     | -                 |
| 1                                  | FRONT BUMPER AIR GUIDE RH                                                | CRACKED       | 125.80                    | 125.80            |
| 1                                  | FRONT BUMPER SPONGE                                                      | NOT NECESSARY | 225.60                    | -                 |
| 1                                  | FRONT HEADLAMP RH                                                        | CUT           | 1,756.40                  | 1,756.40          |
| 1                                  | FRONT HEADLAMP BRACKET RH                                                | CRACKED       | 98.60                     | 98.60             |
|                                    | LESS 20% DISCOUNT                                                        |               | -606.42                   | -510.76           |
|                                    |                                                                          |               | 2,425.68                  | 2,043.04          |
|                                    | <b><u>SPECIAL NETT ITEMS</u></b>                                         |               |                           |                   |
| 1                                  | SET FRONT BUMPER CLIPS (SN)                                              | NECESSARY     | 30.00                     | 30.00             |
| 1                                  | SET FRONT HEADLAMP CLIPS (SN)                                            | NOT NECESSARY | 30.00                     | -                 |
|                                    |                                                                          |               | 60.00                     | 30.00             |
|                                    | <b><u>LABOUR</u></b>                                                     |               |                           |                   |
|                                    | TO RENEW DAMAGED PARTS ,REPLACE ,BEAT ,WELD ,REALIGN ,STRAIGHTEN MEMBER. |               | 600.00                    | 200.00            |
|                                    | TO RESPRAY AFFECTED AREAS.                                               |               | 600.00                    | 200.00            |
|                                    | TO TUFFCOAT AFFECTED AREA.                                               | NOT NECESSARY | 150.00                    | -                 |
|                                    | TO REMOVE /REFIT WIRING CHECKS FOR HEADLAMP.                             |               | 150.00                    | 30.00             |
|                                    |                                                                          |               | 1,500.00                  | 430.00            |
| <b>GRAND TOTAL</b>                 |                                                                          |               | <b>3,985.68</b>           | <b>2,503.04</b>   |
| <b>RECOMMENDED COST OF REPAIRS</b> |                                                                          |               |                           | <b>2,503.04</b>   |

Report Ref No. CC4/LPC21011061/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SMK 3629E

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 3629E

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SMK 3629E**

**RE-INSPECTION**





## LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SMK 3629E**

**RE-INSPECTION**

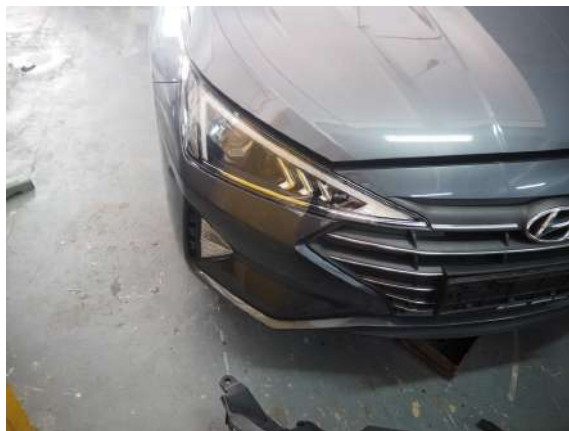



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

