

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference:

21-8145

Date:

22/9/2021

c/o Everdawn Auto Service 8, Kaki Bukit Ave 4 Premier@Kaki Bukit #01-02 Singapore 415875

Dear Sirs

RE:

Road Traffic Accident on 15/9/2021 Mohamad Hafis Bin Mohamed Alifi

In accordance with your instructions received in this office on

16/9/2021

, we made arrangements to

examine the vehicle on

16/9/2021

at above-mentioned address. The following data was

recorded:

#### Vehicle details

| Make      | Toyota   | Registration | SJY5154G     |
|-----------|----------|--------------|--------------|
| Model     | ALPHARD  | Chassis      | AGH300263866 |
| Colour    | Black    | Gearbox      | Auto         |
| Odometer  | 13600km  | Paintwork    | Good         |
| Steering  | In order | Brakes       | In order     |
| Condition | Good     |              |              |

### **Tyre Depths**

| Front left  | 255/40ZR19 | 85% ADRENO |
|-------------|------------|------------|
| Front right | 255/40ZR19 | 85% ADRENO |
| Rear left   | 255/40ZR19 | 85% ADRENO |
| Rear right  | 255/40ZR19 | 85% ADRENO |

| Status       | REPAIRABLE   |
|--------------|--------------|
| Magnitude    | Medium       |
| Legal status | Unroadworthy |

### Impact Direction & Area of Damage:



Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$7,300.00 and for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd
   Infoknights International Services (Philippines)
   IABN Pte Ltd www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference

21-8145

Date

22/9/2021

Page

2

# Section A: Damaged Parts Assessment

| Buell Burningian                            | 0.        | Condition As    | Repairer's                              | Our        |
|---|-----------|-----------------|---|------------|
| Part's Description                          | Qty       | inspected       | Estimate                                | Adjustment |
| List Items:                                 |           |                 |   |            |
| Tail gate                                   | 1         | crushed         | 2458.00                                 | 2458.00    |
| Tail gate logo                              | 1         | necessary       | 62.10                                   | 62.10      |
| Tail gate lock                              | 1         | bent-in         | 585.10                                  | 585.10     |
| Tail gate damper actuator c/w ECU * see pho |           | damaged         | 630.00                                  | 630.00     |
| Tail gate weatherstrip                      | 1         | ripped.nec      | 319.50                                  | 319.50     |
| Tail gate emblem Alphard                    | 1         | necessary       | 86.90                                   | 86.90      |
| Tail gate outer chrome garnish              | 1         | bent            | 845.00                                  | 845.00     |
| Tail gate inner trim board                  | 1         | deformed        | 735.00                                  | 735.00     |
| Tail gate side stopper rh                   | 2         | damaged         | 55.00                                   | 55.00      |
| Tail gate centre motor                      | 1         | malfunction     | 301.00                                  | 301.00     |
| Tail gate lamp rh                           | 1         | broken          |   | 561.00     |
| Tail gate windscreen moulding               | 1         | necessary       | 561.00                                  | 210.00     |
| Rear bumper                                 | 1         | deformed        | 210.00<br>1452.20                       | 1452.20    |
| Rear bumper side retainer rh                | 1         | damaged         |   |            |
| Rear bumper reflector rh                    | 1         | reuse           | 98.00                                   | 98.00      |
| Rear end panel                              | 1         |                 | 96.00                                   | 0.00       |
| Rear end panel side rh                      | 1         | repair          | 895.12                                  | 0.00       |
| Rear end panel top garnish                  | 1         | repair<br>reuse | 412.00                                  | 0.00       |
| Tail lamp rh                                | 1         | broken          | 226.00                                  | 0.00       |
| Tail lamp lower apron rh                    | 1         | bent            | 658.90                                  | 658.90     |
| Tail lamp panel rh                          | 1         |                 | 269.10                                  | 269.10     |
| rail lamp patier m                          | 1         | repair.respray  | 589.00                                  | 0.00       |
| St  | ub- Tota  | l cost          | 11544.92                                | 9326.80    |
| Percentage dis                              | scount:   | 25%             | 2886.23                                 | 2331.70    |
| Sub-To                                      | tal costs | s for parts     | 8658.69                                 | 6995.10    |
|   |           |                 |   |            |
| Special Nett Items:                         |           |                 |   |            |
| Rear bumper clips                           | set       | necessary       | 50.00                                   | 50.00      |
| Tail gate windscreen sealant                | 1         | necessary       | 60.00                                   | 60.00      |
|   | tal cost  | s for parts     | 110.00                                  | 110.00     |
| 342 10                                      | tur cost. | , je, pa        |   |            |
|   |           |                 |   |            |
| Parts Repair                                |           |                 |   |            |
| *   | *         | *               | 0.00                                    | 0.00       |
| Su  | b- Total  | costs           | 0.00                                    | 0.00       |
|   |           | or parts        | 8768.69                                 | 7105.10    |
| 1014  | 1 (03(3)  | or pures        | ======================================= |            |
|   |           |                 |   |            |

Subsidiaries of Impact Analysis Consultant:

<sup>●</sup> Impact Analysis Consulting Pte Ltd ● Impact Analysis Academy Pte Ltd ● IA Racking Solutions Pte Ltd

<sup>•</sup> IA Accounting & Consultancy Pte Ltd • Infolmights International Services (Philippines) • IABN Pte Ltd www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

21-8145

Date

22/9/2021

Page

3

### Section B: Labour Cost Calculation

| To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts. |    | rly rate | Manhr. Req. | Total |          |
|--|----|----------|-------------|-------|----------|
|  |    | 45.00    | 18          | \$    | 810.00   |
| Putty & Spray painting to adjacent panels. Job allowance. Paint / material.  |    | Sub-cont | tract work. | \$    | 900.00   |
| Apply rust proofing on the adjacent panels.  |    | Sub-cont | tract work. | \$    | 50.00    |
| Remove and refix tail gate windscreen (2 man-job)  | \$ | 45.00    | 3.5         | \$    | 157.50   |
| Transfer tailgate mechanism  | \$ | 45.00    | 2           | \$    | 90.00    |
| Conduct water leak test for rear portion associated repair works   | \$ | 45.00    | 1.5         | \$    | 67.50    |
| Wiring / bulb checking (inclusive of re-focus / re-adjust on angle of light intensity.)  | \$ | 45.00    | 0.8         | \$    | 36.00    |
|  |    | Total la | bour cost   | \$    | 2,111.00 |

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop' operating cost and in-house@ IA Research Guidelines respectively.

 <sup>●</sup> IA Accounting & Consultancy Pte Ltd
 ● Infoknights International Services (Philippines)
 ● IABN Pte Ltd www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

21-8145

Date

22/9/2021

## Section C: Summary Table of Total Repair Cost

| Description                                |                                  | Cost       |  |
|--|----------------------------------|------------|--|
| Asse                                       | ged Parts<br>ssment<br>ection A) | \$7,105.10 |  |
| Labour Cost Calculation<br>(See section B) |                                  | \$2,111.00 |  |
| Total cost                                 |                                  | \$9,216.10 |  |
| Lump sum repair                            |                                  |            |  |
| Further discount 20%                       |                                  | \$1,843.22 |  |
| Total Repair Cost                          |                                  | \$7,300.00 |  |

| We would recommend a sum oj        | \$7,300.00       | and                 | 5            | working days for repair. |
|------------------------------------|------------------|---------------------|--------------|--------------------------|
| No further items will be approved  | without our expr | essed written agree | ement. Any s | ignificant additional    |
| items will be subject to a supplem | entary report.   |                     |              |                          |

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma.Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

Enterprise Singapore - Recognised Certification for Management Consultants

IMI Professional Certificate In Vehicle Accident Damage Assessment (UK)

Subsidiaries of Impact Analysis Consultant:


Impact Analysis Consulting Pte Ltd
 Impact Analysis Analys











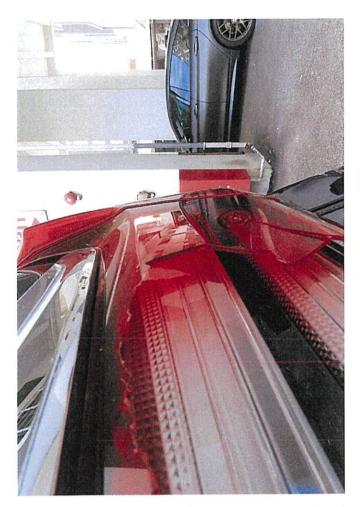




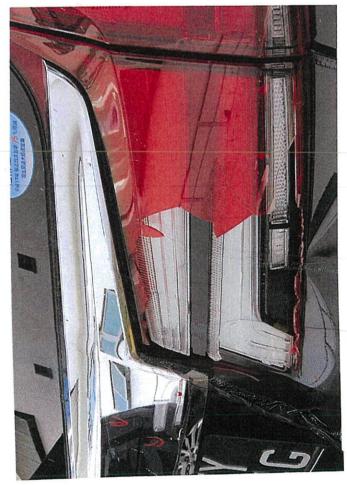




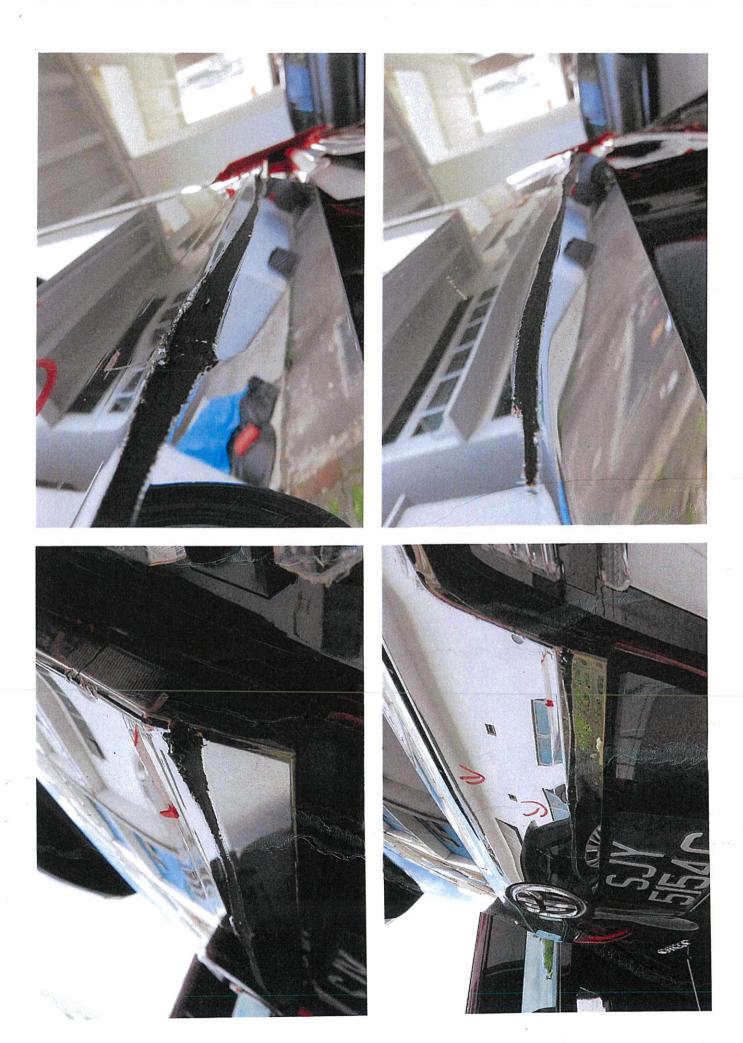


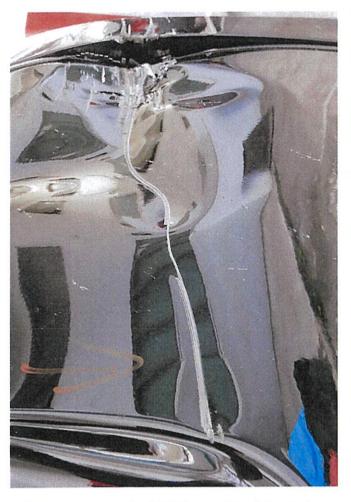





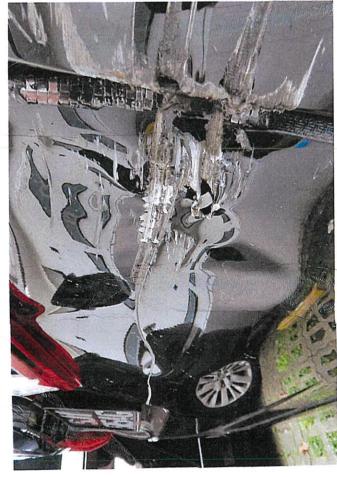

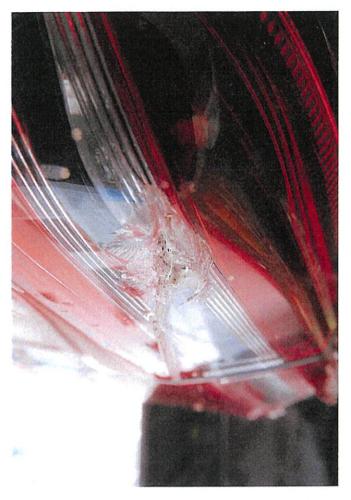












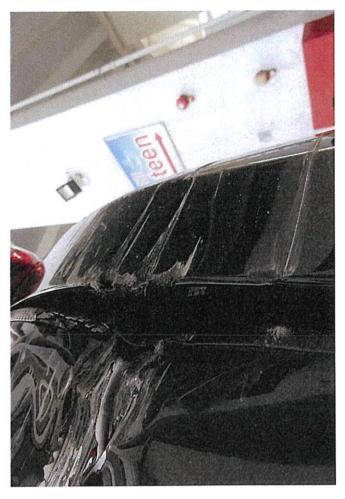







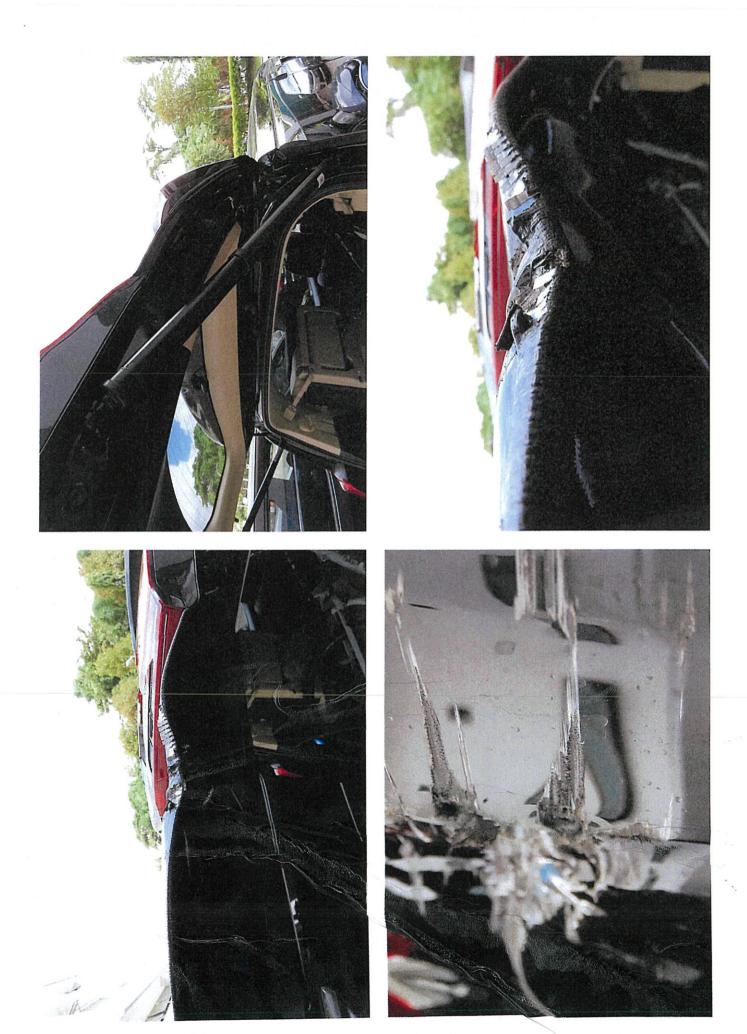


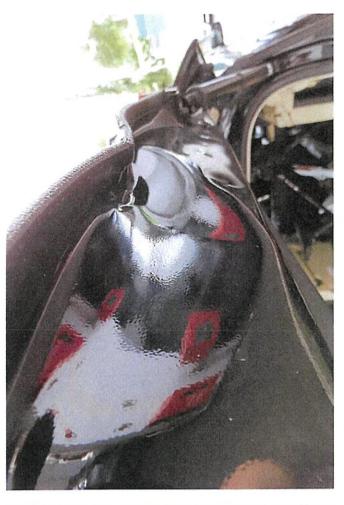

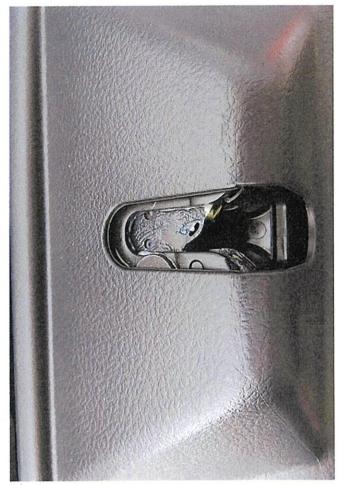



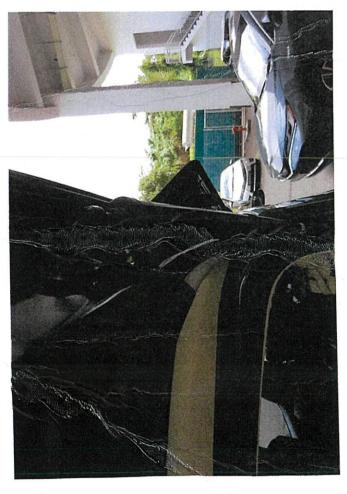

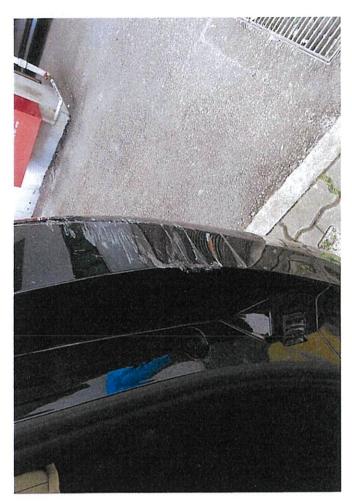


















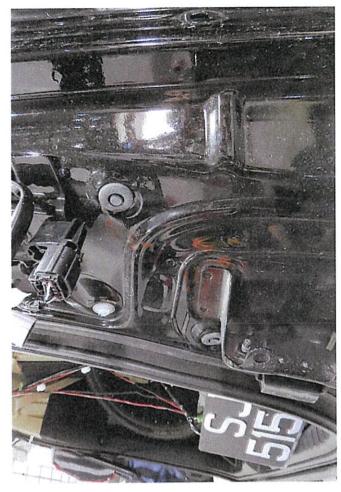



































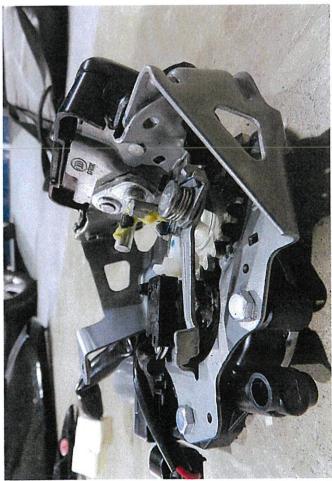





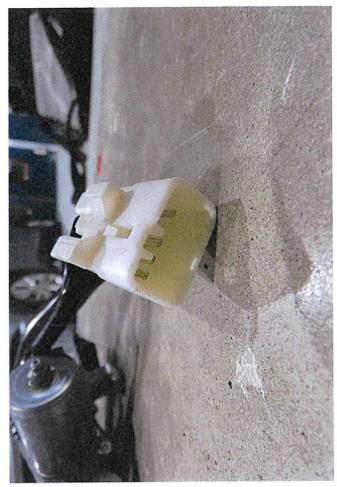



















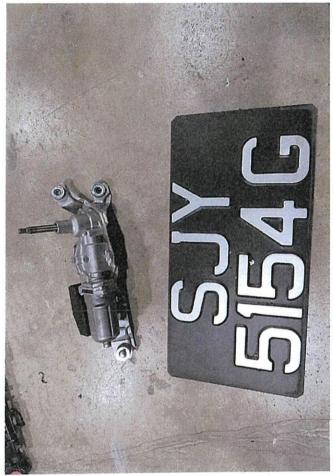

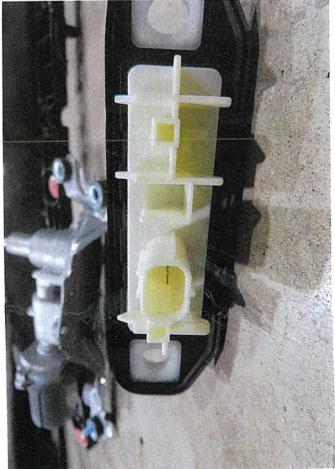


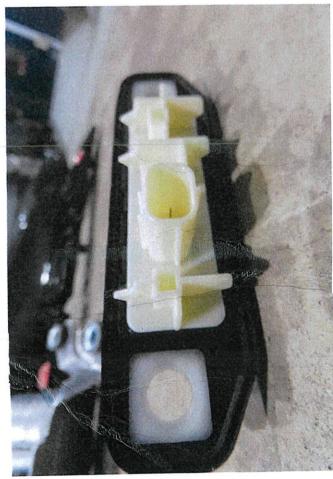


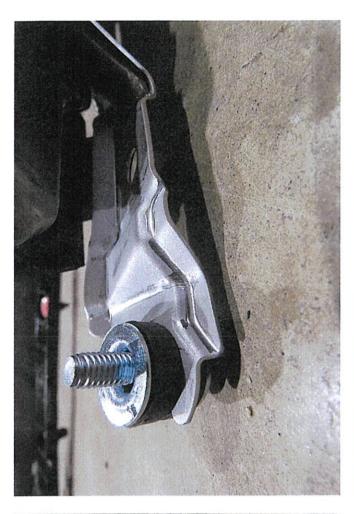






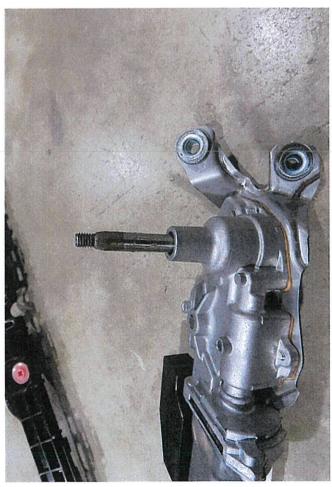


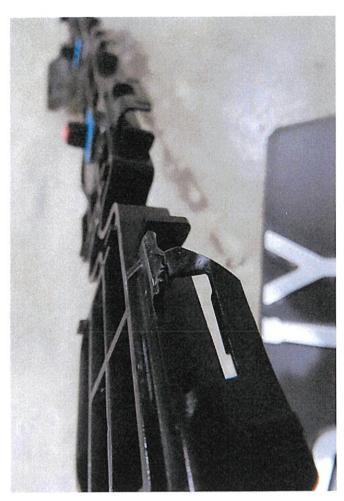






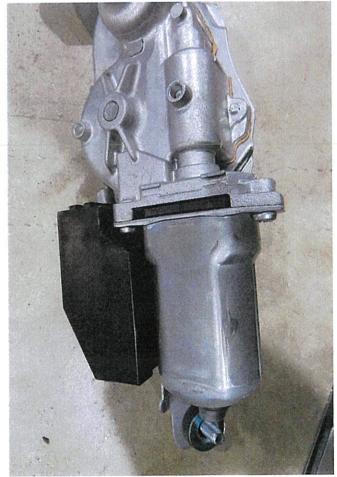

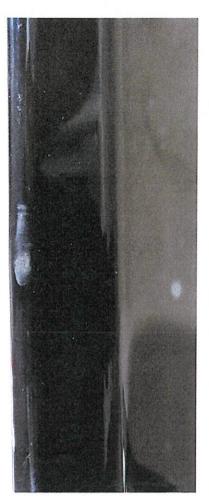





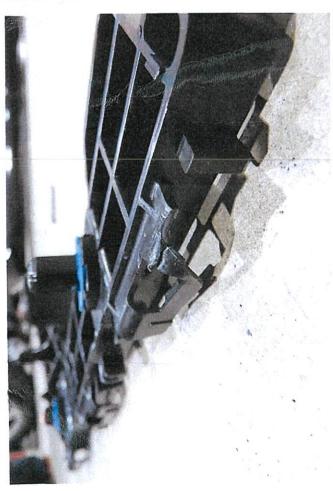

N07219F000K / NTUC Income Insurance Co-operative Ltd NTRY DATE & TIME: 15/99/2021 16:07 (SGT) USMITTED BY, Chen Jun Liang ERSION: 1 (15/09/2021 16/07 (SQT))



# SINGAPORE ACCIDENT STATEMENT

#### MPORTANT NOTICE

Please report correctly the details of the accident to speed up the claims process.

This Form must be completed by the Policyholder and/or the Authorised Dover

- Information provided must be as truthful and accurate as possible. Any withil misrepresentation or witholding of material facts may allow insurance companies to repudiate solicy kability.
- 1. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies

- 5. Any false reporting may be referred to the Police for investigation. 5. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving
- and that copies of this report will, for a fee, be made available upon application by interested parties.

  7. By the fodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission Date of Accident **Exact Location of Accident** Additional Location Information Country/State of Loss

15/09/2021 16:07 (SGT) 15/09/2021 12:47 (SGT) 201 Chestnut Ave. Singapore 679525

Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number

SJY5154G

INSURFO/POLICYHOLDER

Is company?

Name Of Registered Owner

NRIC No

Email Address

Mobile Phone No

Alternative Phone No.

No

MOHAMAD HAFIS BIN MOHAMED ALIFI

S8733844D

MD.HAFISMONGSTER@GMAIL.COM

(Phone) +65-92769021

+65-92769021

VEHICLE PARTICULARS

Manufacturer

Model

Variant

Exact purpose for which vehicle was being used at time of

Are you claiming under your own insurance policy for repair to your vehicle?

Vehicle Category

Transmission

CC

Toyota

Alphard

Private use

No - Claiming third party

Private car

Auto

2500

INSURANCE COMPANY

Name of Insurance Company

Type of Coverage

Fleet Policy

Policy Number

Cover Note Number

NTUC Income Insurance Co-operative Ltd

Comprehensive

5121991727

29/04/2021 - 28/04/2022

DRIVER

Name of Driver

NRIC No

MOHAMAD HAFIS BIN MOHAMED ALIFI S8733844D

Accident report CMATO LECANN

Once 1 of 11

27/10/1987 Date Of Birth Indoor Occupation 11/01/2008 Date Of Driving Pass 13 YEARS AND 8 MONTHS Driving experience Gender (Phone) +65-92769021 Mobile Number +65-92769021 Alt. Phone Number MD.HAFISMONGSTER@GMAIL.COM **Email Address** BLK 415B NORTHSHORE DRIVE #03-559 Address Address complement 822415 Postcode Yes Is the driver the policyholder? If No, Relationship of the Driver with the Insured No Does Driver Own Other Vehicles? Vehicle Registration Number of Other Vehicle Owned by Driver Insurance Company of Other Vehicle Owned by Driver GENERAL INFORMATION OF THE ACCIDENT Hit and run / Vandalism / Damaged whilst parked Type of Accident Clear Weather Conditions Road Surface Dry OTHER INFORMATION Was any foreign vehicle involved in the accident? No Number of vehicles involved in the accident 2 No Was anybody injured in the Accident? Was any injured conveyed to hospital by ambulance? Was any other vehicle or property damaged? Yes Number of Passengers (Including Driver) Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? DETAILS OF POLICE ACTION Was the accident reported to the police? No Was notice of intended Prosecution given? No If yes, against whom? CIRCUMSTANCES OF ACCIDENT REFER TO SKETCH PLAN ATTACHMENT(S) Are accident photos available for attachment? Yes Was there any video captured by Car Camera? Yes Reasons for not uploading a video of the accident FILE SIZE TOO LARGE

# DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number

Vehicle Manufacturer

Vehicle Model

Vehicle Variant

Vehicle Colour

Vehicle Category

Name of Driver

Contact Number

Address

YM8741C

Commercial

Commercial

Commercial vehicle

BORHAN

(Phone) +65-91816811

Was there any audio recorded?

| MILL    | Income Motor Service Center | 15 | 61 | 7.1  |
|---------|-----------------------------|----|----|------|
|         |                             | 13 |    | 5. I |
| H-18302 | No Mi fixe A                |    |    |      |

|              | Allen water | Y< 1 | 1546 |
|--------------|-------------|------|------|
| Vehicle No.  | 218         | 11   |      |
| Make Medil , | 7/1         | Mu   | 16   |

| Report Date: 13 9 202 | Son Time 4:00 PM |
|-----------------------|------------------|
| 10 m                  |                  |
| Proportion France 1.4 | End Frese        |

#### SKETCH PLAN

#### IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- Information provided must be as truthful and accurate as possible. Any withit misrepresentation or withholding of material facts
  may slick insurance companies to regulate policy liability.
- The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies
- 5 Any false reporting may be referred to the Police for investigation.
- 6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the indigement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that :

- (a) My insurer, any workshop and the General insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal deta/personal information solve in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insureris) who have insured vehicle(s) involved in this accident (all insureris) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers lawverslaw firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purposets) of :
  - ii) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - res investigating the accident antior my claims:
  - (iii) conving out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the elemanders of environmental packages); anticer
  - (v) complising with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) also have insured vehicle(s) involved in this accident and the insurers lawyers/law firms, maylare permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal information may/can be disclosed by any of the finances and/or GIA to their third party service providers or agents (including their tawyers/taw firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) say Personal information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) so as insurers ansitar any other than parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonable required for the purposes stated, or

15/9/2021 15:55


rin for complying with requirements under any regulations, law or court orders.

AS 0 2021 15:50

Oriver's Signature (if driver is not the policyholder) Oate & Time: Reporting Centre Personnel's Signature Name: Chen JunLiang NRIC! Fin No: \$990765

Percyholder's Signature Date & Time

A.

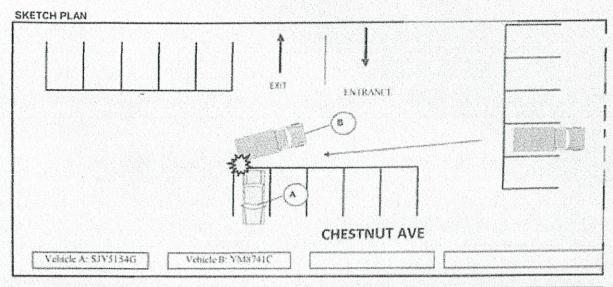

MY VEHICLE WAS PARKED HEAD-IN INTO ONE CARPARK LOT. EVERYTHING WAS FINE AND INTACT WHEN I LEFT AND LOCKED MY VEHICLE. AS I RETURNED TO MY VEHICLE AND WAS AT A NEARBY WASHING BAY TO CLEAN UP MY BICYCLE, I SAW THAT VEHICLE B WAS REVERSING OUT FROM HIS CARPARK LOTAS VEHICLE B DRIVER WAS MAKING A LEFT TURN TO EXIT OUT, VEHICLE B REAR RIGHT PORTION HIT ONTO MY PARKED VEHICLE REAR PORTION. NO ONE WAS INJURED.

## DECLARATION

style secure the foregoing particulars are true in every respect.

15/9/2021 15:59

Onwer's Signature (If driver is not the policyholder) Date 8. Time: Reporting Centre Personner's Signature Name: Chen Amtiang

NR:C/ Fin No. 5990765

13/9/2021 15:59

Policyholder's Signature Date & Time:

Address complement
Postcode
Insurance Company Name
Potone Of Damage
Details of property damaged in accident
No. Of Passenger (accluding Driver)

# REAR RIGHT PORTION

25.00