

Kenneth

SLC 23714 Yr Regn: 07, 16

Veh No: 562 23 F19 Yr Regn: 0 F1 16

Type: ☒ M.Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or

Make: Honda Verano C.C. 1496

Colour M. Black A/C: Insured / Std / NI / NA

Sp. Reading T/Ratio: Insured / Std / NI / NA

Eng/No:

C/No: BU. 111423

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: NII / S/Rlm / STD ~~A/Rlm~~ or

Tyre Size: Roadstone 215/60R15

R: Arct 7 P

N/S	O/S

Front

R/Bal. 2 mm

Rear

R/Ba! mm

U/Bal. 2 mm

D.O.A. 28/8/20 D.O.I. 5/11/2021

Vehicle: IN / OUT

Survey held at

Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis-frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
1	Berkey Plot 1-11 @ 28,2413.00

☐: Prell. Report

1) : Final Report

Date/Time. File Return to?

27

Report Format :

Lump Sum / I.B.I: (S

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

5 - RS. SI

1. Explain

Others

TOTAL

Add Fee: ☐ : Site Insp (\$

☐: Interview (S

[illegible]

☐ Weekend (\$

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645



Insurer Reference:
Repairer Reference: 042837
Date calculated: 16/08/2021 4:32 PM

Full Report
Registration: SLE2371Y
Printed: 16/08/2021 4:33 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	29/08/20
Estimated Repair Time:	15	Hire Car Start:	
Actual Repair Days:	15	Hire Car End:	

Vehicle Details

Vehicle	
Manufacturer:	HONDA
Model:	VEZEL RU1/5
Sub Model:	LX
Model Sheet Number:	35 VE 08
Registration:	SLE2371Y
VIN number:	
Odometer:	
Model Specs	
FROM MODEL 2018	MIRROR WITH TIP FUNC
HEAD AIRBAG	ULTRASONIC PARK SYS
	1496CCM 97KW

*Not Authorized
L/R by @ 2, 7, 16, 20, 21
Return After Paint
Ex \$2000.*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

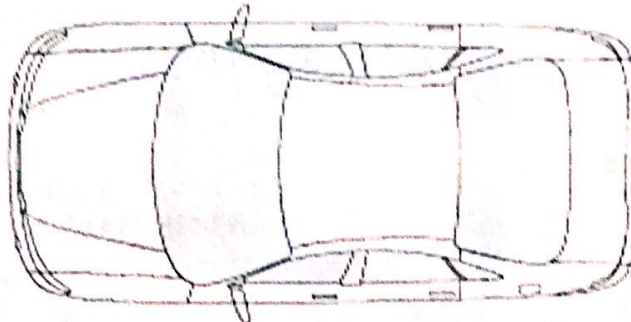

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
4213A7	ALIGN FRONT TOE		4.0	16.80
NO NUMBER	RENEW FRONT PANEL		32.0	134.40
NO NUMBER	RENEW L/INNER A-PILLAR		28.0	117.60
NO NUMBER	RENEW L/INNER B-PILLAR		30.0	126.00
8101A2E	RENEW FRONT BUMPER		15.0	63.00
813110)	RENEW RADIATOR GRILLE		4.0	16.80
812100	RENEW BONNET		11.0	46.20
	INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE			
8121B6)	R + R L/BONNET SEAL		3.0	12.60
8121B7)	R + R R/BONNET HINGE		3.0	12.60
NO NUMBER	R + R BOTH FRONT WINGS (BUMPER REMOVED)		17.0	71.40
	INCLUDES: R + R FRONT HEADLAMPS, SILL COVER AND REQUIRED ATTACHED PARTS.			
831120	R + R WINDSCREEN		26.0	109.20
	INCLUDES: FRT AIR GRILLE, WIPER ARM AND			

Code	Description	WU	Price SGD
7421B0)	REQUIRED TRIMS REMOVE AND REFIT	2.0	8.40
7521A5)	R + R WASHER RESERVOIR	1.0	4.20
842100)	R + R L/HEAD AIRBAG	9.0	37.80
8351C2	R + R HEADLINING	4.0	16.80
8151A0	R + R L/F UPPER DOOR FRAME SEAL	34.0	142.80
	RENEW L/F DOOR		
	INCLUDES: R + R LEFT FRONT DOOR,	2.0	8.40
	ATTACHED PARTS REFIT AND IF NECES RENEW.	1.0	4.20
	ADJUST L/F DOOR.	32.0	134.40
818107	R + R L/F DOOR STRIKER PLATE		
8151B0)	R + R LEFT FRONT DOOR HINGE		
8211A0	RENEW L/R DOOR		
	INCLUDES: R + R LEFT REAR DOOR,		
	ATTACHED PARTS REFIT AND IF NECES RENEW.		
	ADJUST L/R DOOR.	1.0	4.20
8211B0)	R + R LEFT REAR DOOR HINGE	2.0	8.40
818109	R + R L/R DOOR STRIKER PLATE	2.0	8.40
844100)	R + R R/F DOOR TRIM	2.0	8.40
820120)	R + R RIGHT MIRROR	3.0	12.60
811B7	R + R LEFT UPPER B-PILLAR TRIM	3.0	12.60
8571B8	R + R RIGHT UPPER B-PILLAR TRI	2.0	8.40
8491A8)	R + R L/UPPER C-PILLAR TRIM	2.0	8.40
8491A9)	R + R R/UPPER C-PILLAR TRIM	2.0	8.40
848140	R + R REAR END PANEL TRIM	31.0	130.20
841100 ZAX	RENEW DASHBOARD	3.0	12.60
754110)	R + R PASSENGER AIRBAG	3.0	12.60
612100)	R + R HEATER BLOWER	3.0	12.60
710100	R + R BATTERY	4.0	16.80
118130)	R + R DRIVE BELT	2.0	8.40
1211E1	R + R AIR FILTER INTAKE PIPE	9.0	37.80
112101	R + R RIGHT ENGINE BRACKET	5.0	21.00
1121E5	R + R REAR ENINGE MOUNTING	10.0	42.00
114100)	R + R RADIATOR	1.0	4.20
1151A2)	R + R L/FAN MOTOR	1.0	4.20
6171A5)	R + R RIGHT RADIATOR FAN MOTOR	1.0	4.20
1151A1)	R + R L/FAN BLADE	1.0	4.20
6171A8)	R + R RIGHT RADIATOR FAN BLADE	2.0	8.40
616100)	R + R CONDENSER	3.0	12.60
616156)	R + R CONDENSER-EVAPORATOR HOSE	5.0	21.00
616185)	R + R CONDENSER-/COMPRESSOR HOSE	8.0	33.60
6161C2)	RENEW AIR CONDITIONING COMPRESSOR	7.0	29.40
620020	DRAIN + REFILL AIR CONDITIONING	1.0	4.20
NO NUMBER	DETACH + REFIT L/FR BRAKE CALIPER	1.0	4.20
NO NUMBER	DETACH + REFIT R/FR BRAKE CALIPER	15.0	63.00
416175)	RENEW FRONT AXLE SUPPORT	9.0	37.80
5131C0)	RENEW STEERING GEAR	4.0	16.80
416117)	R + R BOTH FR/LOWER CONTROL ARMS	4.0	16.80
NO NUMBER	R + R LEFT FRONT SHOCK ABSORBER	4.0	16.80
NO NUMBER	R + R RIGHT FRONT SHOCK ABSORBER	4.0	16.80
414125)	DIS + ASS L/F SHOCK ABSORBER/COIL SPRING	3.0	12.60
414130)	DIS + ASS R/F SHOCK ABSORBER/COIL SPRING	3.0	12.60
4151A8)	RENEW L/F STEERING KNUCKLE	15.0	63.00
4151A7)	RENEW R/F STEERING KNUCKLE	15.0	63.00
219131)	R + R LEFT FRONT DRIVE SHAFT CPL	6.0	25.20
219132)	R + R RIGHT FRONT DRIVE SHAFT CPL	3.0	12.60

Code	Description		WU	Price SGD
4211A6	R + R L/F WHEEL		2.0	8.40
4211A6	R + R R/F WHEEL		2.0	8.40
4211F3)	R + R AND BALANCE L/F TYRE		4.0	16.80
4211F4)	R + R AND BALANCE R/F TYRE		4.0	16.80
Labour Cost				
	Panel / Mechanical Labour Alignment	Hrs 46.70	WU 467.0	1,961.40
	Measuring Work	0.40	4.0	16.80
Total of Labour				1,978.20

Paint

Paint Work

		SYSTEM AZT	Time Basis 10 WU/h
Code	Description		WU Price SGD
	BONNET NEW PART PAINTING		19.0
	L/F WING NEW PART PAINTING		9.0
	R/F WING NEW PART PAINTING		9.0
	FRONT PANEL CPL SURFACE PAINT		5.0
	LEFT FRONT DOOR NEW PART PAINTING		16.0
	L/R DOOR NEW PART PAINTING		14.0
	L/INNER A-PILLAR SURFACE PAINT		5.0
	L/INNER B-PILLAR SURFACE PAINT		5.0
	FRONT LOWER BUMPER NEW PART PAINT K1R		5.0
	FRONT BUMPER NEW PART PAINT K1R		8.0
	FRT TOWING EYE COVER NEW PART PAINT K1R		3.0
	L/F DOOR OUT HANDLE NEW PART PAINT K1R		3.0

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	51.18
0741	L/F WING NEW PART PAINTING	12.49
0742	R/F WING NEW PART PAINTING	12.49
1009	FRONT PANEL CPL SURFACE PAINT	7.92
1481	LEFT FRONT DOOR NEW PART PAINTING	38.69
1561	L/R DOOR NEW PART PAINTING	32.24
2265	L/INNER A-PILLAR SURFACE PAINT	5.28
2287	L/INNER B-PILLAR SURFACE PAINT	6.16
0282	FRONT LOWER BUMPER NEW PART PAINT K1R	11.17
0283	FRONT BUMPER NEW PART PAINT K1R	30.71
0300	FRT TOWING EYE COVER NEW PART PAINT K1R	0.35
1565	L/F DOOR OUT HANDLE NEW PART PAINT K1R	0.70

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor			
Time Paint	42.00 SGD/h		
Preparation Main Work Metal	0.80	8.0	33.60
Preparation Comp. Work Plastic	0.30	3.0	12.60
Total	10 WU/h	11.20	112.0

Material Cost - Paint

New Part Painting	147.09
New Part Painting - Plastic K1R	42.93
Surface-/Blend Paint	19.36
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	236.48

Price SGD

147.09

42.93

19.36

18.10

9.00

236.48

Spare Parts

prices as at 2015-06-01/01

Code	Description	Part Number	Part Source	Price SGD	
0282	FRONT LOWER BUMPER	71102T7AJ20	Original	mis 145.00	✓
0283	FRONT BUMPER	04711T7AJ00ZZ	Original	mis 310.00	✓
0300	FRT TOWING EYE COVER	71104T7AJ00ZH	Original	mis 25.00	✓
0340	FRT BUMPER SUPPORT	71130T7AJ00ZZ	Original	mis 220.00	✓
0343	L/BUMPER CORNER	71190T7AJ00	Original	mis 35.00	✓
	BRKT				
0344	R/BUMPER CORNER	71140T7AJ00	Original	mis 35.00	✓
	BRKT				
0345	L/F AIR DUCT	71116T7AJ00	Original	mis 45.00	✓
0346	R/F AIR DUCT	71111T7AJ00	Original	mis 45.00	✓
0351	LOWER FRONT GRILLE	71103T7AJ00	Original	mis 60.00	✓
0391	FRONT SPOILER	71110T7AJ00	Original	mis 120.00	✓
0410	GRILLE	71121T8NQ50	Original	mis 240.00	✓
0411	UP/CVR RADIAT GRILLE	71123T8NT00	Original	mis 145.00	✓
0413	RAD GRILLE BRACKET	71150T7AJ00	Original	mis 30.00	✓
0414	RAD GRILLE BRACKET	71125T7AJ01	Original	mis 30.00	✓
0415	L/RAD-GRILLE BRACKET	71152T7AJ00	Original	mis 25.00	✓
0416	R/RAD-GRILLE BRACKET	71151T7AJ00	Original	mis 25.00	✓
0424	RAD GRILLE COVER	71122T7AJ01	Original	mis 30.00	✓
0425	L/HEADLAMP TRIM	71168T7AJ01	Original	mis 25.00	✓
0426	R/HEADLAMP TRIM	71163T7AJ01	Original	mis 25.00	✓
0431	GRILLE BADGE	75700T5A000	Original	mis 25.00	✓
0471	BONNET	60100T7A000ZZ	Original	mis 450.00	✓
0475	L/BONNET HINGE	60170T7AG00ZZ	Original	mis 35.00	✓
0476	R/BONNET HINGE	60120T7AG00ZZ	Original	mis 35.00	✓
0481	BONNET INSULATION	74141T7A000	Original	mis 80.00	✓
0492	BONNET LOCK	74120T7WA01	Original	mis 78.00	✓
0495	BONNET STAY	74145T7A000	Original	mis 45.00	✓
0496	L/BONNET SEAL	74192T7A000	Original	mis 30.00	✓
0512	R/BONNET SEAL	74142T7A000	Original	mis 30.00	✓
0515	FRONT BONNET SEAL	74146T7A900	Original	mis 40.00	✓
0561	L/F HEADLAMP CPL	33150T7SE51	Original	mis 1,100.00	✓
0562	R/F HEADLAMP CPL	33100T7SE51	Original	mis 1,100.00	✓
0637	L/F FOG LAMP	71108T7AJ00	Original	mis 140.00	✓
0638	R/F FOG LAMP	71107T7AJ00	Original	mis 140.00	✓
0649	L/F BUMPER COVER	71106T7WA00	Original	mis 35.00	✓
0650	R/F BUMPER COVER	71105T7WA00	Original	mis 35.00	✓
0741	L/F WING	60260T7AJ00ZZ	Original	mis 220.00	✓
0742	R/F WING	60210T7AJ00ZZ	Original	mis 220.00	✓
0787	L/WING MOULDING	74157T7B003	Original	mis 60.00	✓
0788	R/WING MOULDING	74107T7B003	Original	mis 60.00	✓
0841	L/F WHEELHOUSE COVER	74150T7A900	Original	mis 80.00	✓
0842	R/F WHEELHOUSE COVER	74100T7A900	Original	mis 80.00	✓

Code	Description	Part Number	Part Source	Price SGD	
1009	FRONT PANEL CPL	60400T7A901ZZ	Original	480.00	✓
1395	COWL	74200T7A010	Original	220.00	?
1401	WINDSCREEN	73111T7YY01	Original	1,850.00	✓
1411	WINDSCREEN BOND KIT	KNGKWI2		0.00	
1413	FRT SCREEN MNTG KIT	91568TF0003		0.00	
1415	L/WINDSCREEN MLDG	73125T7A003	Original	20.00	✓
1416	R/WINDSCREEN MLDG	73125T7A003	Original	20.00	✓
1423	LWR FRT SCREEN SEAL	77466SV4000	Original	45.00	✓
1432	UPP WINDSCREEN MLDG	73150T7A003	Original	45.00	✓
1435	FILLER NECK	76805T7A003	Original	45.00	✓
1436	WASHER RESERVOIR	76841T5A003	Original	155.00	✓
1437	W-SCREEN WASHER PUMP	76846TF0013	Original	90.00	✓
1443	WASHER RESERVOIR CAP	76802SK7003	Original	35.00	✓
1481	LEFT FRONT DOOR	67050T7A300ZZ	Original	580.00	✓
1487	L/F UPPER DOOR HINGE	67450T5A003ZZ	Original	55.00	✓
1495	L/F LOWER DOOR HINGE	67460T5A003ZZ	Original	55.00	✓
1505	L/F DOOR CHECK	72380T7A003	Original	45.00	?
1509	L/F DOOR SEAL	72364T7A003	Original	65.00	?
1511	L/F LOWER DOOR SEAL	72366T7AJ01	Original	55.00	?
1513	L/ROOF SEAL	72365T7A003	Original	90.00	✓
1515	L/F DOOR SEAL REAR	72367T7AJ01	Original	75.00	?
1519	L/F DOOR WINDOW	73350T7AN21	Original	350.00	✓
1547	L/WINDOW REGULATOR	72250T7A003	Original	310.00	✓
1565	L/F DOOR OUT HANDLE	72180T5A003ZP	Original	160.00	✓
1577	L/F DOOR LOCK	72150T0AJ11	Original	85.00	✓
1581	L/F STRIKER PLATE	72135SDAA01	Original	35.00	?
1597	L/F WINDOW CHANNEL	72275T7A003	Original	120.00	✓
1609	L/R GUIDE RAIL	72271T7A003	Original	55.00	?
1655	L/F DOOR STRIPE	67366T7AJ01	Original	65.00	✓
1661	L/F WINDOW MOULDING	72450T7A003	Original	45.00	✓
1737	L/DOOR MIRROR	76258T7AJ02	Original	520.00	✓
1738	R/DOOR MIRROR	76208T8CT01	Original	520.00	X
1781	L/R DOOR	67550T7A305ZZ	Original	580.00	✓
1787	L/R UPPER DOOR HINGE	67950T2AH11ZZ	Original	55.00	✓
1795	L/R LOWER DOOR HINGE	67960T2AH11ZZ	Original	55.00	✓
1805	L/R DOOR CHECK	72880T7A003	Original	45.00	?
1809	L/R DOOR SEAL	72865T7A003	Original	65.00	?
1875	L/R DOOR OUT HANDLE	72680T7WA01	Original	170.00	✓
1877	L/R DOOR LOCK	72650T0AH01	Original	85.00	✓
1881	L/R STRIKER PLATE	72135SDAA01	Original	35.00	?
1947	L/R DOOR FRT MLDG	67865T7AJ01	Original	70.00	✓
1961	L/R WINDOW MOULDING	72950T7A003	Original	55.00	?
2265	L/INNER A-PILLAR	64515T8NT00ZZ	Original	320.00	X
2287	L/INNER B-PILLAR	64620T7A300ZZ	Original	350.00	✓
4325	PASSENGER AIRBAG	77820T7AJ80	Original	1,500.00	✓
4331	INSTRUMENT PANEL	77100T7A000ZA	Original	600.00	✓
4381	L/INSTR PANEL COVER	77216T7A003ZA	Original	90.00	?
4382	R/INSTR PANEL COVER	77211T7A003ZA	Original	90.00	?
4455	AIR CON COMPRESSOR	388105R0004	Original	900.00	?
4465	CONDENSER	80110T7A003	Original	420.00	✓
4481	COND/COMPRESSOR HOSE	80315T7A003	Original	180.00	?
4482	COND/EVAPORATOR PIPE	80341T7AJ01	Original	185.00	?

Code	Description	Part Number	Part Source	Price SGD	
4621	L/ITS HEAD AIRBAG	78875T7AH00	Original	1,250.00	✓
4941	L/UPP A-PILLAR TRIM	84151T7AJ01ZA	Original	150.00	✓
7011	FRT ASSEMBLY SUPPORT	50200T7A023	Original	560.00	?
7035	L/F DRIVE SHAFT	44306T7YT93	Original	760.00	?
7036	R/F DRIVE SHAFT	44305T7YT93	Original	760.00	?
7053	L/LOWER CONTROL ARM	51360T7JH01	Original	195.00	✓
7054	R/LOWER CONTROL ARM	51350T7JH01	Original	195.00	✓
7081	L/F STEERING KNUCKLE	51216T7A000	Original	190.00	✓
7082	R/F STEERING KNUCKLE	51211T7A000	Original	190.00	✓
7087	L/FR SHOCK ABSORBER	51621T7MH02	Original	220.00	?
7088	R/FR SHOCK ABSORBER	51611T7MH02	Original	220.00	?
7091	L/SUPPORT BEARING	51688T7A003	Original	25.00	✓
7092	R/SUPPORT BEARING	51688T7A003	Original	25.00	✓
7131	L/F WHEEL HUB	44600T0BA00	Original	95.00	?
7132	R/F WHEEL HUB	44600T0BA00	Original	95.00	?
7201	L/FR WHEEL	42700T8CT91	Original	350.00	✓
7202	R/FR WHEEL	42700T8CT91	Original	350.00	✓
7227	L/FR TYRE	215/60 R 16 .. H	Original	300.00	✓
7228	R/FR TYRE	215/60 R 16 .. H	Original	300.00	✓
7261	FRONT STABILISER	51300T7A003	Original	240.00	?
7271	L/F OUT STABI MNTG	51325T7A003	Original	40.00	?
7272	R/F OUT STABI MNTG	51320T7A003	Original	40.00	?
7300	STEERING GEAR	53400T7AJ03	Original	900.00	?
7311	L/TIE ROD BALL JOINT	53560T7J003	Original	55.00	?
7312	R/TIE ROD BALL JOINT	53540T7J003	Original	55.00	?
7417	COMBINATION SWITCH	35251T5AB02	Original	220.00	?
7437	L/F AIRBAG SENSOR	77930T6AJ21	Original	135.00	✓
7438	R/F AIRBAG SENSOR	77930T6AJ21	Original	135.00	✓
7442	CONTACT RING	77900T5AJ01	Original	660.00	✓
7445	DRIVER AIRBAG	77810T9AT82ZA	Original	1,150.00	✓
7751	L/UPP RADIATOR BRKT	74176T7A000	Original	35.00	✓
7752	R/UPP RADIATOR BRKT	74171T7AJ00	Original	35.00	✓
7761	RADIATOR	1901050T902	Original	860.00	✓
7764	RADIATOR COVER	19045PWA004	Original	20.00	✓
7767	L/FAN SHROUD	1901550T901	Original	90.00	✓
7768	R/FAN SHROUD	38615R1AA02	Original	70.00	✓
7773	LWR RADIATOR HOSE	1950250T901	Original	60.00	?
7776	UPPER RADIATOR HOSE	1950150T901	Original	55.00	?
7787	EXPANSION TANK	19101R1AA00	Original	65.00	✓
7799	L/FAN MOTOR	19030R1AA03	Original	220.00	✓
7790	R/FAN MOTOR	38616R1AA01	Original	210.00	✓
7793	L/RADIATOR FAN	19020R1AA01	Original	50.00	✓
7794	R/RADIATOR FAN	38611R1AA02	Original	50.00	✓
8665	R/ENGINE BRACKET	50620T7A003	Original	120.00	?
8673	R/ENG MNTG BRACKET	50690T7A003	Original	125.00	?
8674	REAR SILENTBLOCK	50890T5A003	Original	135.00	?
8679	R/SILENTBLOCK	50822T5RA01	Original	80.00	?
8780	ENGINE INSULATION	74111T7A000	Original	115.00	?
9629	BATTERY	31500TT2Q11	Original	150.00	?
9631	BATTERY TRAY	31521T9P000	Original	25.00	?
9632	BATTERY PROTEC COVER	31531T5A003	Original	20.00	?
9647	HIGH TONE HORN	38150T7AJ01	Original	120.00	?

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal

0.00
30,443.00

Total**30,443.00****Extras**

Code	Description	Price SGD
1000	HEADLAMP MODULE RH HEADLAMP MODULE	145.00* 7
1001	HEADLAMP MODULE LH HEADLAMP MODULE	145.00* 7
1002	ECU REPROGRAMMING ECU REPROGRAM	25d 450.00*
Total Extras		740.00

Final Calculation

	SGD	SGD
Parts	30,443.00	
Total Parts		30,443.00 ✓
Labour Time Base 10 WU/h		
Total 467.0 WU X 42.00 SGD/h	1,961.40	
Alignment	16.80	
Measuring Work		1,978.20
Total of Labour		740.00 ✓
Total Of Extras		
Paint Work Time Base 10 WU/h		
Labour Cost 112.0 WU X 42.00 SGD/h	470.40	
Material Cost	236.48	
Total Paint Including Material		706.88
		33,868.08
Repair Cost Excludes GST		2,370.77
GST (+7.0%)		36,238.85
Repair Cost Included GST		

Comments

USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	13/08/2021 18:03 (SGT)
Date of Accident	29/08/2020 00:00 (SGT)
Exact Location of Accident	Zion Rd, Singapore
Additional Location Information	55 ZION ROAD SINGAPORE 247780
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLE2371Y
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	RABBIT CAR RENTAL PTE LTD
Company Reg No	2XXXXX547M
Email Address	LUSIONT96@GMAIL.COM
Mobile Phone No	(Phone) +65-90396265
Alternative Phone No	(Office) +65-90396265

VEHICLE PARTICULARS

Manufacturer	Honda
Model	Vezel
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private hire
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private hire
Transmission	Auto
CC	1496

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMHCSNA00004272000
Cover Note Number	-

DRIVER

Name of Driver	RAFIZ BIN ABDUL LAJIS
NRIC No	SXXXX991J